

Cisco ASR 920 Series Aggregation Services Routers - System Messages Guide

Revised: August 31, 2017

Overview of System Messages

Use this document together with the tools and utilities that are available on Cisco.com on this page:

http://www.cisco.com/c/en/us/support/index.html

- Cisco Technical Assistance Center (TAC): https://mycase.cloudapps.cisco.com/case
- Bug Search Tool link: https://bst.cloudapps.cisco.com/bugsearch/

Note: When contacting TAC, please have available the nonzipped, plain-text (.txt) output of the show logging and show tech-support commands, as well as any pertinent troubleshooting logs.

System messages can be grouped into these categories:

 System Event Messages—Describe the system and error messages that are generated for events related to the Cisco platform, and its hardware and software components.

System error messages begin with a percent sign (%) and are structured as follows:

%FACILITY-SUBFACILITY-SEVERITY-MNEMONIC: Message-text

System error messages contain the following components:

- FACILITY is a code indicating the platform or other component that is generating the message.
- SEVERITY is a number that reflects the significance of the error message. All error messages have a Cisco severity number that ranges from 0 to 7. The lower the number, the more serious the situation. This table describes the possible severity levels and their meanings.

Cisco		
Level	Class	Description
0	Emergency	The system has become unusable and requires immediate attention. This problem might also be affecting other parts of the network.
1	Alert	Some type of system or connection failure has occurred and requires immediate attention.
2	Critical	An error occurred that requires immediate attention to avoid system or connection failure.
3	Error	An error condition occurred that requires attention to resolve. Failure to address this problem will result in some type of system or connection failure in the near future.

System Messages Description

Cisco		
Level	Class	Description
4	Warning	A condition occurred that indicates attention is needed in near future to avoid potential problems. Failure to address this problem could result in some type of system or connection failure later on.
5	Notice	A situation occurred that is normal but is significant enough that system administrators might want to notice.
6	Informational	An information message that might or might not be significant to the system administrators.
7	Debug	Messages that appear only while debugging is turned on.

- MNEMONIC is a string that uniquely identifies the error message. Error messages are usually organized and referred to by their mnemonic value.
- The Message-text is a string that provides details about the particular error. This string can include specifics about cable interface, IP or MAC addresses, and other information. In this document, the specific information is presented by variable fields that are indicated by square brackets ([]). A decimal number, for example, is represented as [dec].

System Messages Description

B

BIPC

```
%BIPC-3-BIPC PERFORMANCE : buffer size request [int] failed
```

Explanation An internal buffer allocation has failed.

Recommended Action No action is required. If the problem persists, or router performance is noticeably degraded, contact Cisco technical support. Copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at https://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

BIPCMGR

```
%BIPCMGR-3-INVALID_TDL_ERROR_ON_MARSHAL : TDL epoch error on marshal [dec] unex-
pected: [chars]
```

Explanation The bipc manager has attempt to marshal a message to be sent. The tdl library has generated an error on marshal that is unexpected. The message was not sent.

Recommended Action This is unexpected. Report this to Cisco TAC

В

BOOT

```
%BOOT-0-APP STARTFAILCRIT : Failed to launch a critical process [chars]
```

Explanation A process important to the chassis has failed.

Recommended Action Note the time of the message and investigate the error message logs to learn more about the problem. If the problem persists or cannot be resolved, copy the error message and the output of show platform software tech-support into a plaintext file and contact Cisco technical support.

```
%BOOT-0-DRV INITFAIL : [chars] driver failed to initialize properly
```

Explanation A kernel driver that is critical to the functioning of the system failed to initialialize properly.

Recommended Action Note the time of the error message and check the kernel error logs for additional information on the problem. If you are unable to resolve this problem, copy the error message and the output of show platform software tech-support into a plaintext file and contact Cisco technical support.

```
%BOOT-0-DRV LOADFAIL : Failed to load driver [chars] ( [chars] )
```

Explanation A kernel driver that was critical to the functioning of the system failed to load.

Recommended Action Note the time of the error message and check the kernel error logs for additional information on the problem. If you are unable to resolve this problem, copy the error message and the output of show platform software tech-support into a plaintext file and contact Cisco technical support.

```
%BOOT-3-APP STARTFAIL : Failed to launch process [chars]
```

Explanation A process that does not affect the forwarding of network traffic failed to start.

Recommended Action If the failed process is not something that needs to be corrected, do not address this message. If the failed process needs to be addressed, install new software and reload the router.

```
%BOOT-3-BOOTTIME_INCOMPATIBLE_SW_DETECTED : Incompatible software detected. Details: [chars]
```

Explanation Incompatible software is detected on target fru/chassis.

Recommended Action Upgrade manually or check auto-upgrade configuration.

```
%BOOT-3-BOOTTIME_SMU_MISSING_DETECTED : SMU file [chars] missing and system impact will be unknown
```

Explanation SMU file not found during bootup.

Recommended Action System will be running without the fix from the SMU

%BOOT-3-BOOTTIME_SMU_RUN_CORRECTION_FAILED: Failed to correct the SMU mismatch between the running version on active and [chars]. Pls abort the smu installation using 'install abort'

В

Explanation The system tried to recover from the missmatch, but failed. Engineer intervention is required

Recommended Action Get the 'show install log' and the btrace logs from active and standby

%BOOT-3-BOOTTIME_SMU_SYNC_FAILED: Failed to copy the SMUs to switch [chars]. Reload cancelled and switch will be declared incompatible

Explanation SMU sync failed on newly joined switch.

Recommended Action Switch with mismatch will be declared incompatible. Check the space on the remote switch. Check whether the file is present on active.

```
%BOOT-3-DUAL_BOOT_MEMORY : Dual IOS boot indicated in ROMMON ([chars]), unavailable on [chars] RP
```

Explanation Running two IOS instances on the same RP is unavailable on route-processors with insufficient memory

Recommended Action Unset the specified ROMMON variable or increase the memory on the route-processor.

```
%BOOT-3-EXT_ISSU_CHK_FAILED: Detected booting up of standby RP with image beyond the ISSU domain of active RP by the [chars] process. The standby RP is forced to reset.
```

Explanation If standby RP is booted up with an image which is beyond the ISSU software domain of the active RP's image, the functionality of active RP may be unpredictable. Hence the standbby is being reset.

Recommended Action Remove the standby RP FRU from the chassis or boot it up with an image whose version is compatible with current running active RP.

```
%BOOT-3-FLASH READ FAIL : failed to get [chars] from flash
```

Explanation Property not populated.

Recommended Action No user action is necessary. This is informative message.

```
%BOOT-3-PARTIAL_CORE_CLEANUP_FAILURE : Partial core clean up failed for [chars]: [chars]
```

Explanation During RP boot, a failure occurred cleaning up incomplete core files.

Recommended Action Please check the router file systems.

```
%BOOT-5-BOOTTIME_SMU_MISMATCH_DETECTED : SMU mismatch from active dectected. SMUs will be copied and switch [chars] will be reloaded
```

Explanation SMU mismatch found on newly joined switch.

Recommended Action Switch with mismatch will be reloaded

В

```
%BOOT-5-BOOTTIME_SMU_RUN_MISMATCH_DETECTED : Running SMU mismatch from active dectected. System will try to correct it, switch [chars] will be reloaded
```

Explanation Running version of SMU mismatch found on newly joined switch.

Recommended Action Stack will try to correct itself.

```
%BOOT-5-BOOTTIME_SMU_TEMP_ACTIVE_DETECTED : SMU file [chars] active temporary... SMU commit is pending
```

Explanation SMU file is active temporary and 'install commit' needs to be run to make it permanent. Else reload without commit will deactive this SMU.

Recommended Action Execute 'install commit' before reload to make activate permanent.

```
%BOOT-5-BOOTTIME_SMU_TEMP_DEACTIVE_DETECTED : SMU file [chars] deactive temporary... SMU commit is pending
```

Explanation SMU file is deactive temporary and 'install commit' needs to be run to make it permanent. Else reload without commit will active this SMU again.

Recommended Action Execute 'install commit' before reload to make deactivate permanent.

```
%BOOT-6-APP START : The process [chars] has started
```

Explanation The process has successful launched and begun executing.

Recommended Action No user action is necessary. This message indicates the system is functioning normally and is provided for informational purposes only.

```
%BOOT-6-DRV LOAD : Loaded driver [chars]
```

Explanation A kernel driver that was critical to the functioning of the system was successfully loaded.

Recommended Action No user action is necessary. This message indicates the system is functioning normally and is provided for informational purposes only.

```
%BOOT-6-PARTIAL CORE REMOVED : Removed incomplete core file: [chars]
```

Explanation On boot of the RP, an incomplete core file was found and removed. Incomplete core files can happen for a variety or reasons, including the coincident failure of the active RP while a core file is being generated.

Recommended Action No action required. This is not an error, it is an indication that the system is cleaning up a previous error.

BSHELL

```
%BSHELL-3-EXEC_DIRECTIVE_FAIL : [[chars]] Command directive execution failed:
[chars]
```

Explanation The diagnostic shell was unable to execute the requested directive.

Recommended Action Check the diagnostic shell trace file for more information on the underlying failure.

```
%BSHELL-3-EXEC FAIL : [[chars]] Command execution failed
```

Explanation The diagnostic shell was unable to execute the requested interactive command.

Recommended Action Check the diagnostic shell trace file for more information on the underlying failure.

```
%BSHELL-3-EXEC PREPARE FAIL : [[chars]] Command execution prepare failed
```

Explanation The diagnostic shell was unable to prepare the requested interactive command for execution. The command failed.

Recommended Action Check the diagnostic shell trace file for more information on the underlying failure.

```
%BSHELL-3-GET HOSTNAME FAIL : [[chars]] Get hostname failed: [chars]
```

Explanation The diagnostic shell was unable to read the hostname from the kernel.

Recommended Action No action is required. The diagnostic shell periodically checks for hostname changes to set the user prompt.

```
%BSHELL-3-RECEIVE MESSAGE FAILED : [[chars]] Receive message [chars] failed: [chars]
```

Explanation The diagnostic shell was unable to receive a message from the Shell Manager

Recommended Action Retry the operation or start a new diagnostic shell session.

```
%BSHELL-3-SEND MESSAGE FAILED : [[chars]] Send message [chars] failed: [chars]
```

Explanation The diagnostic shell was unable to send a message to the Shell Manager.

Recommended Action Retry the operation or start a new diagnostic shell session.

```
%BSHELL-3-TERMINAL_OPERATION_FAIL : [[chars]] Terminal [chars] [chars] failed:
[chars]
```

Explanation The diagnostic shell was unable to get or set terminal properties. An attempt to change or act on terminal properties failed.

Recommended Action Restart the diagnostic shell and reattempt the failed operation

```
%BSHELL-6-BSHELL_UPGRADE_DETECTED : [[chars]] New software detected. Bshell instance restarting.
```

Explanation The diagnostic shell detected a new installation of diagnostic shell software. The diagnostic shell instance exits and restarts with the new software version.

Recommended Action This is an informational message only. No action is required.

```
%BSHELL-6-SESSION_ENDED : [[chars]] bshell session ended for user '[chars]'
```

Explanation A user has exited a diagnostic shell session.

Recommended Action This is an informational message only. No action is required.

```
%BSHELL-6-SESSION STARTED : [[chars]] bshell session started for user '[chars]'
```

Explanation A user has started a diagnostic shell session.

Recommended Action This is an informational message only. No action is required.

```
%BSHELL-6-SMAN CONNECTION FAILED: [[chars]] Shell Manager connect failed: [chars]
```

Explanation The diagnostic shell is unable to connect to the Shell Manager, possibly because the Shell Manager process is no longer available. This type of error is experienced if a software upgrade is in progress.

Recommended Action No action is required. Once the Shell Manager process has restarted, the diagnostic shell will reconnect.

```
%BSHELL-6-SMAN_CONNECTION_LOST : [[chars]] Shell Manager connection lost
```

Explanation The diagnostic shell was disconnected from the Shell Manager and the Shell Manager process is no longer available. This type of error is experienced if a software upgrade is in progress.

Recommended Action This is an informational message only. No action is required. Once the Shell Manager process has restarted, the diagnostic shell will reconnect.

BTRACE_ROTATE

```
%BTRACE_ROTATE-3-ARCHIVE_FAIL : Error archiving trace file -[chars]
```

Explanation While trying to archive a trace file on the active RP, an error occurred that prevented the file transfer. The trace file is not saved.

Recommended Action This message is usually seen a result of an underlying problem with the harddisk: file system, so check the console log for messages related to harddisk: file system messages.

C

CHASFS

```
%CHASFS-3-NOCHASFSDIR : The directory [chars] does not exist.
```

Explanation No explanation.

Recommended Action No action is required.

```
%CHASFS-3-NOINOTIFY: The inotify device could not be opened. Error [dec].
```

Explanation This error occurs when there is an error in the system that prevents the notification facility from being accessed.

Recommended Action No action is required.

```
%CHASFS-3-NOOPEN_PROPERTY : Error opening chassis file system object [chars]:
[chars]
```

Explanation An application was not able to open a an object in its local chassis file system.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CHASFS-3-NORESOLVE LOCAL OBJECT : Error resolving local FRU object: [chars]
```

Explanation An application was not able to create a reference to an object in its local chassis file system.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

CMAN_IDPROM_ENVMON

```
CMAN_IDPROM_ENVMON-3-CMAN_IDPROM_FIELD_INVALID : The idprom contains an invalid environmental monitoring field.
```

Explanation If this error occurs then parsing of the environmental monitoring data is aborted. Environmental monitoring will be either incomplete or absent entirely.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

CMANRP

```
%CMANRP-2-CRASHDUMP : Fatal error, calling crashdump, error: [dec] [chars]
```

Explanation A fatal condition has occurred causing IOS to crashdump.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMANRP-3-CMREADFAIL : Read from cpld_ha fd [dec] failed, errno [dec], event cnt
[dec]
```

Explanation Read from cpld_ha device returned 0 bytes.

Recommended Action No action is required.

```
%CMANRP-3-CMSWVERINFO: Unable to process software version information using file [chars]. Reason: [chars]. Error: [dec]
```

Explanation An unexpected condition has occurred while IOS was trying to process the software version information file. As a result, version information may not be available to an SNMP Manager

Recommended Action No action is required.

```
%CMANRP-3-INVERR: Unable to process chassis inventory for file [chars], slot [dec], [chars], error [dec]. Some SPA's may not be fully configured
```

Explanation An unexpected condition has occurred while IOS is trying to process the chassis inventory on startup. IOS can not determine the type and number of all Carrier Cards and SPA's present in the system. Some configuration relating to these SPA's may not be applied and leave the system in an inconsistent state.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMANRP-3-INVERRSPA: Unable to process chassis inventory for file [chars], SPA subslot [dec]/[dec], [chars], error [dec]. Some SPA's may not be fully configured
```

Explanation An unexpected condition has occurred while IOS is trying to process the chassis inventory on startup. IOS can not determine the type and number of all Carrier Cards and SPA's present in the system. Some configuration relating to these SPA's may not be applied and leave the system in an inconsistent state.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMANRP-3-MSGDISPATCH : Unable to dispatch received TDL message '[chars]' from Chassis Manager. LUID: [chars]
```

Explanation An unexpected condition has occurred while IOS is trying to dispatch to the TDL message handler functions for received TDL messages from Chassis Manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMANRP-3-MSGDISPATCHNULL : Received NULL TDL message from IOS
```

Explanation An unexpected condition in which IOS has received a NULL TDL message from Chassis Manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMANRP-3-MSGIPCERR: Unable to process received IPC messages from Chassis Manager, error: [chars]
```

Explanation An unexpected condition has occurred while IOS is trying to process a received IPC message from Chassis Manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMANRP-3-SMU COMMITTED FAILED : 'install commit' failed [dec] during reload.
```

Explanation There are uncommitted SMU activity in the system, reload will remove this SMU activity, with user input install commit is tried but failed with the error code mentioned in message.

Recommended Action No action is required.

```
%CMANRP-3-UDEVPERMS : An invalid permissions value, [chars], was found in a udev file
```

Explanation The udev files for a particular filesystem contain a description the file system. If the permissions attribute is not recognized then this file system may run with incorrect permissions.

Recommended Action No action is required.

```
CMANRP-4-SMU\_UNCOMMITTED : There are uncommitted SMU, abort reload and 'install commit' if required
```

Explanation There are uncommitted SMU activity in the system, reload will remove this SMU activity, use 'install commit' to make it persistent.

Recommended Action No action is required.

```
%CMANRP-6-CMHASTATUS : RP switchover, [chars]
```

Explanation RP switchover events received by chassis manager.

Recommended Action No action is required.

```
%CMANRP-6-CMNOTSWITCH : RP is not doing switchover
```

Explanation Read from cpld_ha device indicate no switchover event.

Recommended Action No action is required.

```
%CMANRP-6-CMSTATUS : Chassis Manager Process is [chars]
```

Explanation The current status of Chassis Manager Process.

Recommended Action No action is required.

```
%CMANRP-6-CMSWREAD : RP switchover event triggered
```

Explanation RP switchover event triggered by IOS fastpath.

Recommended Action No action is required.

```
%CMANRP-6-SMU COMMITTED : 'install commit' is success.
```

Explanation There were uncommitted SMU activity in the system, reload will remove this SMU activity, with user input install commit is done.

Recommended Action No action is required.

CMANRPCHAIN

```
CMANRPCHAIN-6-NOSHUTWARN: Shutdown not supported on this platform
```

Explanation Shutdown due to sensor overtemp is not supported

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

CMCC

%CMCC-2-BAD_ID_HW: Failed Identification Test in [chars]. The module [chars] on the slot [dec] may not be a genuine Cisco product. Cisco warranties and support programs only apply to genuine Cisco products. If Cisco determines that your insertion of non-Cisco memory, WIC cards, AIM cards, Network Modules, SPA cards, GBICs or other modules into a Cisco product is the cause of a support issue, Cisco may deny support under your warranty or under a Cisco support program.

Explanation Hardware in the specified location could not be identified as a genuine Cisco product

Recommended Action Replace the hardware with a genuine Cisco product. If this message recurs, contact your Cisco technical support representative and provide the representative with the gathered information

CMEM

```
%CMEM-3-SENSOR INIT FAILED: Sensor ([chars]) initialization failed due to [chars].
```

Explanation This error indicates that environmental monitor software cannot initialize the sensor. The software will not register and monitor this sensor. This could occur when the IDPROM has a bad I2C address for this sensor.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMEM-4-OBFL INIT FAILED : OBFL initialization failed.
```

Explanation This error indicates the OBFL dedicated filesystem is not mounted. OBFL diagnostic information will not be retained for customer troubleshooting.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

CMFP

%CMFP-2-BAD_ID_HW : Failed Identification Test in [chars]. The module [chars] may not be a genuine Cisco product. Cisco warranties and support programs only apply to genuine Cisco products. If Cisco determines that your insertion of non-Cisco memory, WIC cards, AIM cards, Network Modules, SPA cards, GBICs or other modules into a

Cisco product is the cause of a support issue, Cisco may deny support under your warranty or under a Cisco support program.

Explanation Hardware in the specified location could not be identified as a genuine Cisco product

Recommended Action Replace the hardware with a genuine Cisco product. If this message recurs, contact your Cisco technical support representative and provide the representative with the gathered information.

CMLIB

%CMLIB-2-IDPROM_INVALID : Invalid IDPROM assembly number [hex]. IDPROM update required

Explanation IDPROM assembly number is not supported.

Recommended Action IDPROM update is required

```
%CMLIB-3-THROUGHPUT_VALUE_APPLY_FAILED : Throughput [chars] [chars] -failed to per-
sist throughput of [chars] kbps. Error: [chars]
```

Explanation Status indicating that a failure was observed during the writing of the throughput to persistent store. The error reason may shed light on the cause. The throughput value may have be used to configure the CPP hardware.

Recommended Action Examine the ios, chassis-manager and license-manager logs for possible clues.

```
%CMLIB-3-THROUGHPUT_VALUE_SETUP_FAILED : Throughput [chars] [chars], throughput set
to [chars] kbps. Error: [chars]
```

Explanation Status indicating that a failure was observed during the setup of the throughput. The error reason may shed light on the cause. The set value is used to configure the CPP hardware.

Recommended Action Examine the ios, chassis-manager and license-manager logs for possible clues.

```
%CMLIB-4-FW_CHECK: slot [chars]: [chars] current firmware version is [chars], while the minimum \ required version is [chars]. Please upgrade it to minimum required version or higher.
```

Explanation Firmware version in the specified location is lower than minimum required version

Recommended Action Upgrade firmware version to latest.

```
%CMLIB-6-THROUGHPUT_VALUE : Throughput [chars] [chars], throughput set to [chars] kbps
```

Explanation Status indicating whether appropriate throughput is found or enabled and ensuring the value is used to configure the CPP hardware.

Recommended Action No user action is necessary. This is an informational message indicating that the throughput is configured.

CMRP

%CMRP-2-ACT2_UDI_DATA_INVALID : The act2 udi secure area format mismatch with unsecure area

Explanation This Router may not have been manufactured by Cisco or with Cisco's authorization. This product may contain software that was copied in violation of Cisco's license terms. If your use of this product is the cause of a support issue, Cisco may deny operation of the product, support under your warranty or under a Cisco technical support program such as Smartnet. Please contact Cisco's Technical Assistance Center for more information.

Recommended Action Replace the current product with a Cisco authorised product. If this message recurs, contact your Cisco technical support representative and provide the representative with the gathered information.

%CMRP-2-BAD_ID_HW: Failed Identification Test in [chars]. The module [chars] may not be a genuine Cisco product. Cisco warranties and support programs only apply to genuine Cisco products. If Cisco determines that your insertion of non-Cisco memory, WIC cards, AIM cards, Network Modules, SPA cards, GBICs or other modules into a Cisco product is the cause of a support issue, Cisco may deny support under your warranty or under a Cisco support program.

Explanation Hardware in the specified location could not be identified as a genuine Cisco product

Recommended Action Replace the hardware with a genuine Cisco product. If this message recurs, contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP-3-POWERBUDGET : not enough power budget left for : [chars]:[dec]
```

Explanation The system do not have enough power budget for the new card.

Recommended Action the message will be displayed when not enough power budget left for the new card inserted.

```
%CMRP-5-PEM OUTPUT DETECT : Output of PEM [dec] is [dec] V
```

Explanation Value of Output of PEM.

Recommended Action If PEM Output is 0, check Power Cable.

CMRP_ENVMON

%CMRP_ENVMON-3-PWR_FRU_HW_AUTO_SHUTDOWN : WARNING: The card on slot [dec] hit abnormal voltage or current. it has been auto-shutdown by hardware for protection

Explanation The FRU hit abnormal voltage or current and has been auto-shutdown in order to protect the components.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

C:

%CMRP_ENVMON-3-TEMP_FRU_HW_AUTO_SHUTDOWN : WARNING: The card on slot [dec] is over-heating. it has been auto-shutdown by hardware for protection

Explanation The FRU is overheating and has been auto-shutdown in order to protect the components.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_ENVMON-3-TEMP_FRU_SHUTDOWN_NOW : WARNING: [chars] temperature sensor on [chars] is in a shutdown FRU state. FRU shutdown now.
```

Explanation The FRU is overheating and will be shut down in order to protect the components.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_ENVMON-3-TEMP_FRU_SHUTDOWN_PENDING : WARNING: [chars] temperature sensor on [chars] is in a shutdown FRU state. FRU shutdown will occur in [dec] minutes.
```

Explanation The FRU is overheating and will be shut down in order to protect the components.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_ENVMON-3-TEMP_PSU_SHUTDOWN_NOW: WARNING: [chars] temperature sensor on [chars] is in a shutdown PSU state. PSU shutdown now.
```

Explanation The PSU is overheating and will be shut down in order to protect the components.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_ENVMON-3-TEMP_SYS_SHUTDOWN_NOW: WARNING: [chars] temperature sensor on [chars] is in a shutdown SYS state. System shutdown now.
```

Explanation The FRU is overheating and will be shut down in order to protect the components.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a

search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_ENVMON-3-TEMP_SYS_SHUTDOWN_PENDING: WARNING: [chars] temperature sensor on [chars] is in a shutdown SYS state. System shutdown will occur in [dec] minutes.
```

Explanation The FRU is overheating and will be shut down in order to protect the components.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_ENVMON-3-TEMP_WARN_CRITICAL: WARNING: [chars] temperature sensor on [chars] is in a critical state reading [dec]
```

Explanation The FRU is overheating and will be shut down in order to protect the components.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_ENVMON-3-TRANSCEIVER_TEMP_SYS_SHUTDOWN_NOW : WARNING: transceiver temperature sensor is in a shutdown SYS state. System shutdown now [hex].
```

Explanation The Transceiver is overheating and will be shut down in order to protect the components.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

CMRP_PFU

```
%CMRP PFU-3-DCPOWERREDUNDANCY : dc input [chars] failed for pem: [dec]
```

Explanation The DC input failed for pem module.

Recommended Action the message will be displayed when DC input failed.

```
%CMRP_PFU-3-FANASSY_REMOVED : Fan Assembly is removed. Please insert to avoid system from heating.
```

Explanation Fan Assembly has been removed from the system. It needs to be inserted back to prevent system from heating. If the system over heats, parts of the system will not function normally and system may shut itself down.

Recommended Action Insert the fan assembly in the system to prevent system from over heating.

```
%CMRP_PFU-3-PEM_STATUS : WARNING: The power supply module on slot [dec] hits
[chars],
```

Explanation The power supply module are not functioning properly.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-3-PEM_VOLTAGENOTSUPPORTED: WARNING: Input voltage of power supply module on PS[dec] is not supported. Please use the supported range of either [dec]-[dec] volts for [dec]W or [dec]-[dec] volts for [dec]W
```

Explanation The input voltage of the power supply module is out of range

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-3-PFU_FAN_DEAD : WARNING: Fan [dec] in the [chars] in slot [dec] has failed.
```

Explanation A fan is not functioning properly.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-3-PFU_FAN_ERR: WARNING: Fan [dec] in slot [dec] has the error: [chars], Please replace it with a new fan.
```

Explanation A fan is not functioning properly.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP PFU-3-PFU FANS DEAD : The fans in the [chars] in slot [dec] have all failed.
```

Explanation The system is in danger of overheating because none of the fans in one of the PEMs are working properly.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-3-PFU_FANS_DEAD_SHUTDOWN : Shutting down system now because the fans in slot [dec] have all failed.
```

Explanation When the fans fail then system does not have sufficient cooling capacity. To prevent damage, the system will automatically shut down.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-3-PFU_IDPROM_CORRUPT : The PEM/FM idprom could be read, but is corrupt in slot P[dec] The system will run without environmental monitoring for this component
```

Explanation The idprom contains information required in order to properly operate the environmental monitoring subsystems. The idprom could not be read, therefore no monitoring will take place.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-3-PFU_IDPROM_READ_ERR : Could not read the PEM/FM idprom in slot P[dec]. The system will run without environmental monitoring for this component
```

Explanation The idprom contains information required in order to properly operate the environmental monitoring subsystems. The idprom could not be read, therefore no monitoring will take place.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

 $CMRP_PFU-3-PFU_SHUTDOWN$: Shutting down system now because the PEM in slot [dec] was removed and not replaced.

Explanation When either a PEM or a FM are removed, the system lacks sufficient cooling capacity. To prevent damage, the system will automatically shut down unless it is replaced.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%CMRP_PFU-3-PFU_SLOT_VACANT : The platform does not detect a power supply in slot [dec]

Explanation There is no power supply in one of the power supply slots.

Recommended Action Insert a power supply into the empty slot.

%CMRP_PFU-3-PWR_MGMT_ALARM : WARNING: System does not have sufficient input power for minimum reliable operation requiring [dec] watts. The system needs [dec] watts of additional power.

Explanation System power does not meet minimum requirements. Insert additional power supplies or provide current power supplies with a greater input voltage source if applicable.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%CMRP_PFU-3-PWR_MGMT_LC_SHUTDOWN: WARNING: Linecard in slot [dec] with priority [dec] and a power requirement of [dec] watts has shutdown.

Explanation A LC was shutdown due to a power loss.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

 $CMRP_PFU-3-PWR_PROTECTION_ACTION$: Shutdown the card [chars] due to insufficient power budget.

Explanation The total power is not enough, shutdown FRUs for power protection.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%CMRP_PFU-3-PWR_PROTECTION_MODE: WARNING: Detected low input voltage ([dec]V) on the power supply in slot P[dec], the power budget may not be enough, some cards may be shutdown due to the power budget reduction. Please check the power input.

Explanation Input voltage of power supply is too low.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%CMRP_PFU-3-PWR_REDUN_ALARM_STATE : WARNING: An active power supply has failed and the system has entered alarm state. The system is operating without power redundancy and has [dec] watts of power remaining

Explanation An active power supplied failed while in redundant power mode.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%CMRP_PFU-3-SHUTDOWN_FAILURE : The system attempted to shut itself down, but failed because [chars]

Explanation The system reached a condition where it should be shut down, but the shutdown call failed. The system should be manually rebooted.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%CMRP_PFU-3-TEMP_FRU_SHUTDOWN: [chars] temperature sensor on [chars] is in a shutdown FRU state. FRU shutdown will occur in [dec] minutes.

Explanation The FRU is overheating and will be shut down in order to protect the components.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%CMRP_PFU-3-TEMP_SYSTEM_SHUTDOWN: [chars] temperature sensor is in a shutdown system state. System shutdown will occur in [dec] minutes.

Explanation The system is overheating and will be shut down in order to protect the components.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-4-PFU_FAN_INSUFFICIENT : WARNING: Insufficient number of fan modules installed. There are only [dec] fan modules, expecting [dec]
```

Explanation Insufficient number of fan modules installed, should insert new fans as soon as possible to avoid system from over heating.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-4-PFU_FAN_WARN : WARNING: Fan [dec] in slot [dec] has the error: [chars].
```

Explanation A fan is not functioning properly.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-4-PWR_MGMT_WARN: WARNING: Insufficient number of power supplies ([dec]) are installed for power redundancy mode [chars]. The system needs [dec] watts additional power.
```

Explanation Insufficient number of power supplies are installed. Should insert new power supplies as soon as possible

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP PFU-5-DCPOWERINPUT : dc input [chars] recovered for pem: [dec]
```

Explanation The DC input recovered for pem module.

Recommended Action the message will be displayed when DC input recovered.

```
%CMRP PFU-6-FANASSY INSERTED : Fan Assembly is inserted.
```

Explanation Fan Assembly that was previously removed has been inserted in the system. Preventing the system from over heating is important. So fan assembly should not be removed for extended period of time during normal operation.

Recommended Action No further action is necessary.

```
%CMRP PFU-6-PEM INSERTED : PEM in slot [dec] not operational.
```

Explanation A PEM seems to be inserted without the power cable connected. This message is a notice that the power supply is not operational, will not provide power to the system, and may not be completely detected by the software until the power cable is connected and the PEM is supplied with the power.

Recommended Action Insert the power supply cable in the PEM and provide power.

```
%CMRP_PFU-6-PFU_BEACON_LED_ON_OFF : [chars] beacon LED in slot PS[dec] is TURNED
[chars].
```

Explanation Power Supply or Fan-tray, Beacon LED turned ON/OFF. This is a notification message only. No action is required.

Recommended Action This is a notification message only. No action is required.

```
%CMRP_PFU-6-PFU_FAN_RECOVERED : Fan in slot [dec] has been recovered from error conditions, Now it's working normally.
```

Explanation Fans are just recovered from an error condition,

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-6-PFU_FAN_RECOVERED_I2C : Successfully restored I2C communication to PSoC [dec] on fan module in slot [dec].
```

Explanation Fans are just recovered from an I2C communcation.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP PFU-6-PFU INSERTED : [chars] inserted. System shutdown aborted.
```

Explanation When either a PEM or a FM are removed, the system lacks sufficient cooling capacity. To prevent damage, the system will automatically shut down unless it is replaced. This message serves as notice that the module has been replaced within the required time

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-6-PWR_MGMT_LC_RECOVERED : Linecard in slot [dec] with priority [dec] has been recovered from shutdown
```

Explanation A LC was recovered from a shutdown

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-6-PWR_MGMT_OK: Sufficient number of power supplies ([dec]) are installed for power redundancy mode [chars] (excess power [dec] watts).
```

Explanation Sufficient number of power supplies are installed.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-6-PWR_PROTECTION_RECOVERED : The power supply in slot P[dec] has been recovered from the power protection mode.
```

Explanation Power supply input are just recovered from an error condition,

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP_PFU-6-PWR_REDUN_RECOVERED : System has recovered from the alarm state and has [dec] watts of power remaining
```

Explanation User has recovered the system from the alarm state triggered by a power failure

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%CMRP PFU-6-PWR UP FRU: Power up the card [chars] due to power budget change.
```

Explanation The total power become enough, power FRUs.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

COND_DEBUG_HA

```
%COND_DEBUG_HA-2-GET_BUFFER : COND_DEBUG ISSU client failed to get buffer for mes-
sage. Error: [dec] ([chars])
```

Explanation The COND_DEBUG HA client failed to get buffer space for building chkpt message. Message cannot be sent to standby device. If a problem occurs, the standby device cannot be brought up properly.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show logging and show checkpoint client command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%COND_DEBUG_HA-2-INIT : COND_DEBUG ISSU client initialization failed to [chars]. Er-
ror: [dec] ([chars])
```

Explanation The COND_DEBUG ISSU client could not be initialized. This initialization failure must be addressed before in-service software upgrade or downgrade can be performed successfully. If you do not address this failure, there will be downtime during software upgrade or downgrade.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%COND_DEBUG_HA-2-SEND_NEGO_FAILED : COND_DEBUG ISSU client failed to send negotiation message. Error: [dec] ([chars])
```

Explanation The COND_DEBUG ISSU client failed to send a session negotiation message to the peer device. If a problem occurs with the ISSU session negotiation, the standby device cannot be brought up properly.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> show logging and show checkpoint client command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support

representative and provide the representative with the gathered information.

```
%COND_DEBUG_HA-2-SESSION_NEGO : COND_DEBUG ISSU client encountered unexpected client
nego done. Error: [dec] ([chars])
```

Explanation An ISSU-compliant client transitions through a series of internal states. The COND_DEBUG ISSU client encountered a 'client negotiation done' state that was unexpected. If a problem occurs with the ISSU session negotiation, the standby device cannot be brought up properly.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show issu session client_id> and show issu negotiated capability session_id> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%COND_DEBUG_HA-2-SESSION_REGISTRY : COND_DEBUG ISSU client failed to register session information. Error: [dec] ([chars])
```

Explanation The COND_DEBUG ISSU client failed to register session information. If a problem occurs with the ISSU session registration, the standby device cannot be brought up properly.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show issu capability entries client_id and show issu session client_id and show issu negotiated capability session_id command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool:
https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance
Center: https://mycase.cloudapps.cisco.com/start , or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%COND_DEBUG_HA-3-INVALID_SESSION : COND_DEBUG ISSU client does not have a valid registered session.
```

Explanation The COND_DEBUG ISSU client does not have a valid registered session.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold show issu capability entries client_id and show issu session client_id and show issu negotiated capability session_id command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool:
https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance
Center: https://mycase.cloudapps.cisco.com/start , or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%COND_DEBUG_HA-3-MSG_SIZE : COND_DEBUG ISSU client failed to get the MTU for Message Type [dec]. Error: [dec] ([chars])
```

Explanation The COND_DEBUG ISSU client failed to calculate the MTU for the specified message. The COND_DEBUG ISSU client will not able to send the message to the standby device.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show issu message

group <client_id> and show issu session <client_id> and show issu negotiated version <session_id> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%COND_DEBUG_HA-3-SESSION_UNREGISTRY : COND_DEBUG ISSU client failed to unregister session information. Error: [dec] ([chars])
```

Explanation The COND_DEBUG ISSU client failed to unregister session information.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show issu session client_id and show issu negotiated capability session_id command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%COND_DEBUG_HA-3-TRANSFORM : COND_DEBUG ISSU client [chars] transform failed for
'Message Type [dec]'. Error: [dec] ([chars])
```

Explanation The COND_DEBUG ISSU client could not transform the specified message type. If the transmit transformation failed, the checkpoint message was not sent to the standby device. If the receive transformation failed, the checkpoint message was not applied on the standby device. In both cases, the COND_DEBUG state between the active device and the standby device is not identical.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show issu session cclient_id> and show issu negotiated version session_id> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

CYLON_MGR_URPF

%CYLON_MGR_URPF-3-URPF_IPV4_IPV6 : ipv4 and ipv6 URPF interfaces can't be disjoint in single VRF. Either both ipv4 and ipv6 urpf should be configured or none of them should be configured in interface under VRF:[dec]

Explanation A software error has occurred

Recommended Action if both ipv4 and ipv6 URPF needs to be enabled under a single VRF then both urpf config (ipv4 and ipv6) need to be enabled/disabled for a interface. We can't configure only ipv4 URPF on one interface and ipv6 URPF on other interface present in same VRF.

```
%CYLON_MGR_URPF-3-URPF_VRF_OVERRIDE : Per-VRF uRPF overridden for vrf:[dec]. Allowed mode for this vrf is [chars]
```

Explanation A software error has occurred

Recommended Action uRPF mode is per-VRF, hence we can't have two different mode (strict and loose) at once in the same VRF. The new mode configured conflicts with the earlier mode and user will have to change it to allowed mode for uRPF to take effect on the interface.

CYLON_TCAM

```
%CYLON_TCAM-3-TCAM_ACL_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%threshold set for app [chars], asic id [dec]
```

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

```
%CYLON_TCAM-3-TCAM_ACL_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than
[dec]%threshold set for app [chars], asic id [dec]
```

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

```
%CYLON_TCAM-3-TCAM_EGRESS_ACL_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars], asic id [dec]
```

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

```
%CYLON_TCAM-3-TCAM_EGRESS_ACL_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage
less than [dec]%%threshold set for app [chars], asic id [dec]
```

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

```
%CYLON_TCAM-3-TCAM_EOAM_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars]
```

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

```
%CYLON_TCAM-3-TCAM_EOAM_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than
[dec]%%threshold set for app [chars]
```

Explanation The TCAM usage for the application has become less than the threshold level

%CYLON_TCAM-3-TCAM_EQOS_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_EQOS_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_EVLAN_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_EVLAN_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than [dec]%*threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_IPV4_TUNNEL_THRESHOLD : TCAM-above-threshold: TCAM usage more than [dec]%*threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_IPV4_TUNNEL_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than [dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_IPV6_ACL_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

%CYLON_TCAM-3-TCAM_IPV6_ACL_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less
than [dec]%*threshold set for app [chars]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_IVLAN_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_IVLAN_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than [dec]% threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_MCASTV4_SADT_THRESHOLD : TCAM-above-threshold: TCAM usage more than [dec]%*threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_MCASTV4_SADT_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than [dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_MCASTV4_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_MCASTV4_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than [dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become less than the threshold level

%CYLON_TCAM-3-TCAM_MCASTV6_THRESHOLD : TCAM-above-threshold: TCAM usage more than [dec]%threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_MCASTV6_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less
than [dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_QOS_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_QOS_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_UCASTV4_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_UCASTV4_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than [dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%CYLON_TCAM-3-TCAM_UCASTV6_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

```
%CYLON_TCAM-3-TCAM_UCASTV6_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less
than [dec]%*threshold set for app [chars]
```

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

CYLON_TCAM_MGR

```
%CYLON_TCAM_MGR-3-TCAM_PARITY_ERROR : TCAM parity array error on Asic: [dec] Index:
[dec] App : [chars] Region: [chars]
```

Explanation The TCAM parity array error has been reported for the mentioned Application

Recommended Action The box crashes in such a condition.

D

DSX

```
%DSX-4-ALARM : [chars] [chars]: [chars]
```

Explanation The specified T1/E1 or T3/E3 Alarm has been asserted or cleared

Recommended Action The recommended action is to isolate and repair the source of the asserted alarm

DYNCMD

```
%DYNCMD-3-CHAINADDFAIL : Parse chain link add failed for '[chars]'
```

Explanation An error has occurred when a dynamic command is being added to the IOS command set. The commands specified will not be available.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-CHAINDELFAIL : Parse chain link delete failed for '[chars]'
```

Explanation An error has occurred when a dynamic command is being removed from the IOS command set. The commands specified will stil not be available.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%DYNCMD-3-FLAGSINUSE : New feature flags list [int] invalid while feature flags in use [int]
```

Explanation IOS received a message to set the feature flags for the CLI. The message received to set the feature flags changed the number of feature flags which is unexpected. The message is ignored.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-FLAGSINVALID: New feature flag list values ([int]) different than expected ([int])
```

Explanation IOS received a message to set the feature flags for the CLI. The message received does not contains the number of feature flag values that the message list size indicated.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-INIT : Dynamic command subsystem failed to initialize '[chars]'
```

Explanation Some features depend on portions of the dynamic command infrastructure. Such features will be unavailable.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-LINKINVALIDALT : Link alternate node message received for node '[chars]', which cannot have an alternate.
```

Explanation IOS received a message to add a command into the CLI. One of the messages to link nodes instructed IOS to link nodes which would result in an invalid construction.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-LINKINVALIDTRANS : Link transition '[chars]' message received for node '[chars]', which cannot have such a transition.
```

Explanation IOS received a message to add a command into the CLI. One of the messages to link nodes instructed IOS to link nodes which would result in an invalid construction.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-LINKOUTOFSEQ : Create node message received when in mode '[chars]'
```

Explanation IOS received a message to add a command node into the CLI. The message was received out of sequence

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-LINKUNKNOWNACCEPTNODE : Link node message received for unknown accept ([chars]) node '[int]'
```

Explanation IOS received a message to add a command into the CLI. One of the messages to link nodes referenced a node unknown to IOS

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-LINKUNKNOWNALTNODE : Link node message received for unknown alternate node '[int]'
```

Explanation IOS received a message to add a command into the CLI. One of the messages to link nodes referenced a node unknown to IOS

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-LINKUNKNOWNNODE : Link node message received for unknown node '[int]'
```

Explanation IOS received a message to add a command into the CLI. One of the messages to link nodes referenced a node unknown to IOS

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-MSGBIPCBUFFER : Unable to acquire a BIPC buffer for sending messages.
```

Explanation A message was to be sent by IOS, but no BIPC buffer was available. The message to be sent has been discarded and the associated operation failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-MSGBIPCERR: Unable to process received BIPC messages for Dynamic Commands, error: [chars]
```

Explanation An unexpected condition has occurred while IOS was trying to process a received BIPC message for Dynamic Commands.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
DYNCMD-3-MSGBUILDERROR : Error '[dec]' building TDL message '[chars]' to send to the Shell Manager
```

Explanation An unexpected condition has occurred while IOS is building a TDL message to send to the Shell Manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
\mbox{\ensuremath{\$DYNCMD-3-MSGDISPATCH}} : Unable to dispatch received TDL messages for Dynamic Commands
```

Explanation An unexpected condition has occurred while IOS is trying to dispatch to the TDL message handler functions for received TDL messages for Dynamic Commands.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%DYNCMD-3-MSGDISPATCHNULL : Received NULL TDL message
```

Explanation An unexpected condition in which IOS has received a NULL TDL message for Dynamic Commands.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
DYNCMD-3-MSGENQUEUEERROR : Error queueing TDL message '[chars]' to send to the Shell Manager
```

Explanation An unexpected condition has occurred when IOS attempted to queue a TDL message to send to the Shell Manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-MSGERROR : Error '[chars]' handling a received TDL message '[chars]' for Dynamic Commands
```

Explanation An unexpected condition has occurred while IOS is processing a received Dynamic Command TDL message

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-MSGINVALIDFIELDINT : Invalid field '[chars]' in TDL message '[chars]' received: value '[int]' for Dynamic Commands
```

Explanation A message with an invalid field value was received for Dynamic Command creation

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-MSGINVALIDFIELDSTR : Invalid field '[chars]' value '[chars]' in TDL message '[chars]' received for Dynamic Commands
```

Explanation A message with an invalid field value was received for Dynamic Command creation

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
DYNCMD-3-MSGMARSHALERROR : Error '[dec]' marshaling TDL message '[chars]' to send to the Shell Manager
```

Explanation An unexpected condition has occurred while IOS is marshaling TDL message to send to the Shell Manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-MSGMISSINGFIELD: Missing field '[chars]' in TDL message '[chars]' received from the Shell Manager
```

Explanation A message missing a required field was received from the Shell Manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-NODEDUPLICATE : Create node message received for duplicate node '[int]'
```

Explanation IOS received a message to add a command into the CLI. One of the command nodes to be created has an identifier of an existing node. The new node is ignored.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-NODEOUTOFSEQ : Create node message received when in mode '[chars]'
```

Explanation IOS received a message to add a command node into the CLI. The message was received out of sequence

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%DYNCMD-3-NODETYPEUNKNOWN : Create node message received for unknown node type '[dec]', '[chars]'
```

Explanation IOS received a message to add a command into the CLI. One of the command nodes to be created is of a type unknown to IOS

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGERR LOG FAIL : Failed to log errors for package '[chars]'
```

Explanation An error has occurred updating the commandset for a newly installed package. The commands which failed to transfer could not be saved for further analysis.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGHANDLER_FILE_REMOVE : Package '[chars]' failed to remove: [chars]
([chars])
```

Explanation An error has occurred when a package was attempting to remove a file. This should never fail.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGHANDLER_FILE_WRITE : Package '[chars]' failed to write: [chars]
([chars])
```

Explanation An error has occurred when a package was attempting to write a file. The configuration for the package could not be propagated to associated components.

```
%DYNCMD-3-PKGINT API : Package interface failure for package '[chars]': [chars]
```

Explanation Some features' configuration depends on a packaging infrastructure. Packaged configuration for the specified package will be unavailable.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT_ARG : Incorrect argument type for package '[chars]', operation
'[chars]': [chars] ([int])
```

Explanation An error has occurred loading the commandset for a newly installed package. The package is not compatible with the running IOS instance.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT_ARG_NUMBERVAL : Invalid argument value for package '[chars]', operation '[chars]': [int] ([int])
```

Explanation An error has occurred loading the commandset for a newly installed package. The package is not compatible with the running IOS instance.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT_ARG_OPAQUEVAL : Invalid argument value for package '[chars]', oper-
ation '[chars]': [IPV6 address] ([int])
```

Explanation An error has occurred loading the commandset for a newly installed package. The package is not compatible with the running IOS instance.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT_ARGS: Incorrect argument count for package '[chars]', operation '[chars]': [dec] not [dec]
```

Explanation An error has occurred loading the commandset for a newly installed package. The package is not compatible with the running IOS instance.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT_DIR_CREATE : Package integration failed to create directory:
[chars] ([chars])
```

Explanation An error has occurred when attempting to create a package export directory. This should never fail.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT_DIR_MOVE : Package integration failed to move directory: [chars] to
[chars] ([chars])
```

Explanation An error has occurred when attempting to move a package export directory. This should never fail.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT_DIR_OPEN : Package integration failed to open directory: [chars]
([chars])
```

Explanation An error has occurred when attempting to open a package export directory. This should never fail.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT_DIR_REMOVE : Package integration failed to remove directory:
[chars] ([chars])
```

Explanation An error has occurred when attempting to remove a package export directory. This should never fail.

```
%DYNCMD-3-PKGINT_FILE_OPEN : Package integration failed to open file: [chars]
([chars])
```

Explanation An error has occurred when attempting to open a file in a package export directory. This should never fail.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT_FILE_REMOVE : Package integration failed to remove: [chars]
([chars])
```

Explanation An error has occurred when attempting to remove a package export file. This should never fail.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT INSTALL : Failed to install '[chars]': [chars]
```

Explanation Some features' configuration depends on a packaging infrastructure. Packaged configuration for the specified package will be unavailable.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT LOAD : Failed to load '[chars]': [chars]
```

Explanation Some features' configuration depends on a packaging infrastructure. Packaged configuration for the specified package will be unavailable.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT LOCK : Failed to acquire package list lock for [chars]: [chars]
```

Explanation An error occurred when a configuration package was being installed or removed. This may indicate a timeout which may be a temporary condition.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search

Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT_OFFSET : Invalid offset argument for package '[chars]', operation '[chars]': [chars] ([int])
```

Explanation An error has occurred loading the commandset for a newly installed package. The package is not compatible with the running IOS instance.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT PKGLOCK : [chars] failed to acquire package lock for [chars]
```

Explanation An error occurred when locking a configuration package. The package needs to be locked for processing configuration commands or timer-based processing of configuration data.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT_SYMBOL : Package [chars] incompatible: symbol '[chars]' is of type [chars], expected [chars]
```

Explanation Some features' configuration depends on a packaging infrastructure. Packaged configuration for the specified package will be unavailable.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGINT UNLOCK : Failed to release the package list lock: [chars]
```

Explanation An error occurred when a configuration package was being installed or removed. This should not occur.

```
%DYNCMD-3-PKGINT VALIDATE : Failed to validate '[chars]': [chars]
```

Explanation Some features' configuration depends on a packaging infrastructure. Packaged configuration for the specified package will be unavailable.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-PKGNODE_ADD_FAIL : Parse node add failed for package '[chars]', [chars]
([int])
```

Explanation An error has occurred loading the commandset for a newly installed package. The node could not be added and the commandset for the package will not be available.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-TREETOP: Unable to link top-level keyword '[chars]' into parse tree
```

Explanation IOS received a message to add a command into the CLI. The appropriate location to link in the command could not be found.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%DYNCMD-3-TREETOPNOTKW : The top-level parser transition '[chars]' is not a keyword
```

Explanation IOS received a message to add a command into the CLI. The top-level node must be a keyword node.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%DYNCMD-4-CMD_DEPRECATION: The command 'platform trace runtime' is being deprecated. Please use the exec mode command 'set platform software trace' instead. Note that using this command and 'set platform software trace' together will lead to indeterministic results

Explanation The command 'platform trace runtime' is being deprecated.

Ε

Recommended Action No action is required.

 $\mbox{\ensuremath{\mbox{NDYNCMD-}7-CMDSET_LOADED}}$: The Dynamic Command set has been loaded from the Shell Manager

Explanation IOS has completed loading the set of commands published and processed by components running in packages other than the IOS package.

Recommended Action No action is required.

 $DYNCMD-7-CMDSET_UNLOADED$: The Dynamic Command set from the Shell Manager has been unloaded

Explanation IOS has completed unloading the Dynamic Command set. This should only occur when a new package has been installed and should shortly be followed by a message indicating that the new Dynamic Command set has been loaded.

Recommended Action No action is required.

%DYNCMD-7-PKGINT_INSTALLED : The command package '[chars]' has been successfully installed

Explanation IOS has completed installation of the specified command package. Configuration commands for the package are now available.

Recommended Action No action is required.

%DYNCMD-7-PKGINT_UNINSTALLED : The command package '[chars]' has been successfully
uninstalled

Explanation IOS has completed uninstallation of the specified command package. Configuration commands for the package are no longer available.

Recommended Action No action is required.

F

ECFM_HSBY

%ECFM_HSBY-5-FAIL : Communication lost with remote ODU for link protection group [dec] on [chars]

Explanation Communication was lost with the remote outdoor unit (ODU) due to either a CC message timeout or the interface going down.

Recommended Action No action is required.

Ε

%ECFM_HSBY-5-FAILOVER: Failover from [chars] to [chars] in link protection group [dec].

Explanation The active outdoor unit (ODU) in the link protection group either has sent a message to the indoor unit (IDU) indicating a failure or communication with the ODU was lost. The IDU has failed over to the standby ODU.

Recommended Action No action is required.

 $\mbox{\ensuremath{\mbox{\tt \%ECFM_HSBY-5-KO}}}$: Remote ODU for link protection group [dec] on [chars] has indicated a failure

Explanation The remote outdoor unit (ODU) has raised its Sender KO flag indicating a failure.

Recommended Action No action is required.

%ECFM HSBY-5-OK: Remote ODU for link protection group [dec] on [chars] is now ok.

Explanation The previously failed remote outdoor unit (ODU) has recovered.

Recommended Action No action is required.

%ECFM_HSBY-5-PORT_ACTIVE : [chars] link protection group [dec] now forwarding traffic

Explanation The remote outdoor unit (ODU) connected to this interface is now active. This interface is now forwarding traffic to/from the remote ODU.

Recommended Action No action is required.

%ECFM_HSBY-5-SUSPEND : Remote ODU for link protection group [dec] on [chars] is now suspended.

Explanation The remote outdoor unit (ODU) has requested monitoring of CC messages be temporarily suspended.

Recommended Action No action is required.

EMD

%EMD-0-EVENT_LIBRARY: An event facility initialization or maintenance function failed because [chars]

Explanation An event facility initialization or maintenance function failed. This error could be due to a software defect or system resource limitation.

Recommended Action Restart the card.

%EMD-0-RESOLVE FRU: Failed to determine [chars] card because [chars]

Ε

Explanation The system was unable to to determine a card state. This error could be due to a software defect or system resource limitation.

Recommended Action Restart the card.

```
%EMD-0-SERVICES_INITIALIZATION : Failed to initialize general application services because [chars]
```

Explanation The system failed to initialize the application services. This error could be due to a software defect or system resource limitation.

Recommended Action Restart the card.

```
%EMD-3-IDPROM_ACCESS : Failed access or process an IDPROM because [chars]
```

Explanation The system failed to access an IDPROM or an IDPROM process failed. This error can occur from a hardware defect, software defect, or incorrect IDPROM content.

Recommended Action Examine the logs for IDPROM and hardware errors.

```
%EMD-3-IDPROM_SENSOR : One or more sensor fields from the idprom failed to parse properly because [chars].
```

Explanation One or more IDPROM sensor fields failed to parse properly. The most likely reason is a checksum failure in the IDPROM from incorrect IDPROM content.

Recommended Action Examine the logs for IDPROM and hardware errors.

```
%EMD-3-PFU_INITIALIZATION: The RP has failed to initialize a Power Supply/Fan module controller because [chars]
```

Explanation The route processor (RP) failed to initialize a power supply or a fan module controller. This error could be caused by a hardware defect or a C2W access failure.

Recommended Action Examine the logs for C2W and hardware errors.

```
%EMD-3-SENSOR_INITIALIZATION : Failed to initialize sensor monitoring because [chars].
```

Explanation The system failed to initialize an IDPROM sensor monitoring process. This error can occur from a hardware defect, software defect, or incorrect IDPROM content.

Recommended Action Examine the logs for IDPROM and hardware errors.

ENVIRONMENTAL

```
%ENVIRONMENTAL-1-ALERT : [chars], Location: [chars], State: [chars], Reading: [dec] [chars]
```

E

Explanation One of the sensors in the system is reading an out of normal value.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%ENVIRONMENTAL-1-SENSORFAIL : [chars], Location [chars], State: fail
```

Explanation One of the sensors in the system has detected a failure condition from which it can not recover. This sensor is no longer reporting readings to the environmental monitoring subsystem.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%ENVIRONMENTAL-3-CHASFSERR : Sensor [chars] on FRU [chars] has an invalid chasfs device state [chars]
```

Explanation The system does not understand the state that the sensor is reporting. This is most likely a filesystem corruption or ISSU problem. You may try rebooting the router to see if the problem corrects itself.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%ENVIRONMENTAL-3-TDLERROR : Error processing TDL message. [dec]
```

Explanation An unexpected condition in which IOS has received a TDL message which it can not process.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%ENVIRONMENTAL-5-SENSOROK : [chars], Location: [chars], State: normal
```

Explanation One of the sensors in the system had been in a failure condition but is now operating normally.

E

representative with the gathered information.

```
%ENVIRONMENTAL-6-NOTICE : [chars], Location: [chars], State: [chars], Reading: [dec] [chars]
```

Explanation Informational message on the sensor reading

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

EPOCH

```
%EPOCH-6-EPOCH REJECTED : Peer [chars] has rejected epoch: [chars]
```

Explanation This error occurs if epoch from shell-manager has been rejected by the peer.

Recommended Action Check the epoch and peer state.

EQPT_ALARM_PERSISTENCY

```
%EQPT_ALARM_PERSISTENCY-3-EQPT_ALARM_INFO_NULL : Persistent alarm queue alarm info
is NULL
```

Explanation None

Recommended Action None

```
%EQPT_ALARM_PERSISTENCY-3-EQPT_ALARM_QUEUE_NULL : Persistent alarm queue info is
NULL.
```

Explanation None

Recommended Action None

```
%EQPT ALARM PERSISTENCY-3-EQPT NULL DATA STRUCTURE : [chars] is NULL
```

Explanation None

Recommended Action None

EVUTIL

```
%EVUTIL-3-PERMISSION : Operation not permitted for pid [dec] tid [dec]
```

Explanation Eventlib has detected that a process has attempted to invoke an API that is listed as having a level of permission.

Recommended Action Review the process logs taking note of the timestamp information to select specific information to review. Copy the message and other related information exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%EVUTIL-3-PREREQUISITE INIT : A preferred library has failed to initialize: [chars]
```

Explanation Eventlib has detected that a preferred library which provides infrastructure services has failed to fully initialize.

Recommended Action Review the process logs taking note of the timestamp information to select specific information to review. Copy the message and other related information exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%EVUTIL-6-PREREQUISITE : Preferred library is absent
```

Explanation Eventlib has detected that a preferred library is missing from the process.

Recommended Action This is an informational message.

F

FLASH_CHECK

```
%FLASH_CHECK-3-DISK_QUOTA: Flash disk quota exceeded [free space is [dec] kB] - Please clean up files on bootflash.
```

Explanation The remaining free space on the flash disk is below the recommended threshold of at least half the installed RP memory. This limits the system from core files necessary to root cause critical system faults.

Recommended Action Please remove unneeded files from bootflash: device. Any core files under the bootflash:/core directory should be reported and then deleted.

FMANFP

```
%FMANFP-3-CRYPTO_DEVICE_REQUEST_FAILED : Crypto-device is busy processing last request. This request will be discarded
```

Explanation Crypto-device is still processing previous reload request or still processing crypto feature packets. New request will not be applied

Recommended Action No action is required.

%FMANFP-3-CRYPTO_LICENSE_THPUT_MAX_APPROACHED: Average crypto throughput rate approached the licensed crypto bandwidth of [int] bps during [dec] sampling periods in the last 24 hours, sampling period is [dec] seconds

Explanation To monitor crypto throughput and, to generate notification/warning if the average throughput utilization over a longer time are approaching or exceeding the cypro licensed bandwidth

Recommended Action No action is required.

%FMANFP-3-CRYPTO_LICENSE_THPUT_THRESHOLD_EXCEED: Average crypto throughput rate exceeded [dec] percent of licensed crypto bandwidth of [int] bps during [dec] sampling periods in the last 24 hours, sampling period is [dec] seconds

Explanation To monitor crypto throughput and, to generate notification/warning if the average throughput utilization over a longer time are approaching or exceeding the cypro licensed bandwidth

Recommended Action No action is required.

```
%FMANFP-3-LICENSE THPUT INVALID : Invalid throughput [int]kbps
```

Explanation The throughput value is invalid. The forwarding engine will not operate at the throughput value.

Recommended Action Report this occurrence to Engineering. Use Topic to search for a similar DDTS. If you find none, write a DDTS for this problem.

%FMANFP-6-CRYPTO_DEVICE_NOT_PRESENT : Hardware crypto-device is not present. Request aborted

Explanation Hardware crypto-device is not present on the system. User request doesn't apply or be executed. This may not be an error.

Recommended Action No action is required.

```
%FMANFP-6-CRYPTO DEVICE REQUEST COMPLETE : Crypto-device is ready to process packets
```

Explanation Crypto-device is load with new core based on user request. Now it is ready to process packets

Recommended Action No action is required.

%FMANFP-6-FMANACLLOGMISSMSG : access-list logging datapath rate-limited or missed [int] packet[chars]

Explanation Some packet matching logs were missed because the access list log messages were rate-limited or no access list log buffers were available.

Recommended Action No action is required.

```
%FMANFP-6-IPACCESSLOGDP : list [chars] [chars] [chars] [chars] -> [chars] ([int]/[int]), [int] packet[chars]
```

Explanation A packet matching the log criteria for the given access list was detected.

Recommended Action No action is required.

```
%FMANFP-6-IPACCESSLOGNP : list [chars] [chars] [int] [chars] [chars]-> [chars], [int] packet[chars]
```

Explanation A packet matching the log criteria for the given access list was detected.

Recommended Action No action is required.

```
%FMANFP-6-IPACCESSLOGP: list [chars] [chars] [chars] [chars] ([int]) [chars]-> [chars]([int]), [int] packet[chars]
```

Explanation A packet matching the log criteria for the given access list was detected.

Recommended Action No action is required.

```
%FMANFP-6-IPACCESSLOGSGDP: ingress_interface='[chars]' sgacl_name='[chars]' action='[chars]' protocol='[chars]' src-ip='[chars]' dest-ip='[chars]' type='[int]' code='[int]' sgt='[int]' dgt='[int]' logging interval hits='[int]'
```

Explanation A packet matching the log criteria for the given access list was detected.

Recommended Action No action is required.

```
%FMANFP-6-IPACCESSLOGSGNP: ingress_interface='[chars]' sgacl_name='[chars]' action='[chars]' protocol='[int]' src-ip='[chars]' dest-ip='[chars]' sgt='[int]' dgt='[int]' logging interval hits='[int]'
```

Explanation A packet matching the log criteria for the given access list was detected.

Recommended Action No action is required.

```
%FMANFP-6-IPACCESSLOGSGP : ingress_interface='[chars]' sgacl_name='[chars]' ac-
tion='[chars]' protocol='[chars]' src-ip='[chars]' src-port='[int]' dest-
ip='[chars]' dest-port='[int]' sgt='[int]' dgt='[int]' logging interval hits='[int]'
```

Explanation A packet matching the log criteria for the given access list was detected.

Recommended Action No action is required.

```
%FMANFP-6-IPV6ACCESSLOGDP : list [chars] [chars] [chars] [chars] -> [chars] ([int]/[int]), [int] packet[chars]
```

Explanation A packet matching the log criteria for the given access list was detected.

Recommended Action No action is required.

```
%FMANFP-6-IPV6ACCESSLOGNP : list [chars] [chars] [int] [chars] [chars]-> [chars], [int] packet[chars]
```

Explanation A packet matching the log criteria for the given access list was detected.

Recommended Action No action is required.

```
%FMANFP-6-IPV6ACCESSLOGP : list [chars] [chars] [chars] [chars] ([int]) [chars]-> [chars]([int]), [int] packet[chars]
```

Explanation A packet matching the log criteria for the given access list was detected.

Recommended Action No action is required.

FMANRP

```
%FMANRP-4-INVALID CCE POSITION : Invalid position '[dec]' prevented [chars]
```

Explanation A messaging error has occurred during service-policy modification and the configuration could not be downloaded properly

Recommended Action Report this occurrence to Engineering. Use Topic to search for a similar DDTS. If you find none, write a DDTS for this problem.

FMANRP_ACL

```
%FMANRP_ACL-3-EXPOGACLLIMITERR : Expanded OGACL ([chars]) size ([dec]) exceeded MAX ACL limit ([dec])
```

Explanation Expanded OGACL size exceeded the maximum ACL limit. Command rejected

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> Reduce # of ACEs in the ACL command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-INVALIDV4ACETYPE : v4 ACE type is invalid
```

Explanation An unexpected condition has occurred which is due to the type of v4 ACE created

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip access-list command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-INVALIDV6OP : Operation is invalid
```

Explanation An unexpected condition has occurred which is due to the operation performed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ipv6 access-list command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-NOACL : ACL is null
```

Explanation An unexpected condition has occurred which is due to the absence of an ACL structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show ip access-list command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-NOMACACE : mac ACE is null
```

Explanation An unexpected condition has occurred which is due to the absence of an mac ACE structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show access-list command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-NOSB : Subblock on interface [chars] ([hex]) is null
```

Explanation An unexpected condition has occurred which is due to the absence of a subblock structure on interface.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%FMANRP ACL-4-NOSWIDB : Sub-interface is null
```

Explanation An unexpected condition has occurred which is due to the absence of a swidb structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-NOV4ACE : v4 ACE is null
```

Explanation An unexpected condition has occurred which is due to the absence of an v4 ACE structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip access-list command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-NOV6ACE : v6 ACE is null
```

Explanation An unexpected condition has occurred which is due to the absence of an v6 ACE structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ipv6 access-list command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-TMPLACLDISABLEERR: Not enough resources to disable template ACL
```

Explanation Not enough resurces to store individual ACLs

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip access-list template summary command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
FMANRP\_ACL-4-TMPLACLINITERR : Template ACL initialization error
```

Explanation An unexpected condition has occurred on template ACL initialization

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show memory command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-TMPLACLNOMEMERR : Template ACL no memory error
```

Explanation An unexpected condition has occurred on template ACL processing

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show memory command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-UPDMACSTATSERR : Update mac ACL statistics error
```

Explanation An unexpected condition has occurred when updating mac ACL statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show access-list command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-UPDV4STATSERR : Update v4 ACL statistics error
```

Explanation An unexpected condition has occurred when updating v4 ACL statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show ip access-list command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ACL-4-UPDV6STATSERR : Update v6 ACL statistics error
```

Explanation An unexpected condition has occurred when updating v6 ACL statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show ipv6 access-list command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

FMANRP_ALG

```
%FMANRP ALG-3-API FAILED : NULL
```

Explanation A call to the API of another component has indicated an error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ALG-3-EINVAL : NULL
```

Explanation An unexpected input value to a function was incorrect

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_DPSS

```
%FMANRP_DPSS-3-DPSSFOIOSDENQUEUE: Failed to enqueue dpss feature object [hex] config message for transmission
```

Explanation This operation to enqueue an IPC message for sending has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_DPSS-3-DPSSFOIPCALLOC : Failed to alloc IPC buffer for dpss feature object [hex] config message
```

Explanation This operation to allocate IPC buffer for dpss feature object configuration has failed.

%FMANRP_DPSS-3-DPSSFOTDLCREATE : Failed to create tdl msg for dpss feature object [hex] config message

Explanation This operation to create an TDL message has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_DPSS-3-DPSSFOTDLMSGMARSHAL : Failed to copy dpss feature object config message to IPC buffer for fo_hdl [hex]

Explanation This operation to build a TDL message for dpss feature object configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_DPSS-3-DPSSFOTDLSET : Failed to set tdl msg detail for dpss feature object [hex] config message

Explanation This operation to set an TDL message has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

 $\mbox{\sc \$FMANRP_DPSS-3-DPSSGLOBALIOSDENQUEUE}$: Failed to enqueue dpss global config message for transmission

Explanation This operation to enqueue an IPC message for sending has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_DPSS-3-DPSSGLOBALIPCALLOC : Failed to alloc IPC buffer for dpss global config message

Explanation This operation to allocate IPC buffer for dpss global configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_DPSS-3-DPSSGLOBALTDLCREATE : Failed to create tdl msg for dpss global config message

Explanation This operation to create an TDL message has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_DPSS-3-DPSSGLOBALTDLMSGMARSHAL : Failed to copy dpss global config message to IPC buffer

Explanation This operation to build a TDL message for dpss global configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_DPSS-3-DPSSGLOBALTDLSET : Failed to set tdl msg detail for dpss global config message

Explanation This operation to set an TDL message has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_ESS

```
%FMANRP ESS-3-ENQUEFAIL : [chars] ([hex], [hex])
```

Explanation An unexpected condition has occurred which resulted in a configuration not being sent to the Forwarding Manager Processs.

representative with the gathered information.

```
%FMANRP ESS-3-ERREVENT2 : [chars] ([hex] / [hex])
```

Explanation General error used for failures during internal software integrity checks.

Recommended Action Report this occurrence to Engineering. Use Topic to search for a similar DDTS. If you find none, write a DDTS for this problem.

```
%FMANRP ESS-3-ERREVENT : [chars] ([hex])
```

Explanation General error used for failures during internal software integrity checks.

Recommended Action Report this occurrence to Engineering. Use Topic to search for a similar DDTS. If you find none, write a DDTS for this problem.

```
%FMANRP_ESS-4-EVSICREAT : [chars] sip_ess_segment= [hex], segment_id= [int], fsp ess segment= [hex], segment id= [int], evsi= [int]
```

Explanation A failure has occured in creating a session interface.

Recommended Action The session creation is rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_ESS-4-FULLVAI : Session creation failed due to Full Virtual-Access Interfaces not being supported. Check that all applied Virtual-Template and RADIUS features support Virtual-Access sub-interfaces. swidb= [hex], ifnum= [dec]
```

Explanation A failure has occured in creating a session interface due to a Full Virtual-Access Interface being created. Full Virtual-Access Interface are created if a Virtual-Template or RADIUS feature does not support Virtual-Access sub-interfaces. This platform only supports Virtual-Access sub-interfaces. Refer to Action to isolate offending feature.

Recommended Action The session creation is rejected. Steps to isolate unsupported Session feature: Run 'test Virtual-Template # subinterface' where # is the Virtual-Template number being used to create the session. Remove any identified features that are not sub-interface compliant. For RADIUS features: Configure aaa policy interface-config allow-subinterface on the router or cisco-avpair=lcp:allow-subinterface=yes needs to be specified in the subscriber profile on the Radius server.

```
%FMANRP ESS-4-MAXSESS : [chars] ([dec])
```

Explanation This error indicates a failed session setup due to the lack of a necessary system resource.

Recommended Action Reduce other system activity to ease memory demands. If conditions warrant, upgrade to a larger memory configuration.

```
%FMANRP ESS-4-SEGFAIL2 : [chars] Seghandle [hex] of Type [int] ess segment= [hex]
```

Explanation A failure has occured with a segment operation.

Recommended Action The session creation is rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-SEGFAIL : [chars] Seghandle [hex] of Type [int]
```

Explanation A failure has occured with a segment operation.

Recommended Action The session creation is rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_ESS-4-SESSCNT : [chars] ([hex])
```

Explanation Inactive/Active Session Counts are incorrect.

Recommended Action The active sessions should still be functional but overall system performance may be less than optimal. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNEVENT2 : [chars] ([hex] / [hex])
```

Explanation A failure has occured possibly relating to system resources.

Recommended Action The session should still be functional but overall system performance may be less than optimal. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNEVENT : [chars] ([hex])
```

Explanation A failure has occured possibly relating to system resources.

Recommended Action The session should still be functional but overall system performance may be less than optimal. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform

a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM 2U : [chars] ([int] / [int])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session should still be functional but overall system performance may be less than optimal. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_ESS-4-WRNPARAM_2X2S : [chars] ([hex] / [hex] / [chars])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session creation may be rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM 2X : [chars] ([hex] / [hex])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session creation is rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM 2XD : [chars] ([hex] / [hex] / [dec])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session should still be functional but overall system performance may be less than optimal. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM 3X : [chars] ([hex] / [hex] / [hex])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session creation may be rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM : [chars]
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session creation is rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM D : [chars] ([dec])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session creation is rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://cway.cisco.com/go/sa/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM DU : [chars] ([dec] / [int])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session should still be functional but overall system performance may be less than optimal. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_ESS-4-WRNPARAM_F2S : [chars]: [chars] ([chars] / [chars])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session should still be functional but overall system performance may be less than optimal. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support

representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM F2X : [chars]: [chars] ([hex] / [hex])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session creation is rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM FU : [chars]: [chars] ([int])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session creation is rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_ESS-4-WRNPARAM_S : [chars]: [chars]
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session creation is rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://cway.cisco.com/go/sa/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM U2X : [chars] ([int] / [hex] / [hex])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session creation is rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_ESS-4-WRNPARAM_U : [chars] ([int])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session creation is rejected. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM UXD : [chars] ([int] / [hex] / [dec])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session should still be functional but overall system performance may be less than optimal. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP ESS-4-WRNPARAM XU : [chars] ([hex] / [int])
```

Explanation A failure has occured relating to an incorrect functional parameter(s).

Recommended Action The session should still be functional but overall system performance may be less than optimal. If you determine that the system is adversely affected then Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_IPSEC

```
%FMANRP_IPSEC-3-HAPI_PCP_UNEXP_REPLY : [chars]: PCP (trans [hex], opcode [hex]): unexpected reply from crypto hardware.
```

Explanation An unexpected internal software error. Engineering must be reported and investigate this occurrence.

Recommended Action Report this occurrence to Engineering. Use Topic to search for a similar DDTS. If you find none, write a DDTS for this problem.

```
%FMANRP_IPSEC-6-HAPI_PCP_NACK : [chars]: PCP NACK (trans [hex], opcode [hex], errcode [hex]): crypto hardware configuration may be out of sync.
```

Explanation A failure has occured during security policy downloading in crypto hardware. The command is rejected.

Recommended Action The configuration may be ignorable or recovered automatically in crypto hardware. The session may still be functional but less than optimal performance. If you determine that the system is adversely affected then Embedded Services Processor (ESP) tracelog should be collected. Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your

Cisco technical support representative and provide the representative with the gathered information.

FMANRP_MFR

```
%FMANRP MFR-3-BLCFGFAIL : Unable to [chars] link [chars] [chars]
```

Explanation An unexpected condition has occurred at Bundle link configuration %s

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP MFR-3-BLFAIL : Unable to [chars] link [chars] [chars]
```

Explanation An unexpected condition has occurred at Bundle link configuration %s

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP MFR-3-BNDLFAIL : Unable to [chars] bundle [chars]
```

Explanation An unexpected condition has occurred at Bundle configuration

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_MFR-3-TDLFAIL : Unable to send [chars] [chars] message to Forwarding Manager Process ([chars])
```

Explanation An unexpected condition has occurred which resulted in a configuration not being sent to the Forwarding Manager Processs.

FMANRP_MPLS

```
%FMANRP_MPLS-3-ENQUEFAIL : Unable to send [chars] [chars] message to Forwarding Manager Process
```

Explanation An unexpected condition has occurred which resulted in a configuration not being sent to the Forwarding Manager Processs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP MPLS-3-NOOBJ : Object entry is null
```

Explanation An unexpected condition has occurred which is due to the absence of an object entry structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> show mpls command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP MPLS-3-UNSPTYPE : Not supported bundle type [dec]
```

Explanation An unexpected condition has occurred which is due to an operation request to an unsupported bundle oce type is received.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_NAT

```
%FMANRP_NAT-3-AVLDELETE : Failed to delete node from NAT [chars] database for [IP address]
```

Explanation This operation to perform delete processing has failed.

```
%FMANRP_NAT-3-AVLTREEWALK : Failed to walk NAT [chars] database for [chars]
```

Explanation This operation to perform stale processing has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_NAT-3-DEBUGTDLMSGMARSHAL : Failed to copy debug NAT request message to IPC buffer

Explanation This operation to build a TDL message for debug NAT command has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_NAT-3-IFADDRTDLMSGMARSHAL : Failed to copy interface address change message to IPC buffer for interface [chars], new address [IP address]

Explanation This operation to build a TDL message for NAT interface address configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_NAT-3-IFTDLMSGMARSHAL : Failed to copy interface config essage to IPC buffer for Interface [chars] ([hex]), domain [chars], operation [chars]

Explanation This operation to build a TDL message for interface configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT-3-INVALID ADDRESS: Received an invalid address [IP address]
```

Explanation An unsupported address for the given config was received.

representative with the gathered information.

```
%FMANRP NAT-3-IOSDENQUEUE : Failed to enqueue NAT [chars] message for transmission
```

Explanation This operation to enqueue an IPC message for sending has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT-3-IPALIASTDL : Error with ipalias message received from data path
```

Explanation An unexpected condition has occurred with received ipalias message from data path

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-IPALIASTYPE : Received ipalias message from data path with unsupported address type [dec]
```

Explanation An unexpected condition has occurred with received ipalias message from data path with unsupported address type

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-IPSTATICROUTETDL : Error with static ip route message received from data path
```

Explanation An unexpected condition has occurred with received static ip route message from data path

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-IPSTATICROUTETYPE : Received ip static route message from data path with unsupported address type
```

Explanation An unexpected condition has occurred with received static ip route message from data path with unsupported address type

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-MAPPINGTDLMSGMARSHAL : Failed to copy mapping config message to IPC buffer for mapping id [dec] (vrf table id [dec])
```

Explanation This operation to build a TDL message for mapping configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-MAXENTRYTDLMSGMARSHAL : Failed to copy max entry config message to IPC buffer for type [chars], entry data [hex], max limit [dec]
```

Explanation This operation to build a TDL message for max entry add/delete has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT-3-MIBEVENT : Failed to get NAT MIB response message: [chars]
```

Explanation An unsupported error occured with waiting for NAT MIB respsonse message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT-3-MSGALLOCERR : Failed to allocate message
```

Explanation When attempting to send message to dataplane, there was not enough memory to allocate the message.

 $FMANRP_NAT-3-NATSETTDLMSGFAIL$: When download [chars], failed to set a field in message

Explanation sotware error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-POOLTDLMSGMARSHAL : Failed to copy pool config message to IPC buffer for pool [chars] (id [dec])
```

Explanation This operation to build a TDL message for pool configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-PORTLISTPROTO: Protocol type [dec] for global addr [IP_address] in the portlist allocation request is not supported
```

Explanation An unexpected protocol type has occurred with received portlist allocation request message from data path

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
FMANRP\_NAT-3-PORTLISTTDL : Error with portlist allocation request message received from data path
```

Explanation An unexpected condition has occurred with received portlist allocation request message from data path

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-PORTLISTTDLMSGMARSHAL : Failed to copy portlist config message to IPC buffer for addr [IP address], proto [dec], start port [dec], end port [dec]
```

Explanation This operation to build a TDL message for portlist add/delete has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search

Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_NAT-3-PORTLISTTYPE : Address type [dec] for global address in the portlist allocation request is not supported

Explanation An unexpected address type has occurred with received portlist allocation request message from data path

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_NAT-3-RANGETDLMSGMARSHAL : Failed to copy pool address range config message to IPC buffer for pool [chars], range start [IP_address], range end [IP_address]

Explanation This operation to build a TDL message for address range configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_NAT-3-SERTDLMSGMARSHAL : Failed to copy service config message to IPC buffer for application type [dec], protocol type [dec], port [dec]

Explanation This operation to build a TDL message for service configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-SERVICERM : Failed to delete NAT services for appl type [chars], protocol [chars], port [dec]
```

Explanation An unexpected condition has occurred which is due to the failure to remove data structures for NAT special services.

```
%FMANRP NAT-3-STATSUPDTDL : Failed to update NAT [chars] statistics
```

Explanation An unexpected condition has occurred when updating statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-TIMEOUTTDLMSGMARSHAL : Failed to copy timeout config message to IPC buffer for timeout type [dec]
```

Explanation This operation to build a TDL message for timeout configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-VRFDELTDLMSGMARSHAL : Failed to copy VRF delete message to IPC buffer for vrf table id [dec]
```

Explanation This operation to build a TDL message for vrf deletion configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-3-WLANSESSIDB : Received WLAN session message from data path with nil input interface for inside local host [IP address]
```

Explanation An unexpected condition has occurred with received WLAN session message from data path with nil input interface

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT-3-WLANSESSTDL : Error with WLAN session message received from data path
```

Explanation An unexpected condition has occurred with received WLAN session message from data path

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance

Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_NAT-3-WLANSESSTYPE : Received WLAN session message from data path with unsupported address type [dec]

Explanation An unexpected condition has occurred with received WLAN session message from data path with unsupported address type

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-4-BADACTION : Invalid action [dec] for NAT configuration
```

Explanation An unexpected condition has occurred which is invalid action for a NAT configuration.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT-4-LOGGING PARAM : Highspeed logging export [chars] [int]nsupported
```

Explanation An unsupported exporting paremeter for highspeed logging on data path is received.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show running command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT-4-NOACL : Access list is null
```

Explanation An unexpected condition has occurred which is due to the absence of an access list structure.

```
%FMANRP_NAT-4-NOLOGGINGPARAM : Highspeed logging structure is nil
```

Explanation An unexpected condition has occurred which is due to the absence of a logging parameter structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show running command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT-4-NOMAPPING : A mapping structure is null
```

Explanation An unexpected condition has occurred which is due to the absence of a NAT mapping structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT-4-NONATSERVICE : Service structure is null
```

Explanation An unexpected condition has occurred which is due to the absence of a NAT service structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-4-NOPOOL : Pool structure is null
```

Explanation An unexpected condition has occurred which is due to the absence of a NAT pool structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NAT-4-NORANGE : Pool address range structure is null
```

Explanation An unexpected condition has occurred which is due to the absence of a NAT pool address range structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%FMANRP NAT-4-NOREPLICATEPARAM : Session replication structure is nil
```

Explanation An unexpected condition has occurred which is due to the absence of a session replication parameter structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show running command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT-4-NOSWIDB : Sub-interface is null
```

Explanation An unexpected condition has occurred which is due to the absence of a swidb structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show ip interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_NAT64

```
%FMANRP NAT64-3-API FAILED : NULL
```

Explanation A call to the API of another component has indicated an error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT64-3-EINVAL : NULL
```

Explanation An unexpected input value to a function was incorrect

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_NAT66

```
%FMANRP NAT66-3-API FAILED : NULL
```

Explanation A call to the API of another component has indicated an error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NAT66-3-EINVAL : NULL
```

Explanation An unexpected input value to a function was incorrect

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_NETFLOW

 $\mbox{\ensuremath{\$FMANRP_NETFLOW-3-AGGRCACHENULL}}$: The pointer for aggregation cache type [dec] is NULL

Explanation An unexpected condition has occurred which is due to the absence of an aggregation cache data structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip cache flow command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NETFLOW-3-CACHETDLMSGMARSHAL : Failed to copy cache config message to IPC buffer for cache type [dec]
```

Explanation The operation of building a TDL message for cache configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_NETFLOW-3-CLRSTATSTDLMSGMARSHAL : Failed to copy clear statistics message to IPC buffer

Explanation The operation of building a TDL message for clearing statistics in the data path has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NETFLOW-3-EXPORTERSRCIFINVALID : Management interface ([chars]) cannot be used as source for an exporter
```

Explanation Exporter configuration failed because the management interface cannot be configured as source interface

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NETFLOW-3-EXPORTERTDLMSGMARSHAL : Failed to copy exporter config message to IPC buffer for cache type [dec]
```

Explanation The operation of building a TDL message for exporter configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NETFLOW-3-IFFLOWTDLMSGMARSHAL : Failed to copy interface flow config message to IPC buffer for [chars]
```

Explanation The operation of building a TDL message for interface flow configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NETFLOW-3-INVALIDFLOWDEFCPP : CPP Flow definition can not be created [int]
```

Explanation The operation of building a flow definition using flow fields received from CPP has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%FMANRP NETFLOW-3-NOSAMPLER : Sampler for sampler-map name [chars] is null
```

Explanation An unexpected condition has occurred which is due to the absence of a sampler-map structure

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show sampler command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NETFLOW-3-NOSAMPLERNAME : Sampler-map name is null
```

Explanation An unexpected condition has occurred which is due to the absence of a sampler-map name.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show sampler command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NETFLOW-3-SAMPLERTDLMSGMARSHAL : Failed to copy sampler-map config message to IPC buffer for [chars]
```

Explanation The operation of building a TDL message for sampler-map configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NETFLOW-3-STATSUPDTDL : Failed to update netflow [chars] statistics
```

Explanation An unexpected condition has occurred when updating statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NETFLOW-3-UNKNOWNCACHECMD : Unknown aggregation cache command [dec] received
```

Explanation The aggregation cache configuration command has failed due to unknown command.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search

Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NETFLOW-3-UNKNOWNCACHETYPE : Unknown cache type [dec] received
```

Explanation The cache configuration command has failed due to unknown cache scheme type.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_NETFLOW-4-EXPORTERVERSION : Failed to change default exporter version to [dec]
```

Explanation The operation of changing the default exporter version has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip flow export command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NETFLOW-4-NOFIBIDB : fibdb for interface [chars] is null
```

Explanation An unexpected condition has occurred which is due to the absence of a fibidb structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP NETFLOW-4-NOSWIDB : Sub-interface is null
```

Explanation An unexpected condition has occurred which is due to the absence of a swidb structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_PBR

```
%FMANRP PBR-3-INVALIDIF : The interface specified for '[chars]' is not valid
```

Explanation An non-existent interface is specified for the policy based routing route-map operation specified in the message.

Recommended Action show interface

```
%FMANRP PBR-3-RTMAP NAME NULL : The route-map name for [chars] is NULL
```

Explanation An unexpected condition has occurred due to the absence of an internal route-map data structure.

Recommended Action show route-map

```
%FMANRP PBR-3-RTMAPNULL: The route-map structure for [chars] is NULL
```

Explanation An unexpected condition has occurred due to the absence of an internal route-map data structure.

Recommended Action show route-map

```
%FMANRP_PBR-3-UNSUPPORTED_RMAP: Route-map [chars] has unsupported options for Policy-Based Routing. It has been removed from the interface, if applied.
```

Explanation The route-map attached to an interface for policy routing contains an action that is not supported on this platform. This is a hardware limitation.

Recommended Action Reconfigure the route-map. Use only 'permit' entries and 'set ip next-hop' action in the route-map.

FMANRP_PFR

```
%FMANRP PFR-4-NOINTF : PfR Interface [chars] not exist, can't be [chars]
```

Explanation An unexpected condition has occurred which is due to the absence of MCP PfR interface info.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> show oer border command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP PFR-4-NULLINPUT : NULL input, [chars]
```

Explanation An unexpected condition has occurred which is due to the NULL value of the input parameter.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show oer border command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool:

https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP PFR-4-UNSUPPORTED : Unsupported action, [chars]
```

Explanation An unexpected condition has occurred which is due to and unsupported action being executed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show oer border command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_QOS

```
%FMANRP QOS-3-ACTNOCLASSMAP : Class-map information not found
```

Explanation An unexpected condition has occured when trying to determine class-map information for one of the classes in a policy-map.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show policy-map command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP QOS-3-ACTNOPOLICYMAP : Policy-map information not found
```

Explanation An unexpected condition has occured when trying to determine policy-map information for one of the service policies attached to an interface.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show policy-map command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

 $\mbox{\sc FMANRP_QOS-3-CLPOLFAIL}$: No support for client policy with policing in class-default and marking in custom class

Explanation An internal error occured during installing gos policy.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%FMANRP_QOS-3-NOACCOUNTSTATS: account stats entry not found for class [int].[int], target [int]
```

Explanation An internal error occured when looking up account statistics.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show policy-map interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-3-NOPOLICERSTATS : policer stats entry not found for class [int].[int], target [int]
```

Explanation An internal error occured when looking up policer statistics.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show policy-map interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-3-NOSETSTATS : set stats entry not found for class [int].[int], target [int]
```

Explanation An internal error occured when looking up set statistics.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show policy-map interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP QOS-3-QOSAPIPARAM : Internal QOS API error.
```

Explanation An internal API error occured. QOS configuration may be limited.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-3-QOSCLASSDEL : Error trying to remove class [chars] from policymap [chars]
```

Explanation An operation to remove a class from a policy has failed due to an internal error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show policy-map command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-3-QOSGIDBSP: Service policy [[chars]] installation error: invalid interface type [dec]
```

Explanation An invalid interface type was encountered when trying to configure a service policy. This service policy could not be installed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show policy-map command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-3-QOSIDBSP : Service policy [[chars]] installation error: invalid interface type [dec]
```

Explanation An invalid interface type was encountered when trying to configure a service policy. This service policy could not be installed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show policy-map command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-3-QOSTDLMARSHAL : Failed to copy more than [dec] bytes of message [chars], length [dec] into IPC buffer
```

Explanation An internal error occured when trying to build an IPC message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-3-QOSTMPLCREATEFAIL: QoS template interface creation failed for policy [chars]: [chars]
```

Explanation An error occured during template interface creation

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-3-QOSTMPLDBERROR : Failed to [chars] record for policymap [chars], err [chars]
```

Explanation Database operation failed for record of the policymap

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-3-QOSTMPLDELETEFAIL : QoS template interface deletion failed for policy [chars]: [chars]
```

Explanation An error occured during template interface deletion

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-3-QOSTMPLNONEXIST : QoS template does not exist in [chars] for policymap [chars]
```

Explanation QoS template information does not exist

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-4-CLMODIFYFAIL: classmap [chars] is currently used by policymap, please remove policymap from all targets before the modification
```

Explanation An internal error occured when classmap being modified

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search

Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_QOS-4-MPOLDMVPNGRE : Only Shape and/or BRR is allowed on the QoS policy on GRE tunnel on MPoL hierarchy

Explanation An error occurred during MPoL check between DMVPN and GRE tunnel QoS policy

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_QOS-4-NOFAIRQONVC : fair-queue can not be configured on the parent queue of an ATM VC, use child queue instead

Explanation Configuring fair-queue on the parent queue of an ATM VC is not supported

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP QOS-4-QIDGENFAIL : qid generation failed, reverting to default

Explanation An internal error occured during platform qos initialization.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%FMANRP_QOS-4-QOSSTACK : Failed to install all classes for policymap [chars], excessive stack usage

Explanation An operation to configure the classes within a policymap has failed due to a resource issue. QoS configuration for this policymap is unlikely to work.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> show policy-map command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP QOS-4-QOSUBR : gos can not be attached to the target with UBR configured
```

Explanation An error occured to attach gos to ATM VC/VP target with UBR configured

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_QOS-6-QOSCLASSEXIST : class [chars] (id [int]) in policymap [chars] (id [int]) already exists
```

Explanation This is an informational message and no action is required.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show policy-map command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_SC

```
\mbox{\sc sc-3-DBGTDLMSGMARSHAL} : Failed to copy debug SC request message to IPC buffer
```

Explanation This operation to build a TDL message for debug SC command has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_SC-3-INTFTDLMSGMARSHAL : Failed to copy interface config message to IPC buffer for Interface [chars] ([hex]), operation [chars]
```

Explanation This operation to build a TDL message for interface configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP SC-3-SCIOSDENQUEUE : Failed to enqueue SC [chars] message for transmission
```

Explanation This operation to enqueue an IPC message for sending has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_SC-3-SCTXTDLMSGMARSHAL : Failed to copy service context config message to IPC buffer for sctx name id [dec]
```

Explanation This operation to build a TDL message for service context configuration has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP SC-4-NOSERVICECTX : A mapping structure is null
```

Explanation An unexpected condition has occurred which is due to the absence of a SC mapping structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP SC-4-SCBADACTION : Invalid action [dec] for SC configuration
```

Explanation An unexpected condition has occurred which is invalid action for a SC configuration.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP SC-4-SCNOSWIDB : Sub-interface is null
```

Explanation An unexpected condition has occurred which is due to the absence of a swidb structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_SSLVPN

```
%FMANRP SSLVPN-3-AAATDLERR : [chars][chars]. [chars]
```

Explanation An unexpected condition has occurred in processing AAA request/reply message causing AAA handling failure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP SSLVPN-3-CFGSTATUSERR : [chars]: [chars]
```

Explanation An unexpected condition has occurred when got status of configuration

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_SSLVPN-3-CONDDEBERR : [chars]. [chars]
```

Explanation An unexpected condition has occurred in processing conditional debug message

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_SSLVPN-3-GWERR : Failed [chars]: [chars]
```

Explanation An unexpected condition has occurred in configuration processing causing configuration failure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_SSLVPN-3-PKIERR : Failed [chars]: [chars]
```

Explanation An unexpected condition has occurred in configuration processing causing configuration failure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%FMANRP SSLVPN-3-RRICHUNKERR : [chars]
```

Explanation Error has occurred when requested memory for SSLVPN route handling

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP SSLVPN-3-RRITDLERR : [chars][chars]. [chars]
```

Explanation An unexpected condition has occurred in processing of SSLVPN route inject/remove message

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_SSLVPN-3-STATSCLEARERR: Unable to send clear WEB VPN context stats message. [chars] ([dec])
```

Explanation This operation to build a TDL messages for WEB VPN context stats clearing has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP SSLVPN-3-STATSGUPDERR: Update WEB VPN context stats error. [chars] ([dec])
```

Explanation An unexpected condition has occurred when updating global sslvpn statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP SSLVPN-3-STATSWVUPDERR : [chars]: [chars]
```

Explanation An unexpected condition has occurred when updating ssl web vpn context statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance

Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP SSLVPN-3-VWCONFERR : Failed [chars]: [chars]
```

Explanation An unexpected condition has occurred during WebVPN Context configuration causing failure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP_SSLVPN-4-AAAFRIPWARN : [chars]Invalid framed ip address [IP_address] received from AAA. Not sending user config
```

Explanation Wrong AAA server config.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMANRP_VRF

```
%FMANRP VRF-3-API FAILED : NULL
```

Explanation A call to the API of another component has indicated an error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%FMANRP VRF-3-EINVAL : NULL
```

Explanation An unexpected input value to a function was incorrect

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

FMFP

```
%FMFP-3-DP_NOMEM : DP not enough memory. [chars]
```

Explanation An object download to DP failed because the memory of DP is not enough.

Recommended Action Run show platform resource to see the memory usage

```
%FMFP-3-INTERFACE_OBJECT_NOT_FOUND : Interface object lookup by [chars] not found for interface [int]
```

Explanation The desired interface object was not found.

Recommended Action Examine the interface state in the operating system, route processor (RP) and forwarding processor (FP) forwarding manager logs.

```
%FMFP-3-OBJ DWNLD TO CPP STUCK : AOM download to CPP stuck
```

Explanation An object download from FMAN-FP to lower layer has taken more than 1 hour. It can be caused by incomplete configuration or software defects

Recommended Action Run show platform software object-manager fp [active|standby] [pending-issue-update|pending-ack-update|pending-issue-batch| pending-ack-batch|pending-ack-commands] sorted <min_pending_time> to see the sorted list of update/batch/command in pending state for more than the min_pending_time. Use 3600 for min_pending_time to see context that have been pending for more than an hour. For incomplete configuration, use show platform platform software object fp [active|standby] resolve to see if there is any resolve object

```
%FMFP-3-OBJ DWNLD TO DP FAILED: [chars] download to DP failed
```

Explanation An object has failed to download to the data plane

Recommended Action Examine the list of error objects in the forwarding processor (FP) forwarding manager asynchronous object logs.

FMFP_ACL

```
%FMFP_ACL-3-ACL_LIMIT_EXCEEDED : ACL [chars] exceeded limitation of [int] ACEs per ACL
```

Explanation A software limitation has been exceeded.

Recommended Action Reduce the access control list (ACL) configuration. A reboot of the forwarding processor (FP) is recommended.

```
%FMFP_ACL-3-ACL_MODIFY_FAILED : ACL:[chars] modification through object group edit failed
```

Explanation Object-group used in the ACL was modified. Those changes could not be accommodated in the ACL

Recommended Action Fix the object-group changes. Delete ACL and reconfigure it

```
%FMFP ACL-3-ACL OBJECT DOWNLOAD : [chars][chars] fail to download because [chars].
```

Н

Explanation The access control list (ACL) object has failed to download. This could be due to a hardware or software resource limitation or a software defect.

Recommended Action Check the logs for information on the relevant object download states. Remove the ACL attachment to the interface or delete the ACL. Reboot the forwarding processor (FP).

```
%FMFP_ACL-3-ACL_PROTOCOL_CHECK : ACL [chars] protocol does not match what was previously configured
```

Explanation The error occurs for one of two reasons. An access control list (ACL) reference was made to an ACL of a different protocol or an ACL was added or edited when there were similarly named ACL references of a different protocol

Recommended Action Remove the conflicting ACL or the conflicting ACL references.

```
%FMFP_ACL-3-SGACL_OBJECT_DOWNLOAD : SGACL Cell ([dec] [dec]) policy [chars] fail to download because [chars].
```

Explanation The SGACL policy has failed to download. This could be due to a hardware or software resource limitation or a software defect.

Recommended Action Check the logs for information on the relevant object download states. Remove the SGACL policy for that cell, correct the error and reconfigure it

FMFP_QOS

```
%FMFP_QOS-6-QOS_STATS_PROGRESS : statistics are progressing
```

Explanation QoS statistics are now progressing normally. This is an informational message.

Recommended Action No action is required.

```
%FMFP QOS-6-QOS STATS STALLED : statistics stalled
```

Explanation QoS statistics are temporarily stalled. This is an informational message.

Recommended Action No action is required.

Н

HANDOFF_FUD

```
%HANDOFF_FUD-0-HOFPGA_UPGRADE_FAILED : Handoff FPGA upgrade/downgrade failed after 2 attempts. Possible Hw-fault
```

Explanation Handoff FPGA upgrade/downgrade failed after 2 attempts. This could happen due to a hardware fault, corrupt firmware file or possible flash programming issue.

н

Recommended Action Downgrade to a lower version image to update the FPGA to a working firmware image. If the same fails, it is possibly a hardware fault. A hardware change is required. Additionally, collect Nile manager logs and provide the same to a Cisco technical support representative.

%HANDOFF_FUD-6-FPGA_INTERRUPTS_ERROR : Handoff FPGA encountered interrupts which are not getting cleared

Explanation Handoff FPGA encountered interrupts. Software is unable to clear them by processing. This is message to know when the error occurs

Recommended Action Reload of the box is the only way to remove this error. This is temoprary fix to know when the error occurs

%HANDOFF_FUD-6-HOFPGA_DOWNGRADE : Handoff FPGA is downgrading to [hex] from current FPGA version [hex], as downgrade is required for current release

Explanation Handoff FPGA needs an upgrade to the fw bundled with image

Recommended Action No user action is necessary. This is an informational message indicating nomal system operation.

```
%HANDOFF FUD-6-HOFPGA DOWNGRADE STARTED : Starting Handoff FPGA downgrade
```

Explanation Handoff FPGA is going to be downgraded with the firmware bundled with the image. Informational messgae only.

Recommended Action No user action is necessary. This is an informational message indicating nomal system operation.

%HANDOFF_FUD-6-HOFPGA_UPD_OVERRIDE_SET : ROMMON variable HOFPGA_UPD_OVERRIDE is set. Skipping upgrade for HoFPGA.

Explanation HoFPGA upgrade is being skipped since ROMMON variable HOFPGA_UPD_OVERRIDE is set. Set HOFPGA_UPD_OVERRIDE to 0 to prevent upgrade override

Recommended Action No user action is necessary. This is an informational message indicating nomal system operation.

%HANDOFF_FUD-6-HOFPGA_UPGRADE : Handoff FPGA upgrade required. Current FPGA version is [hex], Image fw version is [hex]

Explanation Handoff FPGA needs an upgrade to the fw bundled with image

Recommended Action No user action is necessary. This is an informational message indicating nomal system operation.

%HANDOFF_FUD-6-HOFPGA_UPGRADE_SKIPPED : Handoff FPGA upgrade being skipped, Current FPGA version is [hex], Image fw version is [hex].

Explanation Handoff FPGA upgraded is being skipped since the HoFPGA fw version > minimum required fw version.

Recommended Action No user action is necessary. This is an informational message indicating nomal system operation.

Н

```
%HANDOFF FUD-6-HOFPGA UPGRADE STARTED : Starting Handoff FPGA upgrade
```

Explanation Handoff FPGA is going to be upgraded with the firmware bundled with the image. Informational messgae only.

Recommended Action No user action is necessary. This is an informational message indicating nomal system operation.

```
%HANDOFF FUD-6-HOFPGA UPGRADE SUCCESSFUL : Handoff FPGA upgrade/downgrade succeeded
```

Explanation Handoff FPGA upgraded/downgrade successsfully.

Recommended Action No user action is necessary. This is an informational message indicating nomal system operation.

```
%HANDOFF_FUD-6-QDR_MULTI_BIT_ERROR_END : Handoff FPGA could encounter MBE, check at end of create update BFD session
```

Explanation Handoff FPGA QDR cntrl_reg is changed qdr_ext_ecc_gen and qdr_ext_ecc_chk is cleared. This could lead to QDR MBE Errors. This is temoprary message to know when the error occurs

Recommended Action Reload of the box is the only way to remove this error. This is temoprary fix to know when the error occurs

```
%HANDOFF_FUD-6-QDR_MULTI_BIT_ERROR_INIT : Handoff FPGA could encounter MBE, check at init of handoff fpga
```

Explanation Handoff FPGA QDR cntrl_reg is changed qdr_ext_ecc_gen and qdr_ext_ecc_chk is cleared This could lead to QDR MBE Errors. This is temoprary message to know when the error occurs

Recommended Action Reload of the box is the only way to remove this error. This is temoprary fix to know when the error occurs

```
%HANDOFF_FUD-6-QDR_MULTI_BIT_ERROR_INIT_DONE : Handoff FPGA could encounter MBE, check after init of QDR in handpff fpga
```

Explanation Handoff FPGA QDR cntrl_reg is changed qdr_ext_ecc_gen and qdr_ext_ecc_chk is cleared. This could lead to QDR MBE Errors. This is temoprary message to know when the error occurs

Recommended Action Reload of the box is the only way to remove this error. This is temoprary fix to know when the error occurs

```
%HANDOFF_FUD-6-QDR_MULTI_BIT_ERROR_START : Handoff FPGA could encounter MBE, check at start of create update BFD session
```

Explanation Handoff FPGA QDR cntrl_reg is changed qdr_ext_ecc_gen and qdr_ext_ecc_chk is cleared. This could lead to QDR MBE Errors. This is temoprary message to know when the error occurs

Recommended Action Reload of the box is the only way to remove this error. This is temoprary fix to know when the error occurs

```
%HANDOFF FUD-6-QDR MULTI BIT INTERRUPT : Handoff FPGA could encounter MBE Interrupt
```

н

Explanation Handoff FPGA QDR cntrl_reg is changed qdr_ext_ecc_gen and qdr_ext_ecc_chk is cleared. This could lead to QDR MBE Errors. This is temoprary message to know when the error occurs

Recommended Action Reload of the box is the only way to remove this error. This is temoprary fix to know when the error occurs

HMAN

```
%HMAN-2-INITIALIZATION FAILED: Host Manager initialization failed.
```

Explanation Initialization of the host manager failed.

Recommended Action Review Host Manager logs taking note of the timestamp information to select specific information to review. Copy the message and other related information exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%HMAN-3-CONSOLE_SETUP_FAILED : Failed to setup console service. It should be enabled on [chars]
```

Explanation Setup of a console service failed.

Recommended Action Check the host manager launch parameters and correct as required.

```
%HMAN-3-HOSTNAME SET FAILED : Failed to set hostname: [chars]
```

Explanation The host manager received notification that the system hostname has been set. The host manager failed to pass this value to the ASR kernel.

Recommended Action Repeat the process to configure the hostname. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool:

https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

HW_IDPROM_ENVMON

```
\ The act2 udi secure area format mismatch with unsecure area
```

Explanation This Router may not have been manufactured by Cisco or with Cisco's authorization. This product may contain software that was copied in violation of Cisco's license terms. If your use of this product is the cause of a support issue, Cisco may deny operation of the product, support under your warranty or under a Cisco technical support program such as Smartnet. Please contact Cisco's Technical Assistance Center for more information.

Н

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%HW_IDPROM_ENVMON-3-HW_IDPROM_CHECKSUM_INVALID : The idprom contains an invalid checksum in a sensor entry. Expected: [hex], calculated: [hex]
```

Explanation If this error occurs then parsing of the environmental monitoring data is aborted. Environmental monitoring will be either incomplete or absent entirely.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%HW_IDPROM_ENVMON-3-HW_IDPROM_FIELD_INVALID : The idprom contains an invalid environmental monitoring field.
```

Explanation If this error occurs then parsing of the environmental monitoring data is aborted. Environmental monitoring will be either incomplete or absent entirely.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

HW_PFU

```
%HW_PFU-3-PFU_IDPROM_CORRUPT : The PEM/FM idprom could be read, but is corrupt in slot P[dec] The system will run without environmental monitoring for this component
```

Explanation The idprom contains information required in order to properly operate the environmental monitoring subsystems. The idprom could not be read, therefore no monitoring will take place.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%HW_PFU-3-PFU_IDPROM_READ_ERR : Could not read the PEM/FM idprom in slot P[dec]. The system will run without environmental monitoring for this component
```

Explanation The idprom contains information required in order to properly operate the environmental monitoring subsystems. The idprom could not be read, therefore no monitoring will take place.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

INTERCHASSIS_REDUNDANCY

%INTERCHASSIS_REDUNDANCY-4-STDBY_PRESENT : Removal of standby RP in location [chars] is recommended for inter-chassis redundancy configuration

Explanation Removal of standby RP from the chassis is recommended for inter-chassis redundancy

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOMD_ETHER_COMMON_ERROR

%IOMD_ETHER_COMMON_ERROR-3-RATEADAPTFAIL : IOMD failed to send rate adapt message for port [dec] speed [dec] duplex [dec] reason:[chars]

Explanation IOMD failed to send message to nile

Recommended Action Examine the IOMD logs. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOMD_ETHER_GEIM

```
%IOMD_ETHER_GEIM-3-FIFO_OVERFLOW : [chars] fifo overflow occurred for port [dec]
```

Explanation A hardware error in phy has occurred

Recommended Action Examine the IOMD logs for Phy driver or hardware errors. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%IOMD_ETHER_GEIM-3-INTERRUPT_ERR : interrupt handling error [chars]
```

Explanation Interrupt could not be handled because of internal sw error

Recommended Action Examine the IOMD logs. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOMD_ETHER_GEIM_UEA

```
%IOMD_ETHER_GEIM_UEA-4-BADPOINTER: Function [chars] detected an invalid [chars] pointer of %08lX, ignoring
```

Explanation A software error has occurred, this message is displayed when an invalid pointer is detected.

Recommended Action Examine the IOMD logs. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOMD_ETHER_GEIM_UEA-4-SSFP_PORT_LIMIT_EXCEED : IOMD Detects Maximum No of SSFP:[dec] Inserted
```

Explanation Exceeding Maximum SSFP transceivers(>6) Insertion

Recommended Action Need to remove the SSFP if it exceeds the Maximum number of supported SSFP

IOMD_IMFPGA

```
%IOMD IMFPGA-3-I2C READ : An I2C read has failed for addr: [hex] reg: [hex]
```

Explanation An attempt to read the I2C bus has failed. This error could be caused by a hardware or software defect.

Recommended Action Examine the logs for I2C driver errors.

```
%IOMD_IMFPGA-3-I2C_WRITE : An I2C write has failed for addr: [hex] reg: [hex] data: [hex]
```

Explanation An attempt to write to the I2C has failed. This error could be caused by a hardware or software defect.

Recommended Action Examine the logs for I2C driver errors.

```
%IOMD IMFPGA-3-IM DEVINIT STATUS : [chars] ----> [dec]
```

Explanation Test msg to indicate status of CEM FPGA Firmware programming

Recommended Action None - do nothing

```
%IOMD IMFPGA-3-MDIO READ : An MDIO read has failed for addr: [hex] reg: [hex]
```

Explanation An attempt to read the MDIO bus has failed. This error could be caused by a hardware or software defect.

Recommended Action Examine the logs for MDIO driver errors.

```
%IOMD_IMFPGA-3-MDIO_WRITE : An MDIO write has failed for addr: [hex] reg: [hex] data: [hex]
```

Explanation An attempt to write to the MDIO has failed. This error could be caused by a hardware or software defect.

Recommended Action Examine the logs for MDIO driver errors.

IOMD_INFRA

```
%IOMD INFRA-3-I2C READ : An I2C read has failed because [chars]
```

Explanation An I2C read has failed. This could be due to a hardware or software defect.

Recommended Action Note the time of the error message and examine the logs for I2C errors. If the logs provide information about a correctable problem, correct the problem. If the problem is not correctable or the logs are not helpful, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%IOMD INFRA-3-I2C WRITE : An I2C write has failed because [chars]
```

Explanation An I2C write has failed. This could be due to a hardware or software defect.

Recommended Action Note the time of the error message and examine the logs for I2C errors. If the logs provide information about a correctable problem, correct the problem. If the problem is not correctable or the logs are not helpful, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%IOMD INFRA-3-INTR EVENT : IOMd fast thread event ([dec]).
```

Explanation IOMd fast thread event

Recommended Action Examine the logs for IOMD. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOMD_INFRA-3-INVALID_BAY_NUM : An invalid bay number is specified in one of the internal APIs. bay=[dec] max_bay=[dec]

Explanation Invalid bay number to find the TDL domain

Recommended Action Examine the logs for IOMD. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOMD_INFRA-3-INVALID_SLOT_NUM : An invalid slot number is specified in one of the internal APIs. slot=[dec] max slot=[dec]

Explanation Invalid slot number to find the TDL domain

Recommended Action Examine the logs for IOMD. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOMD INFRA-3-IPCALLOCFAIL : Failed to allocate IPC buffer [chars]
```

Explanation The IM failed to allocate a buffer for communication with RSP

Recommended Action Examine the logs for IOMD. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOMD INFRA-3-IPCSENDFAIL : IOMD failed to send a message [chars] reason: [chars]
```

Explanation IOMD failed to send message to the RP

Recommended Action Examine the logs for IOMD. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOMD_INFRA-3-LINECARDDIAGSFAILED: Module [chars] in Slot [dec] failed online diagnostics. Please use 'show post' for more details
```

Explanation Online Diag has failed. This could be due to a hardware or software defect.

Recommended Action Note the time of the error message and examine the logs for errors. If the logs provide information about a correctable problem, correct the problem. If the problem is not correctable or the logs are not helpful, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

 $10MD_INFRA-4-BADPOINTER$: Function [chars] detected an invalid [chars] pointer of 081X, ignoring

Explanation A software error has occurred, this message is displayed when an invalid pointer is detected.

Recommended Action Examine the logs for IOMD. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOMD INFRA-4-INTR OVER LIMIT : IOMd main thread disabled interrupt for [int] msec.

Explanation IOMd main thread process disabled interrupt too long

Recommended Action Examine the logs for IOMD. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOMD_INFRA-6-TDLMSG_INCOMPATIBLE : Failed to copy message [chars] to buffer, not allowed for current domain.

Explanation Failure to marshal a message indicates an incompatibility \ with the intended recipient.

Recommended Action Examine the logs for IOMD. If the problem persists, copy the message exactly as it appears on the console or in the system log. Research and attempt to resolve the issue using the tools and utilities provided at http://www.cisco.com/c/en/us/support/index.html. With some messages, these tools and utilities will supply clarifying information. Search for resolved software issues using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSD

```
%IOSD-3-BIPC REJECT : Could not accept ipc connection: [chars]
```

Explanation This error occurs if shell-manager has denied an ipc connection request from IOS.

Recommended Action Check the connection request parameters.

```
%IOSD-3-TDL PROPERTIES : Could not set message properties for connection: [chars]
```

Explanation This error occurs if shell-manager is unable to set message properties for the IOS-sman connection

Recommended Action Check the connection request parameters.

IOSD_INFRA

```
%IOSD INFRA-6-IFS DEVICE OIR : Device [chars] [chars]
```

Explanation USB inserted/removed

Recommended Action No action is required.

IOSXE_APS

```
%IOSXE APS-3-CCCONFIGFAILED: Pair config for interface [chars] Group [dec] failed
```

Explanation Pair config for interface has failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE APS-3-CONFIG FAIL : config change for interface [chars] Group [dec] failed
```

Explanation config for an interface to forwarding plane has failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE APS-3-DOWNLOADFAIL : Unable to download [chars] message to [chars]
```

Explanation An unexpected condition has occurred which resulted in a configuration not being sent to the reported process.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_APS-3-FLOWCONFIGTOCCFAILED: Flow id to cc for interface [chars] Group [dec] failed
```

Explanation Flow id to cc for an interface has failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_APS-3-FLOWIDALLOCFAILED: Allocation of APS flow ID with manager failed for interface [chars] group [dec]

Explanation An unexpected condition has occurred that allocation of APS flow ID. failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_APS-3-FLOWIDDELETIONFAILED: Deletion of APS flow ID with manager failed for interface [chars] group [dec]

Explanation An unexpected condition has occurred that deletion of APS flow ID.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_APS-3-GROUP_CONFIG_FAIL : Group change for interface [chars] Group [dec] failed

Explanation Group change for interface has failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE APS-3-PAIR CONFIG FAIL: Pair config for interface [chars] Group [dec] failed

Explanation Pair config for interface has failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

IOSXE_AUTHENTICATE

%IOSXE AUTHENTICATE-2-AUTHENTICATE FAILED: The platform authentication failed

Explanation WDC authentication failed

Recommended Action Check if WDC is programmed on this device

IOSXE_CIDB

```
%IOSXE CIDB-3-ALLOC : Failed to allocate message for CIDB message
```

Explanation When attempting to program the dataplane with a CIDB object, there was not enough memory to allocate the message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE CIDB-3-MESSAGE : Failed to send message for CIDB object
```

Explanation When the cidb object was being prepared to be sent to the data plane, there was an error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_CRYPTOBW

```
%IOSXE CRYPTOBW-3-CONF FAILED : Configuration failed
```

Explanation An error occurred when the crypto throughput configuration was attempted.

Recommended Action None

 $IOSXE_CRYPTOBW-3-EULA_NOT_ACCEPTED$: The EULA has to be accepted prior to crypto throughput configuration.

Explanation Users need to accept EULA to activate the license

Recommended Action Accept EULA for crypto throughput license

%IOSXE_CRYPTOBW-3-INVALID_CONFIG : No valid license found for the configured crypto throughput level: [chars] kbps

Explanation The boot up crypto throughput has been set to non-default level without having the valid license.

Recommended Action Install valid crypto throughput license

IOSXE_CSLIFS

```
%IOSXE CSLIFS-3-ERROR SETTING : Error setting default file system ([dec])
```

Explanation There is an error happened after calling function ifs_set_default_directory

Recommended Action Check the csl filesystem

IOSXE_CXSC

```
%IOSXE CXSC-3-ACTION : Unknown proposition action ([dec])
```

Explanation When the proposition was being sent to the data plane, the action was unknown error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE CXSC-3-ALLOC: Failed to allocate message for proposition
```

Explanation When attempting to program the dataplane with a CXSC proposition object, there was no enough memory to allocate the message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE CXSC-3-BAD PROPOSITION : Proposition obj corrupt
```

Explanation When the proposition was being sent to the data plane, the object itself is corrupt.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE CXSC-3-BAD PROTOCOLPACK : Invalid Protocol Pack object
```

Explanation When the Protocol Pack was being sent to the data plane, the object's contents were invalid.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE CXSC-3-BAD SUMMARY : Summary obj corrupt
```

Explanation When the proposition summary was being sent to the data plane, the object itself is corrupt.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_CXSC-3-FILESYSTEM_ERR: FileSystem Error ([chars]): Unable to Copy File from [chars] to [chars]
```

Explanation Unable to copy the NBAR Protocol Pack File to the file system for subsequent loading. The system will revert to the previously loaded Protocol Pack.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_CXSC-3-INSUFFICIENT_ALLOC_IOSXE_VER : Insufficent memory allocated for IOSXE version String
```

Explanation The input IOSXE Version String has insufficient memory to hold the IOSXE Version.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_CXSC-3-INSUFFICIENT_ALLOC_NBAR_VER : Insufficent memory allocated for NBAR Engine Version String
```

Explanation The input NBAR Engine Version string has insufficient memory to hold the NBAR Engine Version.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%IOSXE CXSC-3-MESSAGE : Failed to send message for proposition
```

Explanation When the proposition was being prepared for sending to the data plane, there was an error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE CXSC-3-PLATFORM TYPE : Unrecognised platform type. CPU ID [dec]
```

Explanation The platform that the cxsc service is being installed on is not recognised. The most likely cause is that this platform is not supported.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE CXSC-3-RF INIT : Failed to initialize CXSC Redundancy Facility client
```

Explanation An unexpected condition occurred where the CXSC Redundancy Facility failed to initialize.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_CXSC-3-STATISTICS_ALLOCATION : Unable to allocate space for statistics
```

Explanation During initialization, there was failure in the allocation of the memory to gather the statistics. It is non fatal, but after seeing this message, the CXSC subsystem will not be able to gather statistics.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE CXSC-3-STILE ACTIVATE : Failed to activate NBAR classification: ([dec])
```

Explanation An unexpected condition occurred where the CXSC NBAR protocol classification failed to activate.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search

Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_CXSC-4-DUAL_RP_UNSUPPORTED : Dual RPs are not supported in conjunction with CXSC
```

Explanation CXSC is not supported in a dual RP environment. To resolve this warning, either unconfigure CXSC or remove the redundant Route Processor.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_DSP

```
%IOSXE DSP-3-ENQUEFAIL : Enqueue of TDL message failed ([chars]).
```

Explanation An unexpected condition has occurred which resulted in configuration, resource, or call details not being forwarded.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_EPA

```
%IOSXE_EPA-3-ACT2_AUTHENTICATION_FAILURE : slot=[dec] subslot=[dec], spa_type=[hex], lc type=[hex].
```

Explanation ACT2 dev authentication Failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_EPA-3-AUTONEG_CFG_ERR: interface [chars] autoneg state '[chars]' is incompatible with transciever. Remove '[chars]' to allow the transceiver.
```

Explanation Autoneg Config is not compatible. Remove autoneg config on the interface to allow the transceiver

Recommended Action Remove the negotiation auto config or reinsert the previously enabled transceiver.

```
%IOSXE_EPA-3-CREATION_FAILURE : slot=[dec] subslot=[dec], spa_type=[hex],
lc type=[hex].
```

Explanation Failed to create a SPA object.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE EPA-3-NULL DEVOBJ PTR :
```

Explanation Pointer to a DEVOBJ object is NULL.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_EPA-3-NULL_DEVPSEQ_PTR :
```

Explanation Pointer to a DEVPSEQ object is NULL.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE EPA-3-NULL EPA PTR :
```

Explanation Pointer to an EPA object is NULL.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE EPA-3-NULL EPASENSOR PTR :
```

Explanation Pointer to a DEVSENSOR object is NULL.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to

gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE EPA-3-NULL FPGA PTR :
```

Explanation Pointer to a FPGA object is NULL.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE EPA-3-NULL PORT PTR :
```

Explanation Pointer to a PORT object is NULL.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE EPA-3-NULL VFT :
```

Explanation Pointer to a DEVSENSOR object is NULL.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_EPA-3-NULL_VSC_PHY_INFO_PTR :
```

Explanation Pointer to a VSC PHY INFO object is NULL.

%IOSXE_EPA-3-UNSUPPORTED_XCVR : Transceiver type [chars] is not allowed on spa [chars], port [dec],

Explanation This transceiver is not allowed on the SPA

Recommended Action Consult the documentation and ensure supported transceivers are plugged into the SPA

%IOSXE_EPA-3-XCVR_EC_BWMISMATCH : Trasnsceiver bandwidth is incompatible with Port-channel[dec] allowed bandwidth. Remove 'channel-group [dec]' config for interface [chars] to allow the transceiver

Explanation The interface port into which the transceiver is inserted is part of a Port-channel. The Port-channel has member links whose bandwidth doesn't match with the inserted transceier's bandwidth. Since, port-channel cannot allow heterogenous bandwidth links, this transceiver is not allowed in to the port.

Recommended Action Remove the channel-group config for the port where transceiver is inserted or insert a transceiver whose bandwidth is compatible with the port-channel bandwidth

%IOSXE_EPA-3-XCVR_PROHIBIT : Transceiver is prohibited to come online for interface [chars]

Explanation XCVR is prohibited on the interface

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_ETHERCHAN

%IOSXE_ETHERCHAN-3-LINK_MTU_FAIL : Failure in changing MTU of interface [chars] to port-channel [chars] MTU

Explanation The MTU for the interface mentioned in the message cannot be changed to match the MTU configured on the port channel interface

Recommended Action Remove the link mentioned in the message from the port-channel group

%IOSXE_ETHERCHAN-6-LINK_MTU: Interface [chars] MTU set to port-channel [chars] MTU [dec]

Explanation The MTU for the interface mentioned in the message is changed to match the MTU configured on the port channel interface

Recommended Action No action is required.

IOSXE_EZMENU

```
%IOSXE_EZMENU-3-VIRT_SRVC_REGISTER : Failed to register '[chars]' with virtual service manager
```

Explanation An unexpected error has occured while trying to register this virtual service with the virtual service manager. This has prevented the virtual service from being enabled/disabled.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_FMANRP

```
%IOSXE_FMANRP-3-EPOCHTDLMSGMARSHAL : Failed to copy epoch TDL message to IPC buffer, epoch number [dec]
```

Explanation This operation to build a TDL messages for epoch message has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP-3-MSGENQERR : Unable to enqueue IPC messages to IOS IPC queue. Message: [chars].
```

Explanation An unexpected condition has occurred while IOS trying to enqueue IPC message to IOS IPC queue in order to send the message to Forwarding Manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP-3-MSGMARSHALERR : Unable to copy IPC messages into transport buffer. Message: [chars]
```

Explanation An unexpected condition has occurred while IOS trying to copy IPC message to transport buffer in order to send the message from IOSd to Forwarding Manager.

%IOSXE_FMANRP-4-MSGDISPATCH : Unable to dispatch received TDL message '[chars]' from Forwarding Manager. LUID: [chars]

Explanation An unexpected condition has occurred while IOS trying to dispatch the TDL message handler functions for received TDL messages from Forwarding Manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP-4-MSGDISPATCHNULL : TDL messages NULL from IOS.
```

Explanation An unexpected condition has occurred while IOS trying to dispatch the TDL message handler functions for received TDL messages from Forwarding Manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP-4-MSGIPCERR : Unable to process received IPC messages from Forwarding Manager, error: [chars].
```

Explanation An unexpected condition has occurred while IOS trying to process received IPC message from Forwarding Manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP-4-MSGNONTDLSTATSERR : Unable to process received non-TDL stats message from Forwarding Manager, error: [chars] ([dec]).
```

Explanation An unexpected condition has occurred while IOS trying to process received non-TDL stats message from Forwarding Manager.

IOSXE_FMANRP_ADJ

```
%IOSXE_FMANRP_ADJ-3-ENCSIZE: Invalid encap length [dec] which is larger than max allowed [dec] bytes
```

Explanation An unexpected condition has occurred which is due to invalid adjacency encapsulation size being larger than the maximum value allowed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP_ADJ-3-ENQUEFAIL : Unable to send [chars] [chars] message to Forwarding Manager Process
```

Explanation An unexpected condition has occurred which resulted in a configuration not being sent to the Forwarding Manager Processs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP ADJ-3-NOADJ : Adjacency entry is null
```

Explanation An unexpected condition has occurred which is due to the absence of an adjacency entry structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> show adjacency command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP ADJ-3-NOFIBHWIDB : FIB Interface [chars] is null
```

Explanation An unexpected condition has occurred which is due to the absence of a FIB interface structure.

IOSXE_FMANRP_CCE

```
%IOSXE FMANRP CCE-3-CCE CLASS CREATE : Unable to create class [int].[int]
```

Explanation An error occured when trying to create a class-map.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show policy-map [type <policy type> <name>] command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP CCE-3-CCE FILTER OVERFLOW : Filter list overflow at type [chars]
```

Explanation An internal error occured when trying to build class-map information for one of the classes in a policy-map.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show class-map [type <class type> <name>] command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP CCE-3-CCE INVALID FILTER RELN : Invalid filter relation [int]
```

Explanation An internal error occured when trying to build class-map information for one of the classes in a policy-map.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show policy-map [type <policy type> <name>] command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

Explanation When configure nested classes as match statements, the total levels of nested classes cannot exceed 4 layers

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show class-map [type <class type> <name>] command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP CCE-4-CCE STACK LIMIT : Failed to create class [dec] filter list
```

Explanation An operation to send a filter list to the forwarding processor for a particular class has failed due to a resource issue. This may imply that the notification was dropped.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show class-map [type class type>cisco.com/go/sa/. Issue the CmdBold show class-map [type class type>Namehttps://cway.cisco.com/go/sa/. Issue the CmdBold show class-map [type class type sarch Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_FMANRP_CEF

```
%IOSXE_FMANRP_CEF-3-ENQUEFAIL : Unable to send [chars] [chars] message to Forwarding Manager Process
```

Explanation An unexpected condition has occurred which resulted in a configuration not being sent to the Forwarding Manager Processs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP CEF-3-NOFIB : FIB entry is null
```

Explanation An unexpected condition has occurred which is due to the absence of a FIB entry structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> show ip cef command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP CEF-3-NOFIBIDB : FIB interface is null
```

Explanation An unexpected condition has occurred which is due to the absence of a FIB interface structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip cef command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP CEF-3-NOFIBPUSHCNT : FIB push counter is null
```

Explanation An unexpected condition has occurred which is due to the absence of a FIB push counter structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip cef command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP CEF-3-NOFIBSB : FIB SB entry is null
```

Explanation An unexpected condition has occurred which is due to the absence of a FIB SB entry structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show ip cef command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP CEF-3-NOFIBTABLE : FIB table is null
```

Explanation An unexpected condition has occurred which is due to the absence of a FIB table structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show ip cef command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP CEF-3-NONATADDR : NAT address is null
```

Explanation An unexpected condition has occurred which is due to the absence of an NAT address.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip alias command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP_CEF-3-ROUTEMSGMARSHAL : Failed to copy route essage to IPC buffer for prefix [chars]/[dec] -[chars]
```

Explanation This operation to build a TDL messages for route download has failed.

representative with the gathered information.

```
%IOSXE FMANRP CEF-4-UPDFRAGSTATSERR : Update IP Fragmentation statistics error
```

Explanation An unexpected condition has occurred when updating fragmentation statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP_CEF-4-UPDREASSSTATSERR : Update IP Reassembly statistics error
```

Explanation An unexpected condition has occurred when updating reassembly statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP CEF-4-UPDSTATSERR: Update CEF statistics error
```

Explanation An unexpected condition has occurred when updating cef statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_FMANRP_EFP

```
%IOSXE_FMANRP_EFP-3-EFP_ACCOUNTING_ERROR : [chars] FMAN EFP support has encounterd an EFP accounting error on [chars]: [chars]
```

Explanation An inavlid EFP count found during EFP accouting in IOSXE FMAN EFP support.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ethernet service instance detail command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP_EFP-3-EFP_AVL_DELETE : Failed to delete EFP node with id [dec] in [chars]
```

Explanation An unexpected condition during configuration change

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_FMANRP_EFP-3-EFP_CFM_ERROR: IOSXE FMAN EFP has encounterd an unsupported encap for CFM. Please remove any CFM configuration befor applying this encap.

Explanation The encapusiation type is not supported for CFM on IOSXE.

Recommended Action Remove any CFM config and reapply encapusation

```
%IOSXE_FMANRP_EFP-3-INVALID_VALUE : Configuration specified invalid value [dec] for [chars]
```

Explanation An unexpected condition in which configuration has accepted an invalid value.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_FMANRP_EOAM

```
%IOSXE_FMANRP_EOAM-3-IOSXE_FMANRP_EOAM_CONFIG : MIP Filtering enable/disable will take into affect only if it is applied before applying any cfm config.
```

Explanation MIP filtering enable/disable should be applied before applying cfm config. Otherwise the command will have no affect on CFM Filtering.

Recommended Action show platform software eoam fp active cfm global

IOSXE_FMANRP_ETHER_DPLB

```
%IOSXE_FMANRP_ETHER_DPLB-3-INVALIDIF : Configuration specified invalid value [dec] for [chars]
```

Explanation An non-existent interface is specified for ETHER_DPLB operation.

Recommended Action show interface

```
%IOSXE_FMANRP_ETHER_DPLB-3-IOSXE_FMANRP_ETHER_DPLB_STATS : Invalid stats update. type [dec], id [dec]
```

Explanation An invalid stats update is received by ETHER_DPLB.

Recommended Action show platform software ether_dplb

IOSXE_FMANRP_FPM

%IOSXE_FMANRP_FPM-3-NOSTATUPDATE : Failed to update class-map statistics during periodic update

Explanation A statistics update for a class-map has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP FPM-4-INVALIDACTION : FPM feature action is invalid [dec]
```

Explanation An unexpected condition has occurred which is due to the invalid action type when trying to bind FPM action with target class group.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP FPM-4-INVALIDLENTYPE : Field length type in PHDF file is invalid
```

Explanation An unexpected condition has occurred which is due to the invalid field length type in PHDF file.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP FPM-4-INVALIDMATCHTYPE : FPM match type is invalid [dec]
```

Explanation An unexpected condition has occurred which is due to the invalid FPM match type in one of FPM class-map filter match entry

IOSXE_FMANRP_IPHC

%IOSXE_FMANRP_IPHC-4-INVALIDSTATSTYPE : IP header compression statistic message received has invalid stats type

Explanation When receiving an IP header compression statistic update for an interface or sub-interface in IOS, the statistic type in that message is invalid.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP_IPHC-4-NOIDB : IOS interface ([chars]) is not available for an IP header compression statistics update message
```

Explanation When receiving an IP header compression statistic update for an interface or sub-interface in IOS, one of data structures in IOS to store those IP header compression statistics is NULL

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP_IPHC-4-STATSERR : There is error when processing IP header compression statistic message received on IOS
```

Explanation When receiving an IP header compression statistic update for an interface or sub-interface in IOS, an unexpected error occurred

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_FMANRP_L2FIB

```
%IOSXE_FMANRP_L2FIB-3-INVALIDIF : Configuration specified invalid value [dec] for [chars]
```

Explanation An non-existent interface is specified for L2FIB operation.

Recommended Action show interface

%IOSXE_FMANRP_L2FIB-3-IOSXE_FMANRP_L2FIB_STATS : Invalid stats update. type [dec], id [dec]

Explanation An invalid stats update is received by L2FIB.

Recommended Action show platform software I2fib

IOSXE_FMANRP_LISP_SFLTR

%IOSXE_FMANRP_LISP_SFLTR-3-UPDENTRYSTATSERR : Update LISP-SFLTR Entry statistics error

Explanation An unexpected condition has occurred when updating lisp-sfltr entry statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_FMANRP_LISP_SFLTR-3-UPDTABLESTATSERR : Update LISP-SFLTR Table statistics error

Explanation An unexpected condition has occurred when updating lisp-sfltr table statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_FMANRP_MACSEC

%IOSXE_FMANRP_MACSEC-3-INVALIDIF : Configuration specified invalid value [dec] for [chars]

Explanation An non-existent interface is specified for MACSEC operation.

Recommended Action show interface

%IOSXE_FMANRP_MACSEC-3-IOSXE_FMANRP_MACSEC_STATS : Invalid stats update. type [dec], id [dec]

Explanation An invalid stats update is received by MACSEC.

Recommended Action show platform software macsec

IOSXE_FMANRP_MCAST

```
%IOSXE FMANRP MCAST-3-FMANRP BADMAF : Unknown Multicast AF [dec])
```

Explanation An unexpected condition has occurred due to the download of an unknown MFIB address family code.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> show mfib command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP_MCAST-3-FMANRP DELID : Failed to remove Multicast ID [dec])
```

Explanation An unexpected condition has occurred due to the failure to delete an internal identifier that is no longer in use.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show mfib command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP_MCAST-3-FMANRP_MCAP : Multicast Capability ([chars]:[chars]), error [chars])
```

Explanation An unexpected condition has occurred due to the failure to set a multicast capability for this platform.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> show mfib state cap command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
IOSXE\_FMANRP\_MCAST-3-FMANRP\_MSTATS : Can't process multicast stats upload from fman. type [dec], id [dec]
```

Explanation An unexpected condition has occurred, preventing interpretation of the stats message from the forwarding manager. This will prevent the statistics for the affected multicast entries from being updated.

```
%IOSXE_FMANRP_MCAST-3-FMANRP_NOID : No Multicast ID for ([IP_address], [IP_address]/[dec]), action [IP address]
```

Explanation An unexpected condition has occurred due to the failure to allocate an internal identifier (ID), the multicast route will use a default empty mlist ID, causing all traffic to this route to be blackholed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip mroute count command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP_MCAST-3-FMANRP_UPDINTF : Failed to update flag count for [chars], due to [chars]
```

Explanation An unexpected condition has occurred due to the failure to update the interface flag count

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show mfib command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP MCAST-3-MCASTID : Multicast ID management error
```

Explanation An unexpected condition has occurred, causing an internal ID to not be properly handled or disposed of

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip mroute count command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_FMANRP_OBJID2

```
%IOSXE_FMANRP_OBJID2-3-DUPCREATE : Duplicate forwarding object creation obj_handle [hex], type [int], existing obj_id [hex], type [int]
```

Explanation An unexpected condition has occurred which results in duplicate forwarding object creation with different object types.

IOSXE_FMANRP_OBJID

```
%IOSXE_FMANRP_OBJID-5-DUPCREATE : Duplicate forwarding object creation obj_handle [hex], type [int], existing obj_id [hex], type [int]
```

Explanation An unexpected condition has occurred which results in duplicate forwarding object creation.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_FMANRP_RTMAP

```
%IOSXE FMANRP RTMAP-3-INVALID LIST : NULL
```

Explanation An internal list structure has been detected as invalid.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP RTMAP-3-RTMAPNULL : The route-map structure for [chars] is null
```

Explanation An unexpected condition has occurred which is due to the absence of a route-map data structure.

Recommended Action show route-map

```
%IOSXE_FMANRP_RTMAP-3-RTMAP_UNSUPPORTED : Routemap ([chars]) contain unsupported match/set clause, ignored
```

Explanation A map contains unsupported match or set clause

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_FMANRP_RTMAP-4-UNKOWNCLIANT : Unknown client type [dec] received
```

Explanation An unexpected known client type is received for route-map download.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold>https://cway.cisco.com/go/sa/. Issue the CmdBold>CmdBold>CmdBold>CmdBold>CmdBold>https://cway.cisco.com/go/sa/. Issue the CmdBold. Issue the CmdBold. Issue the CmdBold. Issue the CmdBold. Issue the CmdBold. Issue the CmdBold. Issue the https://cway.cisco.com/go/sa/. Issue the https://cway.cisco.com/go/sa/. Issue the https://cway.cisco.com/go/sa/. Issue the https://cway.cisco

data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_FMANRP_URPF

```
%IOSXE_FMANRP_URPF-3-INVALIDIFHDL : Invalid interface handle [int] for interface (number= [int], swidb= [hex], name= [chars])
```

Explanation An unexpected condition has occurred which is due to an invalid interface handle

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP URPF-4-NOV4SWIDB : v4 sub-interface is null
```

Explanation An unexpected condition has occurred which is due to the absence of a v4 swidb structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show ip interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE FMANRP URPF-4-NOV6SWIDB : v6 sub-interface is null
```

Explanation An unexpected condition has occurred which is due to the absence of a v6 swidb structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ipv6 interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
\$IOSXE\_FMANRP\_URPF-4-UPDV4STATSERR : Update v4 URPF statistics error
```

Explanation An unexpected condition has occurred when updating v4 URPF statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <a href="cmage-command-

provide the representative with the gathered information.

```
%IOSXE FMANRP URPF-4-UPDV6STATSERR : Update v6 URPF statistics error
```

Explanation An unexpected condition has occurred when updating v6 URPF statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ipv6 interface <name> command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_FMANRP_VPLS

```
%IOSXE_FMANRP_VPLS-3-INVALID_VALUE : Invalid value for [chars]
```

Explanation An unexpected condition in which an invalid value is get during VPLS configuration.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_FMANRP_ZONES

```
%IOSXE_FMANRP_ZONES-3-NOSTATUPDATE : Failed to update zone-pair statistics during periodic update (zone [chars], class [int])
```

Explanation A statistics update for a zone-pair has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_INFRA

```
%IOSXE_INFRA-2-FATAL_NO_PUNT_KEEPALIVE : Keepalive not received for [int] seconds resetting
```

Explanation Punt Inject keepalive message was not received

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance

Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-APP_SESS_OPEN_FAILED : An attempt to open [chars] with handle number [dec] has failed ([dec])
```

Explanation Application session between processes failed to estabish.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-BSO_MSG_CACHE_ERR : BSO mmessage query cache update error
```

Explanation BSO mmessage query cache update error

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-BSO MSG HDR LENGTH ERR : BSO message header length [int] is incorrect
```

Explanation BSO message header length is incorrect

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-BSO_MSG_HDR_MSGTYPE_ERR : BSO message header msgtype [int] is incorrect
```

Explanation BSO message header msgtype is incorrect

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-BSO MSG UNMARSHAL ERR : BSO message unmarshalling has failed
```

Explanation BSO message unmarshalling has failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search

Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-CONSOLE_DBUG_DROP : System dropped [dec] bytes of console debug messages.
```

Explanation Debugging messages are being generated faster than they can be displayed on the console. The messages can not be guaranteed to be seen so this message replaces the lost messages.

Recommended Action Consider using conditional debugging or turning off console logging.

```
%IOSXE_INFRA-3-CYAN_API_ERROR : Failed to retrieve platform dependent value of [chars] (err=[dec])
```

Explanation CYAN API function failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-IFS_DFLT_FS_REG_FAIL : Unable to set [chars] as a default file system.
```

Explanation IOSXE's platform dependent code failed to register the default file system.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-IFS EXTLINK ADD FAIL : Could not add filesystem [chars] to IFS links
```

Explanation Attempt to add filesystem root to allow for links failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-IFS_INIT_HIDDEN_FAIL : IOSXE shim layer initialization failed: Can not create receiving queues
```

Explanation IOSXE IOS shim layer initialization of hidden path watch failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-IFS UDEV REMOVE FAIL : Could not remove udev device [chars]
```

Explanation Attempt to remove udev device failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-INJECT_EMBEDDED_HDR_LENGTH_ERR : Can't allot space needed for embedded inject hdr size [int] exceeds limit
```

Explanation Can't allot space needed for embedded inject header, exceeds pak header space

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-INJECT FEATURE ESS ERR : ESS segment not found, type [dec] hdl [hex]
```

Explanation Packets to be injected to an unsupported ESS segment

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-INJECT GSB CTL INIT FAIL : Inject adjacency subblock init failed
```

Explanation Adj subblock control or register failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-INJECT HDR LENGTH ERR : Inject hdr size [int] exceeds limit
```

Explanation Inject header length exceeds pak header space

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-INJECT_NO_IF_OUTPUT_ERR : Output intf is NULL, [chars]
```

Explanation Output intf is requied to proceed, else skip the feautre

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-INVALID ERRMSG : Error message type [dec] not defined
```

Explanation Error message type used is not defined in IOSXE infrastruction

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-INVALID RUNTIME IDX : Thread runtime index [dec] is not valid
```

Explanation Export the thread's running time failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
IOSXE_INFRA-3-PUNT_ADDR_RES_ENCAP_ERR: Punted address resolution packet with unknown encap [chars]
```

Explanation Punted packet for ARP/ND with encap not supported

```
%IOSXE_INFRA-3-PUNT_INCOMP_WRONG_ADJID : Punted address resolution packet linktype [chars], adj-id [dec] is with linktype [chars]
```

Explanation CPP needs to punt incomplete adjacency for resolution by specifying the adjacency-id, but the included adjacency-id does not match the incomplete adjacency this packet triggered.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-PUNT KEEPALIVE LOG ERR ALLOC CSB : Failed to allocate a csb
```

Explanation Can't allocate a csb when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-PUNT_KEEPALIVE_LOG_ERR_ALLOC_TTY : Failed to allocate a tty
```

Explanation Can't allocate a TTY when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-PUNT KEEPALIVE LOG ERR OPEN FILE : Failed to open file: [chars]
```

Explanation Failed to open file when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-PUNT_KEEPALIVE_LOG_ERR_PARSE_CMD : Failed to parse command: [chars]
```

Explanation Failed to parse a command when generating punt err log

```
%IOSXE_INFRA-3-PUNT_KEEPALIVE_LOG_ERR_WRITE_TO_FILE : Write to file Id [dec] failed [dec] bytes, expected [dec] bytes
```

Explanation Write to file failed when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-PUNT_SVC_PROC_ERR : Punt service [chars] create failed
```

Explanation Punt service process can not be created

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-PUNT_SVC_TYPE_UNKNOWN : Punted packet with unknown service type [int]
```

Explanation Punted pak with an unsupported service type

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-RELOAD_INFO_SAVE_FAIL : Unable to save reload information: [dec]: [chars].
```

Explanation IOSXE's platform dependent code failed to save the reload information.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-SHIM_INIT_DISPATCH_INIT_FAIL : IOSXE shim layer initialization, dispatch path init failed.
```

Explanation IOSXE IOS shim layer initialization of TDL disatch path

%IOSXE_INFRA-3-SHIM_INIT_MEM_FAIL : IOSXE shim layer initialization failed: Memory initialization failed.

Explanation IOSXE IOS shim layer initialization of memory failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-SHIM_INIT_PROC_FAIL : IOSXE shim layer initialization failed: Dispatch process creation failed
```

Explanation IOSXE IOS shim layer initialization creating dispatch process failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-SHIM_INIT_TDL_FAIL : IOSXE shim layer initialization TDL Lib [chars] failed.
```

Explanation IOSXE IOS shim layer initialization of TDL library

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
\$IOSXE\_INFRA-3-SHIM\_INIT\_WQ\_CHASFS\_FAIL: IOSXE shim layer initialization failed: Can not create receiving chasfs watched queue
```

Explanation IOSXE IOS shim layer initialization of watched queue failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-SHIM_INIT_WQ_FAIL : IOSXE shim layer initialization failed: Can not create receiving queues
```

Explanation IOSXE IOS shim layer initialization of watched gueue failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search

Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-SHIM_IPC_NOT_PROCESSED : msg handler returned FALSE for IPC msg for fd [dec], seq num [dec], service [chars]
```

Explanation None

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-SHIM_NO_IPC_DISPATCH_HDL : IOSXE shim layer [chars] process message without IPC dispatch handler.
```

Explanation IOSXE IOS shim layer has no ipc dispatch handler set

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-SHIM_RXMSG_NO_IPC_HDL : IOSXE shim layer without IPC handler for fd [dec], seqnum [dec].
```

Explanation IOSXE IOS shim layer cannot find ipc handler

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-3-SN IPFRR PROC ERR : Static Nexthop IPFRR [chars] create failed
```

Explanation SN IPFRR process can not be created

```
%IOSXE_INFRA-3-SWIFT_ORCH_PROC_FAIL : IOSXE SWIFT Orchestrator process creation failed
```

Explanation The SWIFT Orchestrator process could not be created

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-3-VM_PAGE_TABLE_ERR : VM guarded page operation failed, address [hex], [chars]
```

Explanation VM guarded page avl tree operation error

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
\mbox{\ensuremath{\$IOSXE\_INFRA-4-BSO\_MSG\_RIB\_WATCH\_WARN}} : BSO message RIB watch start error
```

Explanation BSO message RIB watch start error

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-4-INJECT_TUN_NONIP_WARN : pak with linktype [chars] gets into non-ip tunnel
```

Explanation IP/IPv6/MPLS packet should to go through GRE tunnel for non-IP payload

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-4-NO PUNT KEEPALIVE : Keepalive not received for [int] seconds
```

Explanation Punt Inject keepalive message was not received

```
%IOSXE_INFRA-4-PUNT_KEEPALIVE_LOG_ERR_CLOSE_FILE : Failed to close file with descriptor: [dec]
```

Explanation Closing of file failed when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-4-PUNT_KEEPALIVE_LOG_ERR_GET_FILE_NAME : Failed to get file name
```

Explanation Could not form a file name when generating punt err logPunt keepalive log error seen

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-4-PUNT KEEPALIVE LOG ERR GET PROCID : Failed to get process id
```

Explanation Can't get identifier of the process generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-4-PUNT KEEPALIVE LOG ERR INV FILE ID : Invalid file descriptor: [dec]
```

Explanation Invalid file descriptor was found when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-4-PUNT KEEPALIVE LOG ERR INV PARAM : Invalid parameter: [chars]
```

Explanation Invalid parameter was passed when generating punt err log

%IOSXE_INFRA-4-PUNT_KEEPALIVE_LOG_ERR_INV_PROCID : Invalid proc id [dec], expected [dec]

Explanation Invalid process trying to generate punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE INFRA-5-PUNT SVC CANT ENQUEUE: Punted pak can't be enqueued for service

Explanation Punted pak enqueue failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

 $\$IOSXE_INFRA-5-PUNT_SVC_INVALID_OPT_PKT$: Invalid IPv4 options packet punted to RP

Explanation Invalid IPv4 options packet dropped in RP

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE INFRA-6-AUXTHD REQUEST: Too many outstanding requests for file system access

Explanation Resource temporarily unavailable

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_INFRA-6-CHASFS_CLOCK_SET_FAIL : Failed to set Chasfs property on system time change

Explanation Unable to set chasfs property on system time change

representative with the gathered information.

```
%IOSXE INFRA-6-CONSOLE ACTIVE : [chars]
```

Explanation Indicates that the current instance of IOS is assuming active control of the console. This is informational.

Recommended Action No action is required.

```
%IOSXE INFRA-6-PLATFORM RELOAD : [chars]
```

Explanation Indicates that the current instance of IOS is being reset by the platform code. This is part of a normal reset sequence and the message is informational.

Recommended Action No action is required.

```
%IOSXE_INFRA-6-PROCPATH_CLIENT_HOG : IOS shim client '[chars]' has taken %ld msec (runtime: %ld msec) to process a '[chars]' message
```

Explanation The specified IOSXE IOS shim client has taken too long to process a received IPC or chasfs message

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_INFRA-6-SHIM_RXMSG_IPC_INFO : IOS shim layer process IPC msg for fd [dec], seq num [dec], ipc status [dec]
```

Explanation None

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE INFRA-6-THEAD SELECT ERR : Inbound message or packet select error, [chars].
```

Explanation Socket select operation error in threads

IOSXE_LICENSE_RP

%IOSXE_LICENSE_RP-3-UNREGISTER_FAIL : License unregistration not successful for feature [chars]

Explanation Unregistration failed as license was not released.

Recommended Action License has to be released before unregistering

IOSXE_LMANRP

 $IOSXE_LMANRP-3-MSGDISPATCH$: Unable to dispatch received TDL message from lman daemon.

Explanation An unexpected condition has occurred while IOS was trying to dispatch a TDL message received from Iman daemon.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_LMANRP-3-MSGINITFAIL : Failed to initalize required 1man resource: [chars]
```

Explanation During the initialization of the resources required by Iman, a failure occured. This has prevented Iman from being activated.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_LMANRP-3-MSGOPERATION : Unable to [chars] the [chars] to license manager, i.e., lman daemon. Error: [dec]
```

Explanation An unexpected condition has occurred while IOS was trying to send a TDL message to Iman daemon.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_MEMPOOL_MIB

%IOSXE_MEMPOOL_MIB-3-BUFFPOOL_REG_ERROR: Bufferpool register data exceeds allocated memory; Retrieved only [dec] entries.

Explanation Memory allocated is not enough

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_MGMTVRF

```
%IOSXE MGMTVRF-3-AFI ATTACH FAIL : Management VRF AFI [chars] attach failed
```

Explanation Can not create afi subblock for mgmt vrf

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE MGMTVRF-3-INTF ATTACH FAIL : Management VRF attach to mgmt [chars] failed
```

Explanation Can not associate mgmt port to mgmt vrf

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_MGMTVRF-3-PROCESS_CREATE_FAIL : Management VRF process creation failed, [chars]
```

Explanation Can not create IOS process for mgmt port init

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_MGMTVRF-3-SET_TABLEID_FAIL : Installing [chars] Management interface tableid [hex] failed
```

Explanation Fail to set mgmt port tableid into Linux kernel

representative with the gathered information.

```
%IOSXE MGMTVRF-3-VRF CREATE FAIL : Management VRF creation failed [chars]
```

Explanation Can not create mgmt vrf during system init

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_MGMTVRF-6-CREATE_SUCCESS_INFO : Management vrf [chars] created with ID [dec], ipv4 table-id [hex], ipv6 table-id [hex]
```

Explanation mgmt vrf and ipv4, ipv6 tables created for mgmt port

Recommended Action None

IOSXE_MLP

```
%IOSXE MLP-2-DB ALLOC FAIL : MLP link db allocation failed
```

Explanation MLP link database error. Memory chunk creation for MLP link database has failed.

Recommended Action Check for accurate memory management. Perform memory leak checks and look for memory corruption causes. Execute 'show proc memory' command.

```
%IOSXE MLP-2-DB DELETE FAIL : MLP link db entry delete for link [chars] failed
```

Explanation MLP link database error. Removal of entry from MLP link database has failed.

Recommended Action Check for accurate memory management. Perform memory leak checks, look for mamory corruption causes and check for correct database management. Execute 'show proc memory' command.

```
%IOSXE MLP-2-DB DESTROY FAIL : MLP link database destroy failed
```

Explanation MLP link database error. Memory chunk destroy has failed for MLP link database.

Recommended Action Check for accurate memory management. Perform memory leak checks and look for memory corruption causes. Execute show proc memory command.

```
%IOSXE_MLP-2-DB_ENTRY_ALLOC_FAIL : MLP link db entry allocation for link [chars] failed
```

Explanation MLP link database error. Memory chunk allocation for MLP link database entry has failed.

Recommended Action Check for accurate memory management. Perform memory leak checks and look for memory corruption causes. Execute 'show proc memory' command.

```
%IOSXE MLP-2-DB ENTRY FREE FAIL : MLP link entry free failed
```

Explanation MLP link database error. Memory chunk free of MLP link database entry has failed.

Recommended Action Check for accurate memory management. Perform memory leak checks and look for memory corruption causes. Execute 'show proc memory' command.

```
%IOSXE MLP-2-DB INSERT FAIL: MLP link db entry add for interface [chars] failed
```

Explanation MLP link database error. Insertion of a new entry into MLP link database has failed.

Recommended Action Check for accurate memory management. Perform memory leak checks, look for memory corruption causes, verify correct database management. Execute 'show proc memory' command.

```
%IOSXE_MLP-3-ENQUEFAIL : Unable to send [chars] [chars] message to Forwarding Manager Process
```

Explanation An unexpected condition has occurred which resulted in a configuration not being sent to the Forwarding Manager Processs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE MLP-4-UPDSTATSERR : Update MLP statistics error
```

Explanation An unexpected condition has occurred when updating mlp statistics

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_MMA

```
%IOSXE_MMA-3-ENQUEFAIL : Enqueue of TDL message failed ([chars]).
```

Explanation An unexpected condition has occurred which resulted in configuration details not being forwarded.

IOSXE_MMA_FMP

```
%IOSXE_MMA_FMP-3-ENQUEFAIL : Enqueue of TDL message failed ([chars]).
```

Explanation An unexpected condition has occurred which resulted in configuration details not being forwarded.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_OIR

```
%IOSXE OIR-3-MODULE : Missing [chars] for [chars]
```

Explanation A hardware or software error occurred.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_OIR-3-OIRTWICE : Subslot [int]/[int] OIR insertion/removal not paired up: [chars]
```

Explanation An internal OIR-related error occured for the specified SPA.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_OIR-3-POWER_CYCLE_IMMINENT : The SPA in subslot [int]/[int] will be power cycled in [dec] seconds.
```

Explanation The SPA in the specified subslot will be power cycled in the amount of time specified in the error message.

Recommended Action No action is required.

```
%IOSXE OIR-3-PROCMSG : Process msg send failed for process[dec]
```

Explanation Process message send failed.

representative with the gathered information.

```
%IOSXE OIR-3-QUIESCE FAIL : Quiesce failed for subslot [int]/[int] (error = [dec])
```

Explanation The RP failed to contact the SPA during failover. The SPA will be reset.

Recommended Action No action is required.

```
%IOSXE_OIR-3-SPA_INTF_ID_ALLOC_FAILED : Failed to allocate interface identifiers for SPA([chars]) in slot/bay: [int]/[int]
```

Explanation Failed to get CC buffer and flow control identifiers for the SPA in the specified subslot Traffic cannot flow through the SPA under this failure condition. This can happen if the system runs out of available identifiers.

Recommended Action Try to reduce the number of interfaces configured in the system either by physically removing the SPAs or by changing the system configuration

```
%IOSXE_OIR-3-SPA_MDR_FAIL : Minimal Disruptive Restart process failed for SPA in subslot [int]/[int], reason [chars].
```

Explanation The SPA in the subslot failed Minimal Disruptive Restart. Minimal Disruptive Restart process is aborted and an attempt will be made to recover the SPA by resetting the SPA hardware.

Recommended Action No action is required.

```
%IOSXE_OIR-3-UNQUIESCE_FAIL : Unquiesce failed for subslot [int]/[int] (error = [dec])
```

Explanation The RP failed to unquiesce the SPA in the specified subslot. The SPA will be reset.

Recommended Action No action is required.

```
%IOSXE_OIR-6-CARDRECONCILE : SPA type changed on subslot [int]/[int] from [int] to [int]
```

Explanation The SPA in the specified subslot has been initialized, and it has been detected that it is of a different type to the SPA that was previously in this subslot.

Recommended Action No action is required.

```
%IOSXE OIR-6-INSCARD : Card ([chars]) inserted in slot [chars]
```

Explanation The OIR facility detected the insertion of a card in the slot number specified in the message.

Recommended Action No action is required.

```
%IOSXE OIR-6-INSSPA : SPA inserted in subslot [int]/[int]
```

Explanation The OIR facility detected the insertion of a SPA in the subslot number specified in the message.

Recommended Action No action is required.

```
%IOSXE OIR-6-INSSSFP : VCoP inserted in port [chars]
```

Explanation The OIR facility detected the insertion of VCoP SSFP in the port number specified in the message.

Recommended Action No action is required.

```
%IOSXE_OIR-6-OFFLINECARD : Card ([chars]) offline in slot [chars]
```

Explanation The OIR facility detected the state change to offline for the card in the slot number specified in the message.

Recommended Action No action is required.

```
%IOSXE OIR-6-ONLINECARD : Card ([chars]) online in slot [chars]
```

Explanation The OIR facility detected the state change to online for the card in the slot number specified in the message.

Recommended Action No action is required.

```
%IOSXE_OIR-6-REMCARD : Card ([chars]) removed from slot [chars]
```

Explanation The OIR facility detected the removal of a card from the slot number specified in the message.

Recommended Action No action is required.

```
%IOSXE OIR-6-REMSPA : SPA removed from subslot [int]/[int], interfaces disabled
```

Explanation The OIR facility detected the removal of a SPA from the subslot number specified in the message. The interfaces on that processor will be administratively shut down and marked as removed. The routing table will be flushed of any routes through the removed interfaces.

Recommended Action No action is required.

```
%IOSXE OIR-6-REMSSFP : VCoP removed from port [chars]
```

Explanation The OIR facility detected the removal of VCoP SSFP in the port number specified in the message.

Recommended Action No action is required.

```
%IOSXE OIR-6-SOFT RELOADSPA : SPA([chars]) reloaded on [chars]
```

Explanation The SPA in the specified subslot is reloaded by the command <CmdBold>hw-module subslot<NoCmdBold> <CmdArg>slot#/subslot#<NoCmdArg> <CmdBold>reload<NoCmdBold>

Recommended Action No action is required.

```
%IOSXE OIR-6-SOFT STARTSPA : SPA([chars]) restarted in [chars]
```

Explanation The SPA in the specified subslot is restarted by the command <CmdBold>hw-module subslot<NoCmdBold> <CmdArg>slot#/subslot#<NoCmdArg> <CmdBold> start<NoCmdBold>

Recommended Action No action is required.

```
%IOSXE OIR-6-SOFT STOPSPA : SPA([chars]) stopped in [chars], interfaces disabled
```

Explanation The SPA in the specified subslot is stopped by the command <CmdBold>hw-module subslot<NoCmdBold> <CmdArg>slot#/subslot#<NoCmdArg> <CmdBold>stop<NoCmdBold> The interfaces on that processor will be administratively shut down and marked as removed. The routing table will be flushed of any routes through the removed interfaces.

Recommended Action No action is required.

```
%IOSXE OIR-6-SPARELOAD : SPA reloaded on subslot [int]/[int]
```

Explanation The SPA in the specified subslot is reloaded.

Recommended Action No action is required.

```
%IOSXE OIR-6-SYNCSPA : SPA ([chars]) reloading to come up in [chars] mode
```

Explanation The SPA in the specified subslot is reloaded by the command <CmdBold>hw-module subslot<NoCmdBold> <CmdArg>slot#/subslot#<NoCmdArg> <CmdBold>reload<NoCmdBold>

Recommended Action No action is required.

IOSXE_PEM

```
IOSXE\_PEM-3-FANFAIL: The fan in slot [chars]/[dec] is encountering a failure condition
```

Explanation The fan's hardware is reporting that the fan is failing. This is most likely because the hardware detects the fan as spinning below the minimum speed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_PEM-3-FAN_FAIL_SHUTDOWN : More that none [chars] has failed, Leads to shutdown the system
```

Explanation The Temperature sensor reaching maximum threshold value working properly.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search

Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

 $IOSXE_PEM-3-PEMCHASFSERR$: The PEM in slot [chars] has encountered a system software error.

Explanation The PEM's underlying software for storing PEM state is not working properly.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_PEM-3-PEMFAIL : The PEM in slot [chars] is switched off or encountering a failure condition.

Explanation The PEM hardware has been either switched off, or is reporting a failure condition.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_PEM-3-PEMREDNOPWR: Cannot enable power redundancy mode [chars] because config would create mode with insufficient [chars] power

Explanation Configuration set by user is not valid as power supplies in the active slots do not contain enough power to meet the power requirements

Recommended Action Insert additional power supplies and configure them to be active or configure current standby power supplies to active such that power requirements are met

%IOSXE PEM-3-PEMREDNOSTDBY: Total power budget of standby power supplies is zero

Explanation Operating in unprotected mode Should insert at least one ps in standby slots

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_PEM-3-SSFP_TEMPERATURE_RAISE : [chars] transceiver temeprature reached threshold value, Leads to shutdown the system

Explanation The Temperature sensor reaching maximum threshold value working properly.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_PEM-3-TEMPERATURE_RAISE : Sensor [chars] has reached maximum temeprature value, Leads to shutdown the system
```

Explanation The Temperature sensor reaching maximum threshold value working properly.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE PEM-6-FANOK: The fan in slot [chars]/[dec] is functioning properly
```

Explanation The fan was reporting a failure condition. This message indicates that the fan is no longer reporting a failure

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE PEM-6-INSPEM FM : PEM/FM slot [chars] inserted
```

Explanation The platform detected the insertion of a power/fan module in the slot number specified in the message.

Recommended Action No action is required.

```
%IOSXE PEM-6-PEMOK : The PEM in slot [chars] is functioning properly
```

Explanation The PEM hardware may have been either switched off, or reporting a failure condition. This message indicates that the PEM is no longer either switched off, or reporting a failure

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

 ${\rm SIOSXE_PEM-6-PEMREDAUTOLCCONFLICT}$: Cannot enable power redundancy and autoLC shutdown simultaneously

Explanation Power supply redundancy mode n+1 or n+n is not compatible with autoLC shutdown feature.

Recommended Action Disable autoLC shutdown or set power redundancy mode to combined

```
%IOSXE PEM-6-REMPEM FM : PEM/FM slot [chars] removed
```

Explanation The platform detected the removal of a power/fan module in the slot number specified in the message.

Recommended Action No action is required.

IOSXE_PLATFORM

```
%IOSXE PLATFORM-3-WDC INVALID LENGTH: WDC length can not be determined: [dec]
```

Explanation WDC length was not retrieved properly

Recommended Action Check if WDC is programmed on this device

```
%IOSXE PLATFORM-3-WDC NOT FOUND : WDC returned length: [dec]
```

Explanation WDC length was set to 0, which specifies probably WDC does not exist

Recommended Action Check if WDC is programmed on this device

```
%IOSXE_PLATFORM-3-WDC_TLV_NOT_FOUND : WDC TLV could not be read from the Quack device
```

Explanation WDC TLV couldn't be read from the Quack device

Recommended Action Check if WDC is programmed on this device

IOSXE_PROCMIB

```
%IOSXE_PROCMIB-4-MSGERR : [chars] Error with process mib message from sub-slot [dec]/[dec]
```

Explanation When processing a process MIB message from the specified subslot, the specified error has occurred.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
IOSXE\_PROCMIB-4-SENDMSGERR: Failure in sending process mib information from subslot [dec]/[dec] to RP [chars]
```

Explanation A failure is encountered when sending process MIB statistics from the IOS driver for the subslot specified in the message to RP IOS. This indicates a software failure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_RP_ALARM

```
%IOSXE RP ALARM-2-ESP: [chars] [chars] [chars] [chars]
```

Explanation No ESP running alarm information

Recommended Action No action is required.

```
%IOSXE RP ALARM-2-PEM : [chars] [chars] [chars] [chars] [chars]
```

Explanation Power Entity Module missing information

Recommended Action No action is required.

```
%IOSXE_RP_ALARM-6-INFO : [chars] [chars] [chars] [chars]
```

Explanation Alarm assertion or deassertion information.

Recommended Action No action is required.

IOSXE_RP_CFG_NOT

```
\mbox{SIOSXE\_RP\_CFG\_NOT-2-MSGIPCINITERROR} : Error initializing IPC queue
```

Explanation An unexpected condition in which IOS could not initialize a message queue to the PSD.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_CFG_NOT-2-MSGNOEXP : Can not construct a '[chars]' message for configuration export: [chars]
```

Explanation This error usually indicates either an out of memory condition or a TDL error. If ample memory is available, then the TDL error may indicate a version conflict with respect to configuration.

representative with the gathered information.

```
%IOSXE RP CFG NOT-2-MSGTDLERROR : Error processing TDL message. [dec]
```

Explanation An unexpected condition in which IOS has received a TDL message which it can not process.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_CFG_NOT-2-MSGTDLINITERROR : Configuration Notification messaging module initialization failed: Unable to initialize messaging: [chars]
```

Explanation The Configuration Notification subsystem has failed to initialize the infrastructure for messaging with the Pluggable Services Daemon. Notification of configuration to critical modules cannot proceed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP CFG NOT-3-MCP DBPERSIST STAT : Failed to read [chars] property: [dec]
```

Explanation When a 'reload' operation occurs, this chasfs property is read to determine the status of the DB persist/restore/delete operation. This message indicates that the read failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP CFG NOT-3-MCP FRU INVALID : Unknow FRU location: [chars]
```

Explanation Unknown FRU location

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP CFG NOT-3-MCP FRU LOCATION : Failed to get local FRU location: [dec]
```

Explanation Unable to get local FRU location

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search

Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
IOSXE_RP_CFG_NOT-3-MSGENCRYPTINVALID: The mcprp_cfg_notify subsystem has seen an encryption type it does not recognize. [dec]
```

Explanation An unexpected condition has occurred while IOS is trying to process a username command.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_CFG_NOT-3-MSGIPCTXERROR : IPC transmit error. [dec]
```

Explanation An unexpected condition in which IOS encountered an error trying to send a message to another process. %d

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
IOSXE_RP_CFG_NOT-3-MSGNOCAND: Can not construct a candidate entry for configuration export
```

Explanation This error usually indicates either an out of memory condition or a TDL error. If ample memory is available, then the TDL error may indicate a version conflict with respect to configuration.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP CFG NOT-3-MSGNOPWARR: Can not construct an array for configuration export
```

Explanation This error usually indicates either an out of memory condition or a TDL error. If ample memory is available, then the TDL error may indicate a version conflict with respect to configuration.

%IOSXE_RP_CFG_NOT-3-MSGNOREPLMSG : Can not construct a replace message for configuration export

Explanation This error usually indicates either an out of memory condition or a TDL error. If ample memory is available, then the TDL error may indicate a version conflict with respect to configuration.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_RP_CFG_NOT-3-MSGNOUPDATEMSG: Can not construct an update message for configuration export

Explanation This error usually indicates either an out of memory condition or a TDL error. If ample memory is available, then the TDL error may indicate a version conflict with respect to configuration.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_RP_CFG_NOT-3-MSGOBJNULL: An unexpected condition in which IOS has received a null pointer that it expects to be non-null.

Explanation An unexpected condition has occurred while IOS is trying to process a username command.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP CFG NOT-3-NVWRITE EXPORT : Failed to export [chars] notification: [dec]
```

Explanation When a 'write memory' or 'write erase' operation occurs, the Configuration Notification subsystem exports this event into the chassis file system. This message indicates that the export failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP CFG NOT-6-IOX SERVICE NOTSUPPORTED : IOx service not supported.
```

Explanation IOx service is not supported in this platform currently. This may be either due to the feature unavailability or due the current inadequate license level of the system.

Recommended Action None

IOSXE_RP_DPIDB

```
%IOSXE RP DPIDB-3-BULK SYNC : Failed to send [chars] information to peer
```

Explanation The bulk synchronization of the DPIDX configuration to the standby RP has failed to complete successfully; DPIDX has therefore taken the action which will result in a reload of the peer in order to once more attempt to successfully synchronize the configuration state which may have failed initially to a transient condition.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-CF: Datapath IDB CF operation failed -[chars]
```

Explanation Failure in some datapath ID CF activity.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-DECODE : Decode via [chars] of [chars] failed
```

Explanation A message of the transport and type described failed in its attempt to be decoded on the standby. The resultant action taken by the standby route processor is an attempt to resynchronize.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-DOWNLOADFAIL : Unable to download [chars] message to [chars]
```

Explanation An unexpected condition has occurred which resulted in a configuration not being sent to the reported process.

```
%IOSXE RP DPIDB-3-DYN SYNC : Failed to process [chars] dynamic state
```

Explanation The incremental synchronization of the DPIDX configuration to the standby RP has failed to complete successfully. This implies that the configuration state between the active and standby RP is inconsistent.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interfaces command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-EFPSTATSFAILED : EFP stats message data get error: ([dec]) for EFP [int] on [chars]
```

Explanation An unexpected error occurred extracting fields from an EFP stats message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-EXDMAXVRFERR : Exceed Pathmgr max rloc vrf error
```

Explanation An unexpected condition has occurred when exceeding max rloc vrf

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-FASTNOTIFY : Fast notify failed for [chars]
```

Explanation A fast notify message failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-FRRLDFLOWIDDELETIONFAILED : Deletion of fast-reroute flow ID with manager failed
```

Explanation An unexpected condition has occurred that deletion of fast-reroute flow ID.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface

command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-IDBBADTYPE : Datapath IDB type [dec] is not valid
```

Explanation An unexpected condition has occurred as the type of a datapath IDB is not valid.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-IDBEXIST : Datapath IDB already exists in this mapping entry: [chars]-[dec]
```

Explanation An unexpected condition has occurred that an attempt is made to save datapath IDB in a mapping entry filled by another.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-IDBNONEXIST : Datapath IDB does not exist in this mapping entry: [chars]-[dec]
```

Explanation Datapath IDB lookup points to empty mapping entry.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-IDBNOTVAI : Invalid API call for [chars]
```

Explanation Failure in an internal API

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%IOSXE RP DPIDB-3-IDXALLOCFAILED : Datapath IDB index allocation failed: [chars]
```

Explanation An unexpected condition has occurred as all the available of datapath IDB indices are used.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-IDXBADRANGE : Datapath IDB index [dec] is not in a valid range
```

Explanation An unexpected condition has occurred as the index of a datapath IDB is not valid.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-IDXDELETIONFAILED : Deletion of datapath IDB index from the database failed ([chars] -[hex]) rc [dec]
```

Explanation An unexpected condition has occurred that deletion of datapath IDB indices failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-IDXINSERTFAILED : Insertion of datapath IDB index [dec] into database failed
```

Explanation An unexpected condition has occurred that insertion of datapath IDB indices failed.

```
%IOSXE_RP_DPIDB-3-IDXLOOKUPFAILED : Lookup of datapath IDB index from the database failed ([chars])
```

Explanation An unexpected condition has occurred that lookup of datapath IDB indices failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-IP_MTU_ALLOC_FAIL : No hardware resources for [int] byte IP MTU on [chars]
```

Explanation We reached to the threshold of maximum supported unique IP MTU on this platform.

Recommended Action No action is required.

```
%IOSXE RP DPIDB-3-ISSU : [chars] [chars] failed; [chars]
```

Explanation An operation pertaining to the ISSU support for DPIDX failed to complete using either the CF or IPC transport context with the reason specified

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-LIST : List [chars] failed for [chars]
```

Explanation List enqueue or removal failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-MTU_ALLOC_FAIL : No hardware resources for [int] byte MTU on [chars]
```

Explanation We reached to the threshold of maximum supported unique MTU on this platform.

Recommended Action No action is required.

```
%IOSXE_RP_DPIDB-3-NEGOTIATION : Failed to start ISSU [chars] session negotiation; [chars]
```

Explanation The ISSU negotiation with the peer failed to start for either the CF or IPC transport with the reason specified.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-NOHWSUBBLOCK : HWIDB [chars] does not have a hardware subblock
```

Explanation An unexpected condition has occurred that no hardware subblock was previously allocated for a HWIDB.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-NOSWSUBBLOCK : SWIDB [chars] does not have a software subblock
```

Explanation An unexpected condition has occurred that no software subblock was previously allocated for a SWIDB.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-NULLTIMER : NULL timer
```

Explanation A timer is NULL

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-PROGRESSION: Unable to inform RF of bulk sync completion; [chars]
```

Explanation The active route processor has sent a notification to the standby to inform of the completion of the bulk synchronization of the DPIDX configuration. The standby has failed to respond to the active informing that it received the notification noting the reason for the failure. The resultant action taken by the standby route processor is an attempt to resynchronize.

representative with the gathered information.

```
%IOSXE RP DPIDB-3-RECEIVE : Message via [chars] is [chars]
```

Explanation An attempt to receive and process a versioned negotiation or synchronization message has failed due to an internal error being detected by the information received from the IPC or CF components.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-REGISTRATION : ISSU [chars] failed for [chars]; [chars]
```

Explanation An ISSU registration for the set of initial capabilities and sessions failed due to the reason specified. This will have the effect of the DPIDX ISSU support being unavailable between peers.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-RF : Datapath IDB RF operation failed -[chars]
```

Explanation Failure in some datapath ID RF activity.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-RPC : Datapath IDB RPC operation failed -[chars]
```

Explanation Failure in some datapath ID RPC activity.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show interface command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-3-TRANSFORM : [chars] of [chars] via [chars] failed for dpidx [int]
```

Explanation An attempt to either encode or decode a versioned synchronization message has failed due to an internal error encountered by the ISSU component.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-3-TRANSMIT : Unable to send via [chars] [chars] [chars]; [chars]
```

Explanation An attempt to send a versioned negotiation or synchronization message has failed due to an internal error encountered by the IPC or CF components.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_DPIDB-6-READY : [chars] peer not ready, discarding [chars]
```

Explanation The synchronization attempt for the message has determined that the transport has lost communication with its peer. This is a normal situation which indicates that the standby route-processor is currently out of service implying a simplex redundancy mode.

Recommended Action None

```
%IOSXE RP DPIDB-6-RELOAD : [chars], reloading [chars]
```

Explanation A synchronization attempt between the active and standby RP peers has failed with the reason indicated. The standby peer is reloaded in an attempt to resynchronize when operating in a stateful redundant mode.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP DPIDB-6-TIMEOUT : Bulk sync is flow controlled by [chars]
```

Explanation The bulk synchronization of the DPIDX configuration to the standby RP has encountered a flow control condition which has effected a timeout awaiting the condition to clear. This will result in a reload of the standby RP to allow the bulk synchronization to restart.

IOSXE_RP_IF_FLOW_IDS

%IOSXE_RP_IF_FLOW_IDS-3-BUFF_OFFSET_NULL: Unable to utilize the memory buffer provided by the Checkpoint Facility. This [chars] CF client has failed to Bulk Sync.

Explanation This error indicates the Checkpoint Facility is having problems recognizing its own buffer layout. If this occurs during Bulk Sync then Bulk Sync will terminate without completing. Otherwise the incremental Sync will fail.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_RP_IF_FLOW_IDS-3-CF_CANNOT_REGISTER : The call to add this [chars] CF client to the Checkpoint Facility failed with the error [chars]. This client is unable to proceed and will not be registered.

Explanation For some reason the Checkpoint Facility will not register this client. As a result the Standby will never receive synchronized state from this CF client on the Active RP, The system is not capable of SSO and HA switchover.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_RP_IF_FLOW_IDS-3-CF_SEND_BULK_NONBLOCKED: The Checkpoint Facility reported the error [chars] while attempting to send a message. Bulk Sync of this [chars] CF client is terminating.

Explanation This error indicates the Checkpoint Facility has internal problems related to IPC, and cannot perform a non-blocked send operation.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_RP_IF_FLOW_IDS-3-CF_SEND_INCR_NONBLOCKED: The Checkpoint Facility reported the error [chars] while attempting to send a non-blocked message. The Incremental Sync transaction for this [chars] CF client cannot be sent to the Standby RP.

Explanation This error indicates the Checkpoint Facility has internal problems related to IPC.

representative with the gathered information.

```
%IOSXE RP IF FLOW IDS-3-DECODE : Decode via CF of [chars] failed
```

Explanation A message sent via the CF transport failed in its attempt to be decoded on the standby. The resultant action taken by the standby route processor is an attempt to resynchronize.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-3-DEFERRED_DURING_BULK_SYNC : Encountered error [chars] while trying to place an [chars] transaction on the Deferred list during Bulk Sync for the [chars] CF client.
```

Explanation Unable to cache a deferred transaction while Bulk Sync is underway. This can adversely impact SSO state on the Standby RP.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP IF FLOW IDS-3-ISSU OP : [chars] [chars] failed; [chars]
```

Explanation An operation pertaining to the ISSU support for SPA MARMOT IDs failed to complete using the CF transport context with the reason specified

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-3-NEGOTIATION : Failed to start ISSU [chars] session negotiation; [chars]
```

Explanation The ISSU negotiation with the peer failed to start for either the CF or IPC transport with the reason specified.

%IOSXE_RP_IF_FLOW_IDS-3-NO_BUFF_FOR_SYNC : The Checkpoint Facility reported the error [chars] during a request for a buffer length of [dec]. This [chars] CF client has failed to synchronize a transaction to the Standby RP.

Explanation This error indicates that the buffer management within the Checkpoint Facility has either run out of buffers, or has some other problem. If this occurs during Bulk Sync then Bulk Sync will terminate without completing. Otherwise the incremental Sync will fail.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP IF FLOW IDS-3-RECEIVE : Client reports message CF is [chars]
```

Explanation An attempt to receive and process a versioned negotiation or synchronization message has failed due to an internal error being detected by the information received from the CF component.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP IF FLOW IDS-3-REGISTRATION: ISSU [chars] failed for [chars]; [chars]
```

Explanation An ISSU registration for the set of initial capabilities and sessions failed due to the reason specified. This will have the effect of the SPA MARMOT ID ISSU support being unavailable between peers.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-3-RF_ADD_CLIENT_FAILED : The RF facility failed to add this [chars] client, reason given is [chars].
```

Explanation This indicates the RF facility could not add the client.

```
%IOSXE_RP_IF_FLOW_IDS-3-RF_IF_ID_REGEN_ERROR : Error code [dec] encountered trying to regenerate interface flow-control identifer. If id [int] resides in slot/sub-slot/port ([int]/[int]).
```

Explanation The background process which performs Flow Control Id Pool regeneration encountered an error. As a consequence the Standby does not have valid Id pools and cannot progress to Active state.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-3-RF_PEER_EVENT_BUFFER: This [chars] RF client is unable to acquire an event buffer to send an RF peer message, the error [chars] was returned.
```

Explanation This indicates the RF facility is unable to provide a message buffer needed to communicate with the RF peer. As a consequence the RF progression may be compromised.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-3-RF_POOL_REGEN_ERROR : Id Pool Regeneration encountered error code [dec], cannot switchover.
```

Explanation The background process which performs Flow Control Id Pool regeneration encountered an error. As a consequence the Standby does not have valid Flow Id pools and cannot progress to Active state.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-3-RF_POOL_REGEN_PROCESS_FAILED : The [chars] RF client Failed to create the Id Pool Regeneration process.
```

Explanation The background process which performs Flow Control Id Pool regeneration failed to start. As a consequence the Standby will never obtain the relevent SSO state to enable HA switchover.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-3-RF_PROCESS_FAILED : This [chars] RF client Failed to create the Bulk Sync Process.
```

Explanation The background process which performs the RF Bulk Sync failed to be created. As a consequence the Standby will never obtain the relevent SSO state to enable HA switchover.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-3-RF_SEND_PEER : This [chars] RF client encountered error [chars], when attempting to send a peer message.
```

Explanation This indicates the RF facility could not send a message to the RF peer. As a consequence the RF progression may be compromised.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-3-RF_SPA_ID_REGEN_ERROR : Error code [dec] encountered trying to regenerate spa [chars] identifier in slot/subslot ([int]/[int])
```

Explanation The background process which performs Flow Control Id Pool regeneration encountered an error. As a consequence the Standby does not have valid Id pools and cannot progress to Active state.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-3-SEND_FAIL_RELOAD : Checkpoint Facility Failed to send a [chars] transaction for this [chars] CF client. Reloading the Standby RP.
```

Explanation This indicates the underlying Checkpoint Facility could not deliver a message sent from the active RP to the standby RP. The process will automatically reload the standby RP.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP IF FLOW IDS-3-TRANSFORM : [chars] of [chars] via CF failed
```

Explanation An attempt to either encode or decode a versioned synchronization message has failed due to an internal error encountered by the ISSU component.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance

Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-3-TRANSMIT : Unable to send via [chars] [chars] [chars] [chars]; [chars]
```

Explanation An attempt to send a versioned negotiation or synchronization message has failed due to an internal error encountered by the CF component.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-4-DEF_LIST_REMOVE : Failed to remove one entry from the Deferred Sync list, for the [chars] CF client.
```

Explanation An unexpected condition occured during list maintenance.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_IF_FLOW_IDS-6-CFPEER_CANNOT_RECV : The Checkpoint Peer is not ready to receive messages. The Incremental Sync transaction for this [chars] CF client will not occur.
```

Explanation This error indicates the Checkpoint Facility has signalled the peer has gone away.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP IF FLOW IDS-6-READY: [chars] peer not ready, discarding [chars]
```

Explanation The synchronization attempt for the message has determined that the transport has lost communication with its peer. This is a normal situation which indicates that the standby route-processor is currently out of service implying a simplex redundancy mode.

Recommended Action None

IOSXE_RP_MGMTE

```
%IOSXE RP MGMTE-3-MSGCREATENULL : Cannot allocate [chars] TDL message
```

Explanation An unexpected condition in which IOS cannot allocate TDL message for Management ethernet.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_RP_MGMTE-3-MSGTDLINITERROR : Management ethernet interface messaging module initialization failed: Unable to initialize messaging: [chars]

Explanation The Management ethernet interface subsystem has failed to initialize the infrastructure for messaging with the Pluggable Services Daemon. Configuration of management ethernet modules cannot proceed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_RP_MGMTE-3-PROCESS_CREATE_FAIL : Management ethernet statistics process creation failed

Explanation Can not create IOS process for RP management ethernet port statistics collection

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_RP_NV

```
%IOSXE RP NV-3-BACKUP NV ACCESS FAIL : Initial read of backup NVRAM contents failed
```

Explanation This error happens when the contents of the backup NVRAM cannot be read during system initialization. The failure may be due to data corruption of the backup NVRAM contents. The primary nvram contents will be backed up here again.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE RP NV-3-NV ACCESS FAIL : Initial read of NVRAM contents failed

Explanation This error happens when the contents of the NVRAM cannot be read during system initialization. The failure may be due to data corruption of the NVRAM contents. The initial configuration dialog will be entered and the configuration must be restored.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_RP_SPA

```
%IOSXE RP SPA-3-BAD IFCOMTYPE : Bad ifcom message type=[int]
```

Explanation A SPA module passed down a message that the RP software was not prepared to handle.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-CI_UPDATE_FAIL : Failed to update connection identifier for interface [chars]
```

Explanation The SPA driver is not able to update the datapath connection identifier for the interface specified in the message. This indicates a software error.

Recommended Action No action is required.

```
%IOSXE_RP_SPA-3-DPIDX_LKUP_FAIL : Failed to retrieve datapath identifier for interface [chars]
```

Explanation The SPA driver is not able to retrieve the datapath identifier for the interface specified in the message. This indicates a software error.

Recommended Action No action is required.

```
%IOSXE_RP_SPA-3-ERROR : common_str_empty_str
```

Explanation This message can take many forms. It provides information about a software error.

```
IOSXE_RP_SPA-3-FLOWID_ALLOC_FAIL : Failed to allocate a flow control identifier for interface [chars]
```

Explanation The SPA driver is not able to allocate the datapath flow control identifier for the interface specified in the message. This indicates a software error.

Recommended Action No action is required.

```
%IOSXE_RP_SPA-3-FLOWID_RELEASE_FAIL : Failed to release a flow control identifier for interface [chars] (status = [dec])
```

Explanation The SPA driver is not able to release the datapath flow control identifier for the interface specified in the message. This indicates a software error.

Recommended Action No action is required.

```
IOSXE_RP_SPA-3-FOREVER : cmd [int] to [chars] (slot [int]/[int]) took [int]secs, done [hex]
```

Explanation A CCB command from the RP to a SPA module took longer than expected.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-FRR_CFG_REC_FAIL : Failed to record fast reroute conifguration on [chars]: [chars]
```

Explanation This message is displayed when a fast reroute configuration is not properly recorded.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-HWIDB_FAILURE : Creation: slot [dec] subSlot [dec] port [dec] vc [dec]
```

Explanation Failed to create an interface hwidb.

```
%IOSXE_RP_SPA-3-HWIDB_INIT_FAIL : Failed to initialize data structure for SPA port [dec]/[dec]
```

Explanation A SPA driver was not able to properly initialize a data structure mentioned in the message. This indicates a software error.

Recommended Action No action is required.

```
%IOSXE_RP_SPA-3-IFCFG_CMD_NOT_OWNER: Process '[chars]' waiting for interface configuration command ([hex]) to slot [int]/[int] without acquiring lock owned by process '[chars]'
```

Explanation A process on the RP sent an configuration command to the slot specified in the error message and a different process waited for the result. This could cause incorrect line card configuration states.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-IFCFG_FOREVER : to [chars] (slot [int]/[int]) took [int]secs, ret val [int]
```

Explanation A interface config command from the RP to a SPA module took longer than expected.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-IFCFG_NO_UNIQUE_KEY: No unique-key generator registered for interface configuration command [int].
```

Explanation The High Availability component for SPA modules is unable to properly synchronize state information for the current configuration.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-INVALID_PORT_NUM : slot=[dec] port=[dec], hwidbType=[hex], max port num=[dec], LCtype=[hex]
```

Explanation The port number is out of range.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%IOSXE_RP_SPA-3-IPCALLOCFAIL : Failed to allocate IPC buffer [chars]
```

Explanation The RP failed to allocate a buffer for communication with a SPA

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-IPCPORT : Failed to [chars] IPC port '[chars]', error [chars]
```

Explanation The Linecard failed to create a port for communication with the Route Processor (IOSXE-RP).

Recommended Action Copy the error message exactly as it appears, and report it to your technical support representative.

```
%IOSXE_RP_SPA-3-IPCPORTFAIL : Failed to open IPC port '[chars]' with error [chars]
```

Explanation The RP failed to open a port for communication with a SPA module.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP SPA-3-IPCSENDFAIL : Failed to send IPC message [chars]
```

Explanation The RP failed to send a message to a SPA module.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-LIC_REG_FAILED : [int]/[int]/[int]: Failed to register license feature [chars], err=[hex]
```

Explanation License registration has been denied by license manager

```
%IOSXE_RP_SPA-3-LIC_REL_FAILED : [int]/[int]/[int]: Failed to release license feature [chars], handle=[hex], err=[hex]
```

Explanation License release has been denied by license manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-LIC_REQ_FAILED : [int]/[int]/[int]: Interface enable not allowed - license request failed , err=[hex]
```

Explanation A 10 Gig License is required to enable this port. License request has been denied by license manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-MAC_FILTER_ADD_FAIL : All the available [dec] mac filters for [chars] have been consumed. Failed to add [enet] for interface [chars]
```

Explanation The hardware cannot support any more filters.

Recommended Action The interface configuration should be reworked to not cross the limit set by the hardware. If the error is still seen please Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
IOSXE_RP_SPA-3-MAX_SPA: Power to IPSEC-SPA-2G in [chars] is denied because it has exceeded the number allowed([dec])
```

Explanation The number of IPSEC-SPA-2G in a chassis is limited. This message is displayed when the number of IPSEC-SPA-2G in the chassis has exceeded this limit.

Recommended Action Use only the number of supported IPSEC-SPA-2G

```
%IOSXE_RP_SPA-3-MISSING_SPA_PKG_ERR : sipspa[chars] package is not installed for slot = [dec] and subslot = [dec], SPA bootup failed.
```

Explanation This message is displayed when attempting to bootup a SPA without installing a subpackage required for the same.

Recommended Action Download the sub-package required for the affected SPA from the Cisco CCO software download site and install the same. This SPA can be booted in sub-package mode only. Please refer to the Cisco ASR

platform documentation for obtaining and installing sub-packages.

```
%IOSXE_RP_SPA-3-MISSING_SPA_PKG_WARN : sipspa[chars] package is not installed in standby for slot = [dec] and subslot = [dec].
```

Explanation This message is displayed in standby console when attempting to bootup or restart or reload a WMA SPA without installing a subpackage in the standby RP, although the SPA is or will be operational due to prior wma spa package installation in active RP. If switchover takes place the WMA SPA will still be operational. But any subsequent soft or hard oir of the SPA will fail due to missing sub package required to boot up the SPA. Hence it is recommended to complete the wma spa package installation in standby also before switchover or immidiately after switchover.

Recommended Action Download the sub-package required for the affected SPA from the Cisco CCO software download site and install the same for the standby RP as is done on active RP. Please refer to the Cisco ASR platform documentation for obtaining and installing sub-packages.

```
%IOSXE_RP_SPA-3-NO_HOST_INFO : slot [dec] subSlot [dec], spaType [hex]
```

Explanation Failed to get information about the host linecard.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-NULL_DATA_STRUCTURE : common_str_empty_str
```

Explanation A SPA driver is not able to retrieve the data structure mentioned in the message. This indicates a software error.

Recommended Action No action is required.

```
%IOSXE RP SPA-3-PROGRESSION: Unable to inform RF of bulk sync completion; [chars]
```

Explanation The standby has failed to notify the active that its bulks synchronization of the SPA TSM has completed. The resultant action taken by the standby route processor is an attempt to resynchronize.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP SPA-3-SEND L2 HDR MSG FAIL : slot [dec] subslot [dec]
```

Explanation Failed to send ngio L2 header to iomd.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to

gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-SEND_NGIO_MSG_FAIL : NGIO Module message send failed for slot [dec] subslot [dec]
```

Explanation Failed to send ngio msg to iomd.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-SONET_ALARM_PROC_ERR : [chars] Error has occurred while processing in the sonet alarm-proc
```

Explanation Either free/create of the memory failed in SONET alarm proc

Recommended Action None

```
%IOSXE RP SPA-3-SPA NO HOST INFO : slot [dec] subSlot [dec], PID [chars]
```

Explanation Failed to get information about the host linecard.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-3-SPA_WRONGTYPE : Mismatched SPA type ([dec]) in slot [dec]/[dec]. Expected type [dec]. Use 'no card [dec]/[dec]' command to override preprovisioning and update card type.
```

Explanation The SPA inserted does not match the currently provisioned SPA type.

Recommended Action Replace wrong SPA with currently provisioned SPA type, or type 'no card' to allow new card type to be discovered.

```
%IOSXE_RP_SPA-3-UNSUPPORTED_SRVCS_SPA : Service SPA ([hex]) in [dec]/[dec] is not supported. SPA bootup failed.
```

Explanation This message is displayed when attempting to bootup any service SPA in router running non K9 image, i.e., non-crypto image.

Recommended Action Download the K9 IOS XE sub-packages and the required sub-package for the given service SPA from the Cisco CCO software download site and install the same. This SPA can be booted in sub-package mode only. Please refer to the Cisco ASR platform documentation for obtaining and installing sub-packages.

```
%IOSXE_RP_SPA-3-VC_FLOWID_ALLOC_FAIL : Failed to allocate a flow control identifier for VC [dec] under interface [chars]
```

Explanation The SPA driver is not able to allocate the datapath flow control identifier for the VC/interface specified in the message. This indicates a software error.

Recommended Action No action is required.

```
%IOSXE_RP_SPA-3-VC_INGID_ALLOC_FAIL : Failed to allocate a ingress identifier for VC [dec] interface [chars]
```

Explanation The SPA driver is not able to allocate the datapath ingress identifier for the VC/interface specified in the message. This indicates a software error.

Recommended Action No action is required.

```
%IOSXE RP SPA-3-VC PROV FAIL : Failed to provision interface [chars]
```

Explanation The SPA driver is not able to provision the interface specified in the message. Verify that the SPA hardware is not provisioned above the supported limit. Otherwise, this indicates a hardware error.

Recommended Action No action is required.

```
%IOSXE RP SPA-4-CCB PLAYBACK ERROR : CCB playback failed for slot [dec].
```

Explanation The High Availability component for SPA modules failed to synchronize some new state information for the specified slot.

Recommended Action Reload the standby supervisor module to force a fresh bulk synchronization. If this error recurs, Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP SPA-4-CCB RECORD ERROR : CCB record failed for slot [dec].
```

Explanation The High Availability component for SPA modules failed to record some new state information for the specified slot.

```
%IOSXE_RP_SPA-4-IFCFG_CMD_TIMEOUT : Interface configuration command ([hex]) to slot [int]/[int] timed out
```

Explanation The RP sent an configuration command to the slot specified in the error message and received no confirmation for the command.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-4-IFCFG_DFLT_LIST_ERROR : For Interface Configuration command [int], default retval list search resulted [hex] for slot [int]/[int]
```

Explanation The High Availability component for SPA modules failed to synchronize some new state information for the specified slot.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show platform redundancy if-config default-retvals command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-4-IFCFG_PLAYBACK_ERROR : Interface Configuration command [int] play-back failed for slot [int]/[int].
```

Explanation The High Availability component for SPA modules failed to synchronize some new state information for the specified slot.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-4-IFCFG_RECORD_ERROR : Interface Configuration command [int] record failed for slot [int]/[int].
```

Explanation The High Availability component for SPA modules failed to record some new state information for the specified slot.

```
IOSXE_RP_SPA-4-INCR_CFG_SYNC_FAIL: [chars] incremental running-config sync for [[dec]/[dec]] failed -[chars]([dec]), Reload Standby
```

Explanation The specified IOSXE incremental running-config sync failed

Recommended Action Power cycle the redundant supervisor

```
%IOSXE RP SPA-4-IPCFAILED : IPC failed to send RPC message to SPA module
```

Explanation The RP failed to send an RPC message via IPC to a SPA module.

Recommended Action No action is required.

```
%IOSXE_RP_SPA-4-LCLOG_PARSE_ERR : Error parsing logger message: [chars] from subslot [int]/[int]
```

Explanation The SPA module passed down a logger message that could not be parsed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-4-LCLOG_TOOLONG : Message too long from slot [int]/[int]: [int] bytes
```

Explanation The SPA module passed down a logger message that is too long for the RP to handle.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-4-SEMAHOG : Process [dec] ([chars]) hogging [chars]! calling proc [dec] ([chars])
```

Explanation The RP waited too long for a reply to a command sent to a SPA module.

Recommended Action No action is required.

```
%IOSXE_RP_SPA-4-SPA_CMD_NO_RESP : [chars]: No response for interface configuration command [int]
```

Explanation A timeout occurred while RP was waiting for a response from line card. This may happen due to line card CPU being too busy to respond to the command.

Recommended Action No action is required.

```
%IOSXE_RP_SPA-4-SPA_RESP_CMD_ERR : [chars]: Received response to interface configuration command [chars] with wrong return value [int].
```

Explanation An internal error occurred while configuring the interface. The configuration may not have succeeded.

Recommended Action Check that the running configuration for the interface is correct. If this message is repeatable, please Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the show tech-support command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_SPA-4-SPA_RESP_CMD_MISMATCH : [chars]: Expecting response to interface configuration command [int] but received response to command [int].
```

Explanation An internal synchronization error occurred while configuring the interface. The configuration may not have succeeded.

Recommended Action Check that the running configuration for the interface is correct. If this message occurred on the standby, try reloading the standby to ensure that its configuration is in sync. If this message is repeatable, please Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance

https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP SPA-6-CARDRELOAD : Module [int] reload due to SPA insert in [int]/[int].
```

Explanation When inserting a SPA on this carrier card, the card is reset.

Recommended Action No action is required.

```
%IOSXE_RP_SPA-6-CTRLRSWITCH : switching controller type from [chars]([dec]) to [chars]([dec]) for subslot [int]/[int].
```

Explanation When IOSXE-SIP40 is inserted in the slot previously occupied by IOSXE-SIP10 or vice-versa the controller type of the card is overwritten to reflect the current SIP.

Recommended Action No action is required.

```
%IOSXE RP SPA-6-MEDIA AUTOFAILOVER : Media Fail over from ([chars]) to ([chars])
```

Explanation Gige Media Failover.

Recommended Action This is inforamtional message, Not an error message. Use 'show interface gig' to see the current active media type.

IOSXE_RP_VTYMGT

```
IOSXE_RP_VTYMGT-3-MSGBIPCBUFFER: Unable to acquire a BIPC buffer of length [dec] for sending messages.
```

Explanation A message was to be sent by IOS, but no BIPC buffer was available. The message to be sent has been discarded and the associated operation failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_VTYMGT-3-MSGBIPCERR : Unable to process received BIPC messages for Vty Management, error: [chars]
```

Explanation An unexpected condition has occurred while IOS was trying to process a received BIPC message for Vty Management.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_VTYMGT-3-MSGBUILDERROR : Error '[dec]' building TDL Vty Management message '[chars]': [chars]
```

Explanation An unexpected condition has occurred while IOS is building a TDL response message for Vty Management

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
IOSXE_RP_VTYMGT-3-MSGDISPATCH: Unable to dispatch received TDL messages for Vty Management
```

Explanation An unexpected condition has occurred while IOS is trying to dispatch to the TDL message handler functions for received TDL messages for Vty Management.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP VTYMGT-3-MSGDISPATCHNULL : Received NULL TDL message
```

Explanation An unexpected condition in which IOS has received a NULL TDL message for Vty Management.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search

Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_VTYMGT-3-MSGENQUEUEERROR : Error queueing TDL Vty Management message '[chars]'
```

Explanation An unexpected condition has occurred when IOS attempted to queue a TDL response message for Vty Management

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_VTYMGT-3-MSGERROR : Error '[dec]' handling a received TDL message '[chars]' for Vty Management: [chars]
```

Explanation An unexpected condition has occurred while IOS is processing a received Vty Management TDL message

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_VTYMGT-3-MSGEXTAPPUPDATE : Unable to update external application data for line '[dec]'
```

Explanation An attempt to update the external application for a line failed unexpectedly. The line update failed and if the line number specified is valid, the line was released.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_VTYMGT-3-MSGINVALIDFIELDINT : Invalid field '[chars]' in TDL message '[chars]' received: value '[int]' for Vty Management
```

Explanation A message with an invalid field value was received for Vty Management

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_VTYMGT-3-MSGINVALIDFIELDSTR : Invalid field '[chars]' value '[chars]' in TDL message '[chars]' received for Vty Management
```

Explanation A message with an invalid field value was received for Vty Management

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
IOSXE_RP_VTYMGT-3-MSGMARSHALERROR : Error '[dec]' marshaling TDL Vty Management message '[chars]': [chars]
```

Explanation An unexpected condition has occurred while IOS is marshaling TDL response message for Vty Management

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_VTYMGT-3-MSGMISSINGFIELD : Missing field '[chars]' in TDL Vty Management message '[chars]' received
```

Explanation A message missing a required field was received for Vty Management

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_RP_VTYMGT-3-MSGVTYCOUNT : Invalid vty count [dec] detected on initialization
```

Explanation Upon initialization, the Vty Management subsystem checks that the number of available vtys for the platform is valid.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
IOSXE_RP_VTYMGT-3-MSGVTYSVCINIT: Unable to initialize the Vty Management service listen port
```

Explanation The platform IPC services failed to register the Vty Management service's need for a listen port. The Vty Management service will be unable to process requests. IOS services will be unavailable to external access methods.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE RP VTYMGT-3-SET ACCESS FAIL : Installing LIIN interface access control failed
```

Explanation This error happens when the Vty Management subsystem failed to set the access control function for the LIIN, possibly due to IOS out of memory or corruption. Persistent access features into IOS will not work.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_SCHED

```
%IOSXE SCHED-3-AVL INSERT FAIL : Could not insert pid [dec] into process tree
```

Explanation An avl_insert() failed to add a process structure to the ASR1000 scheduler tree. This should never occur, as the tree is always searched first for the presence of the process.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SCHED-3-CALLED FROM INT : API call incorrectly made from interrupt level
```

Explanation An external routine provided by the ASR1000 scheduler was incorrectly called from the context of an interrupt handler. This is not a supported use of the external routine; the calling code must be fixed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SCHED-3-NEGATIVE_DEPTH : Queue '[chars]' consumed more than it produced ([dec])
```

Explanation Based upon internal state derived from calls to mcp_queue_produced() and mcp_queue_consumed(), more data was consumed from a balanced queue than was produced into it. This is logically impossible, so the presence of this error generally indicates incorrect use of the two above mentioned routines.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search

Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SCHED-3-NULLQ : Invalid API parameter
```

Explanation An external routine provided by the ASR1000 scheduler was incorrectly called with an invalid (NULL) pointer.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_SERVICE_ENGINE

```
%IOSXE_SERVICE_ENGINE-3-MSGINITFAIL : Initialization of interface [chars] failed
```

Explanation The initialization of the interface mentioned in the error message has failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SERVICE ENGINE-3-MSGOPENFAIL : Cannot open interface [chars] ([dec])
```

Explanation During the creation of a Service-Engine interface, it is necessary to program the system parameters in the driver. The driver cannot be opened.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SERVICE ENGINE-3-MSGSETFAIL : Set id on interface [chars] ([dec])
```

Explanation During the creation of a Service-Engine interface, it is necessary to program the system parameters in the driver. The failed to accept the programming.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_SMART_AGENT

```
%IOSXE SMART AGENT-3-NOTIFY OOC : Pool is out of compliance
```

Explanation This pool is Out Of Compliance

Recommended Action The pool is out of compliance. Customer needs to update his license pool

```
%IOSXE SMART AGENT-6-NOTIFY DISABLED : Smart Licensing is now Disabled
```

Explanation Smart Licensing is Disabled

Recommended Action None

```
%IOSXE SMART AGENT-6-NOTIFY ENABLED: Smart Licensing is now Enabled
```

Explanation Smart Licensing is Enabled

Recommended Action None

```
%IOSXE_SMART_AGENT-6-NOTIFY_GRACEWILLEXPIRE : Grace Period will Expire
```

Explanation Grace Period will expire

Recommended Action None

```
%IOSXE_SMART_AGENT-6-NOTIFY_InC : Pool is now in Compliance
```

Explanation Smart Licensing Pool in Compliance

Recommended Action None

IOSXE_SPA

```
%IOSXE SPA-3-CREATE TDLH FAILURE : Failed to create SPA [dec]/[dec] handle
```

Explanation Failed to create message handle for SPA communication.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-CREATE TDLMSG FAILURE: Failed to create [chars] message for [chars].
```

Explanation Failed to create/allocate necessary TDL message for SPA communication.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-CREATION_FAILURE : slot=[dec] subslot=[dec], spa_type=[hex], lc type=[hex].
```

Explanation Failed to create a SPA object.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-DIAG CONFIG : [chars] did not complete [dec]/[dec]
```

Explanation An error has occured during diagnostic test.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-DISPATCH_INIT_TDLH_FAILURE : Failed to initialize dispatch path for SPA [dec]/[dec] handle
```

Explanation Failed to initialize dispatch path handle for SPA communication.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-DOMAIN TDLH FAILURE : [chars], rc = [dec]
```

Explanation Failed to bind message handle for SPA communication.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance

Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-INVALID_CPU_NUM : cpu= [dec], max cpu = [dec]
```

Explanation An invalid CPU number is specified in one of the internal APIs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-INVALID_DATA_INSTANCE : interface type [chars], slot [dec] port [dec] vc [dec] : [chars]
```

Explanation Data required to support the interface is not available.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-INVALID_DB_NUM : db = [dec], max db = [dec], db intf = [dec], max db
intf = [dec]
```

Explanation An invalid daughter board number is specified in one of the internal APIs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-INVALID_HANDLE : Failed to get a valid IPC handle for type [int], slot [dec], subslot [dec].
```

Explanation The client handle was found to be NULL for the given type/slot/subslot.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-INVALID_IF_INDEX : index= [dec], spaType=[hex], slot [dec] subSlot [dec] slotunit [dec] vc [dec]
```

Explanation Index for the interface is not valid.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-INVALID INDX RANGE : index1= [dec], index2= [dec], maxIndex= [dec]
```

Explanation An invalid index range is specified in one of the internal APIs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-INVALID_RP_SLOT_NUM : slot= [dec], max slot = [dec]
```

Explanation An invalid RP slot number is specified in one of the internal APIs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-INVALID SLOT NUM : slot= [dec], max slot = [dec]
```

Explanation An invalid slot number is specified in one of the internal APIs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-INVALID SLOTUNIT NUM : cardwide-port = [dec], max cardwide-port = [dec]
```

Explanation An invalid cardwide-port number is specified in one of the internal APIs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to

gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-INVALID SPA TDL CCAPI USAGE :
```

Explanation Incorrect usage of an internal API that should only be used on CC.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-INVALID SUBSLOT NUM : subslot= [dec], max subslot = [dec]
```

Explanation An invalid subslot number is specified in one of the internal APIs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-IPC FAILURE : IPC failure while [chars]
```

Explanation An error has occurred while prepareing or sending an IPC message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-MEM ALLOC ERROR : [chars]
```

Explanation Memory allocation error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-NULL_BAY_PTR :
```

Explanation Pointer to SPA bay is NULL.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-NULL_SPA_PTR :
```

Explanation Pointer to a SPA object is NULL.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-NULL_VFT : [chars] virtual function table is not initialized. spaType=[hex]
```

Explanation A required function table is not initialized

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-NULL VFUNC : [chars] vector is not initialized. spaType=[hex]
```

Explanation A required function vector is not initialized

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-3-POWER CYCLE : [chars] occurred on Shared Port Adapter [int]/[int]
```

Explanation An error has occurred which will cause the Shared Port Adapter to be power cycled

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool:

https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start , or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-SENDCFGFAIL : Failed to send configuration for [chars] to carrier-card for subslot=[dec]/[dec]
```

Explanation Sending configuration failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-SETUP_TDLH_FAILURE : Failed to set the alloc/free handler for SPA [dec]/[dec] handle
```

Explanation Failed to set the alloc/free handler for SPA communication.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-SPA_CREATION_FAILURE : slot=[dec] subslot=[dec], PID=[chars] lc type=[hex].
```

Explanation Failed to create a SPA object.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_SPA-3-SPA_SETUP_FAILURE : Failed to properly setup for SPA communication on slot [dec], subslot [dec].
```

Explanation Discovery of the linux interface used to communicate with a SPA failed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%IOSXE SPA-3-UNSUPPORTED DATA : Data conversion error ([chars], [hex])
```

Explanation An internal software error has occured when converting the data specified in the message from one representation to another.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-6-DUAL RATE CHANGE : [chars]: [chars]
```

Explanation Change in rate of the link.

Recommended Action No action is required.

```
%IOSXE_SPA-6-TDLMSG_INCOMPATIBLE : Failed to copy message [chars] to buffer, not allowed for current domain.
```

Explanation Failure to marshal a message indicates an incompatibility with the intended recipient.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the **show tech-support** command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE SPA-6-UPDOWN : Interface [chars], link down due to [chars]
```

Explanation Ethernet link is down due to remote/local fault.

Recommended Action Replace the faulty cable.

IOSXE_THROUGHPUT

```
%IOSXE_THROUGHPUT-3-CONF_FAILED : Configuration failed. Installed license does not support the throughput level. Please install the valid license
```

Explanation An error occurred when the throughput configuration was attempted.

Recommended Action None

%IOSXE_THROUGHPUT-3-EULA_NOT_ACCEPTED : The EULA has to be accepted prior to throughput configuration.

Explanation Users need to accept EULA to activate the license

Recommended Action Accept EULA for throughput license

%IOSXE_THROUGHPUT-3-INVALID_CONFIG : No valid license found for the configured throughput level: [chars] kbps

Explanation Users has the boot up throughput set to non-default level without having the valid license.

Recommended Action Install valid throughput license

%IOSXE_THROUGHPUT-3-INVALID_LEVEL : An invalid throughput level: [chars] kbps was selected.

Explanation The configured throughput level is unknown

Recommended Action None

%IOSXE_THROUGHPUT-3-SETUP_FAILED : Throughput level setup failed. Boot up will be at the default throughput

Explanation An error occurred when licensing tried to setup the throughut

Recommended Action None

%IOSXE THROUGHPUT-6-LEVEL: Throughput level has been set to [dec]00000 kbps

Explanation Throughput level has been set to a number

Recommended Action None

IOSXE_TIMESTAMP_ENGINE

%IOSXE_TIMESTAMP_ENGINE-3-TSU_ERR : An unexpected condition has occurred at module ([chars])

Explanation An unexpected condition has occurred at the Interface Module TSU.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE TIMESTAMP ENGINE-4-ERROR : NULL

Explanation An unexpected condition has occurred.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_UPGRADE_ROMMON

```
%IOSXE_UPGRADE_ROMMON-0-ROMMON_LOADTEST_FAIL : ROMMON FIPS_140-3 Load test *FAILED*: file [chars]
```

Explanation FIPS 140-3 Related Load test failed for the ROMmon.

Recommended Action Check the system messages to see if any messages appeared that might indicate the source of the ROMmon Load test problem. If you do not find any additional information indicating a correctable problem, collect all output on the screen, in particular the console port output after the **upgrade rom-monitor** command was entered and the output of show rom-monitor, and provide the collected information to a Cisco technical support representative.

```
%IOSXE_UPGRADE_ROMMON-0-ROMMON_UPGRADE_FAIL : ROMMON upgrade failed: partition [chars]
```

Explanation An attempt to upgrade the ROMmon failed.

Recommended Action Check the system messages to see if any messages appeared that might indicate the source of the ROMmon problem. If you do not find any additional information indicating a correctable problem, collect all output on the screen, in particular the console port output after the **upgrade rom-monitor** command was entered and the output of show rom-monitor, and provide the collected information to a Cisco technical support representative.

IOSXE_USB

```
%IOSXE_USB-3-ESHOW_USB : Internal Error locating database for USB Devices.
```

Explanation The mcp_usb_devices is incorrect and needs to be changed

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_UTD

```
%IOSXE UTD-3-ALLOC : Failed to allocate message
```

Explanation When attempting to program the dataplane there was not enough memory to allocate the message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE UTD-3-MESSAGE : Failed to send message
```

Explanation When the message was being prepared for sending to the data plane, there was an error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE UTD-4-MT CONFIG DOWNLOAD: UTD MT configuration download has [chars]
```

Explanation In UTD multitenancy mode, the configuration download to the container can take a while. Please be patient.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_UTD-4-MT_CONTAINER_MESSAGE_NAK : Container responded to UTD message with an error: [dec]
```

Explanation The container rejected the UTD message

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
\mbox{\sc giosxe_utd-4-MT_container_MESSAGE_TIMEOUT} : UTD message sent to the container has timed out
```

Explanation The UTD message sent to the container has timed out.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_UTD-4-MT_CONTAINER_SESSION_TIMEOUT : UTD container download has timed out
```

Explanation The container did not respond with an up/down status before the session timed out.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_UTD-4-MT_CONTAINER_STATUS_DOWN : UTD poll: container status is DOWN
```

Explanation The container sent a down status to the poll message

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_UTD-4-SIG_UPDATE_CFG : UTD signature updates have been configured -A brief service interruption at the time of update is expected
```

Explanation The UTD service will be restarted if a new signature package is found. During this time, if fail-close has been configured (recommended), traffic that would be inspected by UTD will be dropped. Otherwise (default), traffic that would be inspected by UTD will be allowed to pass uninspected. To minimize this service interruption, it is recommended to schedule this operation outside of normal business hours.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
IOSXE\_UTD-4-SIG\_UPDATE\_EXEC: UTD signature update has been executed -A brief service interruption is expected
```

Explanation The UTD service will be restarted if a new signature package is found. During this time, if fail-close has been configured (recommended), traffic that would be inspected by UTD will be dropped. Otherwise (default), traffic that would be inspected by UTD will be allowed to pass uninspected. To minimize this service interruption, it is recommended to execute this operation outside of normal business hours.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_UTD-4-VERSION_INCOMPATIBILITY: UTD OVA version ([chars]) does not match supported UTD version ([chars])
```

Explanation The UTD OVA version does not match the required UTD version embedded in this IOS-XE version. This is an unsupported configuration and may behave unexpectedly.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_VMAN

```
IOSXE\_VMAN-3-MSGDISPATCH: Unable to dispatch received TDL message from Virt-manager
```

Explanation An unexpected condition has occurred while IOS was trying to dispatch a TDL message received from Virtmanager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_VMAN-3-MSGINITFAIL : Failed to initialize required Virt-manager resource: [chars]
```

Explanation During the initialization of the resources required by Virt-manager, a failure occurred. This has prevented virtual services from being activated.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE VMAN-3-RSPMSGHDLR : Failed to deliver response message: [chars]
```

Explanation An unexpected condition has occurred while IOS was trying to deliver a response message to a virtual service received from Virt-manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_WCCP

```
%IOSXE_WCCP-4-ACELIMIT : Too many ACEs in MASK ACL, please switch to Hash mode
```

Explanation Mask merged ACL generate too many ACEs.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip access-lists command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE WCCP-4-BADACE : Access list contains invalid ace
```

Explanation An unexpected condition has occurred which is due to an invalid statement in the access list structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip access-lists command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE WCCP-4-NOACL : Access list is null
```

Explanation An unexpected condition has occurred which is due to the absence of an access list structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> show ip access-lists command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_WCCP-4-NOINPUT : NULL input, [chars]
```

Explanation An unexpected condition has occurred which is due to the NULL value of the input parameter.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the cmdBold> show ip wccp command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_WCCP-4-NOINTF: No [chars] interface info for Service Group ([dec], [dec], [int])
```

Explanation An unexpected condition has occurred which is due to the absence of MCP WCCP interface info for the specific service group.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show platform

software wccp command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE WCCP-4-NOSTATS : WCCP [chars] message error
```

Explanation An unexpected condition has occurred which is due to the error in receiving WCCP stats update message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold show platform software wccp <id>counters command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE WCCP-4-NOSTATSINTF : Interface handle [int] not exsit for the stats message
```

Explanation An unexpected condition has occurred which can't find the interface handle for the interface stats message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show platform software wccp <id> int counters command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_WCCP-4-NOSTATSSVC : Service Group ([dec], [dec], [int]) not exist for the stats message
```

Explanation An unexpected condition has occurred which can't find the service group for the service group stats message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show platform software wccp command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%IOSXE_WCCP-4-NOSVCGRP : [chars] Service Group ([dec], [dec], [int]) NOT exist
```

Explanation An unexpected condition has occurred which is due to the absence of the service group structure.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show ip wccp command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%IOSXE_WCCP-4-UNKNOWNDIR : Unknown [chars] interface direction [hex] for Service Group ([dec], [dec], [int])

Explanation An unexpected condition has occurred which is due to the unknown direction has been applied to the interface for the service group.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the <CmdBold> show platform software wccp command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

IOSXE_WD

```
%IOSXE WD-2-HEARTBEAT FAIL : Heartbeat is not emitted. Heartbeat count:[dec]
```

Explanation Failure in IOS to generate a heartbeat is an abnormal condition

Recommended Action This message may be related to an abnormal configuration and system load, or transient high processing demand. When reporting this message, copy the message text exactly as it appears, include the stack trace and report to your technical support representative

```
%IOSXE WD-2-HOG DETECT FAIL : CPUHOG detection failed to start.
```

Explanation Failure in setting up CPUHOG detection mechanism is an abnormal condition

Recommended Action This message may be related to an abnormal configuration and system load, or transient high processing demand. When reporting this message, copy the message text exactly as it appears, include the stack trace and report to your technical support representative

ISSU

```
%ISSU-0-BOOT SYNC FAIL: Problem with sync of ISSU boot state -[chars]
```

Explanation The ISSU state between two FRUs is not properly synchronized as a result of a boot error.

Recommended Action This message will automatically appear during certain events, such as during a FRU removal or if the FRU loses connectivity. In most cases, the router will resynchronize the ISSU state between the FRUs without any user intervention. If the ISSU state is not resynchronized after multiple attempts, the problem is likely a result of another problem. Monitor the other system messages to see if a more serious issue has occurred on your router. If you are unable to resolve this other issue and this message persists, gather the output of show tech-support and provide it to a Cisco technical support representative.

```
%ISSU-0-PKG INCONSIST : Reason: [chars]
```

Explanation A software consolidated package or sub-package has an error that indicates the sub-package should not be installed or used.

Recommended Action If this message is received, the desired consolidated package or sub-package should not be used. Upgrade using a different consolidated package or sub-package, and report the problem consolidated package or sub-package to Cisco technical support.

```
%ISSU-0-PKG MNT SCRIPT FAIL : Package: [chars]
```

Explanation A consolidated package or sub-package has encountered an error indicating it is not usable.

Recommended Action Upgrade your software using a different consolidated package or sub-package.

```
%ISSU-0-RESET FRU FAIL : Problem with ISSU reset of remote FRU -[chars]
```

Explanation After a sub-package installation, one or more FRUs that were upgraded failed to initialize within the timeout period.

Recommended Action This problem is more likely to occur in routers with larger configurations, so if your router has a large configuration, you may want to wait a few more minutes to see if your hardware initializes. If the hardware continues to not initialize, reset the FRUs which failed to initialize. If resetting the FRUs fails to resolve the issue, gather the output of show tech-support and contact a Cisco technical support representative.

```
%ISSU-0-SOFTWARE INVALID: Package for location [chars]: [chars]
```

Explanation The sub-packages have encountered an error related to the structure of the loaded software.

Recommended Action This error is likely caused by a failure of the boot or installation process or a corrupted provisioning file. If the system displays error messages related to the boot that can be addressed, address those messages. Downloading new software, if possible, may also help with the problem. If the problem persists, gather the output of show tech-support and provide it to a Cisco technical support representative.

```
%ISSU-3-BOOT SYNC : Problem with sync of ISSU boot state -[chars]
```

Explanation The ISSU state between two FRUs is not properly synchronized as a result of a boot error.

Recommended Action This message will automatically appear during certain events, such as during a FRU removal or if the FRU loses connectivity. In most cases, the router will resynchronize the ISSU state between the FRUs without any user intervention. If the ISSU state is not resynchronized after multiple attempts, the problem is likely a result of another problem. Monitor the other system messages to see if a more serious issue has occurred on your router. If you are unable to resolve this other issue and this message persists, gather the output of show tech-support and provide it to a Cisco technical support representative.

```
%ISSU-3-BOOT UNCLEAN : Found reload log file, moved to [chars]
```

Explanation A log file was found at bootup indicating that all shutdown tasks were not performed on a previous reload.

Recommended Action No user action is necessary. The system will automatically resolve most issues related to the shutdown task as part of the bootup procedure. If a problem related to the tasks that did not shutdown occurs, another error message will occur providing information about that problem.

```
%ISSU-3-INCOMPAT : The packages in [chars] are not consistent
```

L

Explanation The sub-packages specified for running on the chassis are not compatible with one other.

Recommended Action Install a compatible set of packages to allow normal operation. This will require booting a known-good package set.

```
%ISSU-3-SYNC ERR : Problem with sync of state -[chars]
```

Explanation The software state between two FRUs or switches is not properly synchronized as a result of a boot error.

Recommended Action This message may appear during certain events, such as during a FRU or switch removal or if the FRU or switch loses connectivity. In most cases, the router will resynchronize the software state between the FRUs or switches without any user intervention. If the software state is not resynchronized after multiple attempts, the problem is likely a result of another problem. Monitor the other system messages to see if a more serious issue has occurred on your router. If you are unable to resolve this other issue and this message persists, gather the output of show techsupport and provide it to a Cisco technical support representative.

```
%ISSU-3-UCODE INCOMPAT : Found mismatch for ucode feature -[chars]
```

Explanation During boottime microcode feature version check, a version mismatch was found for this feature.

Recommended Action Please ensure that versions of features in microcode are compatible by provisioning a different set of microcode files.

```
%ISSU-5-ISSU AUTO ROLLBACK: ISSU rollback timer expired: initiating rollback
```

Explanation An ISSU upgrade has been rolled back because the rollback timer has expired.

Recommended Action No user action is needed. If you want to commit the ISSU upgrade, redo the upgrade. Otherwise, this is an informational message only.

```
%ISSU-5-ISSU STATE INVALID : ISSU stored state found invalid and cleaned up: [chars]
```

Explanation The RP has corrected a failed ISSU install state that was detected at bootup.

Recommended Action No user action is necessary. This is an informative message indicating that the failed ISSU state has been corrected.

L

LICENSING

```
%LICENSING-6-LIC_MISMATCH : Configured license image level [chars] does not match
the current level [chars]. Reload is required to bring the system up in [chars]
```

Explanation During boot-up of system, the configured license image level might mismatch with the current level. This could happen when customer copy a different startup-config to the system.

L

Recommended Action Reload is required to bring the system up in the configured license image level.

LIIN

```
%LIIN-3-SET ACCESS FAIL: Installing LIIN interface access control failed
```

Explanation This error happens when IOS failed to set the access control function for the LIIN, possibly due to IOSd out of memory or corruption. In this case, LIIN interface setup will not proceed, will not operate properly and cannot be recovered. Persistent access features and interactive commands will not work.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%LIIN-3-SET TABLEID FAIL : Installing [chars] LIIN interface tableid failed
```

Explanation This error happens when IOS failed to set tableid into linux kernel, possibly due to either IOSd or kernel out of memory or corruption. In this case, LIIN interface will not have VRF installed for the associated address family. The LIIN interface will not operate properly and cannot be recovered. Persistent access features and interactive commands will not work.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%LIIN-3-VRFADD FAIL : Problem creating vrf
```

Explanation The LIIN config process failed to allocate a mandatory iVRF. The LIIN interface will not operate properly and cannot be recovered. Persistent access features and interactive commands will not work.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%LIIN-3-VRFMODIFY FAIL : Problem adding LIIN interface to vrf table
```

Explanation The LIIN config process failed to assign the LIIN interface to its mandatory iVRF. The LIIN interface will not operate properly and cannot be recovered. Persistent access features and interactive commands will not work.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

L

representative with the gathered information.

```
%LIIN-6-TELNET ALLOWED : Telnet access allowed due to romvar: SR INIT SHELL
```

Explanation Telnet from shell to IOS allowed because rommon variable SR_INIT_SHELL is set with value aux_do_system_shell. Remove this value from SR_INIT_SHELL or unset SR_INIT_SHELL to disable the telnet access

Recommended Action No action is required.

LOTR_DBG

```
%LOTR_DBG-3-LOTR_RSRS_HA_ERR : [chars]
```

Explanation Resource dynamically allocated are synced to standby. Due to error mentioned, sync failed. So, standby won't be having same database as active

Recommended Action None

LSMPI

```
%LSMPI-4-INJECT_FEATURE_ESCAPE : Egress [chars] packet delivered via legacy inject path
```

Explanation A packet with a CPP supported L3 encapsulation (such as IP) was produced by IOS but delivered to CPP via the L2/legacy inject path instead of the proper L3 inject path. For this packet, outbound features will not be applied and packet accounting will likely be incorrect.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

LUA_VM

```
%LUA VM-2-INITIALIZATION : Cannot initialize the Lua Virtual Machine
```

Explanation The Lua Virtual Machine is a critical component of the shell-manager process. It is used to render responses to user commands. If this component cannot be initialized then the shell-manager will be unable to process any commands directed at the IOS-XE daemons.

Recommended Action The shell-manager process could not be started. Check the trace log files for more details as to why the virtual machine failed to initialize correctly. This may be an out of memory condition so rebooting the chassis may resolve the problem.

M

M

MACSEC

%MACSEC-4-IPMTU_OVERSIZE : MACsec enabled interface [chars] IP MTU can't be more than [dec]

Explanation User config IP MTU size over MACsec enabled interface allows.

Recommended Action Reconfigure IP MTU base on the suggested range.

```
%MACSEC-4-RX_SC_EXCEED : (RX SCI [hex] : TX SCI [hex] : vport [dec] : secy vport
[dec])
```

Explanation RX SC exceeds hardware limit.

Recommended Action No action required (normal operation).

```
%MACSEC-4-TX_SC_EXCEED : (TX SCI [hex] : vport [dec])
```

Explanation TX SC exceeds hardware limit.

Recommended Action No action required (normal operation).

```
%MACSEC-5-TX SA PN EXPIRE : (TX SCI [hex] : AN [dec]) TX SA PN about to expire.
```

Explanation TX SA PN about to expire. Send a request to MKA to perform a SAK Rekey for the given TX SCI and AN.

Recommended Action No action required (normal operation).

```
%MACSEC-6-CREATE_RX_SC : ([chars] RX SCI [hex] : TX SCI [hex] : vport [dec] : secy vport [dec])
```

Explanation MKA request MACsec PD to create a RX SC on the given RX SCI and vport.

Recommended Action No action required (normal operation).

```
%MACSEC-6-CREATE_TX_SC : ([chars] TX SCI [hex] : vport [dec])
```

Explanation MKA request MACsec PD to create a TX SC on the given TX SCI and vport.

Recommended Action No action required (normal operation).

```
%MACSEC-6-DEL RX SA : ([chars] RX SCI [hex] : vport [dec] : an [dec])
```

Explanation MKA request MACsec PD to delete a RX SA on the given RX SCI, vport and an.

Recommended Action No action required (normal operation).

M

```
%MACSEC-6-DEL RX SC: ([chars] RX SCI [hex]: vport [dec])
```

Explanation MKA request MACsec PD to delete a RX SC on the given RX SCI and vport.

Recommended Action No action required (normal operation). No action required (normal operation).

```
%MACSEC-6-DEL TX SC : ([chars] TX SCI [hex] : vport [dec])
```

Explanation MKA request MACsec PD to delete a TX SC on the given TX SCI and vport.

Recommended Action No action required (normal operation).

```
%MACSEC-6-INSTALL_RX_SA: ([chars] RX SCI [hex]: vport [dec]: an [dec]: secy vport [dec])
```

Explanation MKA request MACsec PD to install a RX SA on the given RX SCI, vport and an.

Recommended Action No action required (normal operation).

```
%MACSEC-6-INSTALL_TX_SA : ([chars] TX SCI [hex] : vport [dec] : an [dec] : next_pn [hex])
```

Explanation MKA request MACsec PD to install a TX SA on the given TX SCI, vport and an.

Recommended Action No action required (normal operation).

```
%MACSEC-6-POST_FAIL : ([chars] Power-On-System-Test failure in Trial No.[dec])
```

Explanation MACSEC power-on-system-test failed

Recommended Action No action required (normal operation).

```
%MACSEC-6-POST SUCC : ([chars] Power-On-System-Test success in Trial No.[dec])
```

Explanation MACSEC power-on-system-test successful

Recommended Action No action required (normal operation).

MCPRP_CLI

```
%MCPRP_CLI-6-LICENSE_EXPIRED : Shell access disabled due to license expiration
```

Explanation Shell license is expired. Thus the shell access is disabled

Recommended Action Get and install another shell license

MCPRP_DAI

```
%MCPRP_DAI-4-ERR_DISABLE : DAI detected error on [chars], putting [chars] to err-disable
```

Explanation Dynamic ARP inspection has detected an error condition because ARP packets have exceeded the configured rate or burst

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

MCP_SYS

```
%MCP SYS-0-ASSERTION FAILED : Assertion failed: [chars]
```

Explanation An internal state consistency check failed. Correct operation cannot be guaranteed, and the system has been halted.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

N

NCS4200IM

```
%NCS4200IM-3-DIFF_IM_INSERTED : [chars] -[chars] in bay [dec]
```

Explanation A different IM type has been inserted in the bay which previously had another IM type. If the interfaces were set to default before swap, the IM will boot up fine. If not, IM will goto Out-of-service state. Kindly insert the previous IM type, use hw-module subslot 0/x default and then proceed with the IM swap. If not, might need to reload the box for recovery

Recommended Action None

```
%NCS4200IM-3-INCOMPATIBLE : [chars]-[dec]
```

Explanation P1D and onwards, Cu IM.... is not backward compatible with P1A/P1B/P1C Cu IM, use the same build of Cu IM or reload the router to use the new build.

Recommended Action None

```
%NCS4200IM-3-INVALID_COMBINATION: [chars] is not allowed in bay [dec], can be supported only in bay(s) [chars]
```

Explanation The inserted IM is not supported in the specified subslot given the combination of existing IMs in the chassis.

Recommended Action None

%NCS4200IM-3-UNSUPPORTED: This Interface Module is not supported in subslot [dec]

Explanation The inserted IM is not supported in the specified subslot. Kindly check the supported slots for the IM type.

Recommended Action None

 ${\tt NCS4200IM-3-UNSUPPORTED_PLATFORM}$: This Interface Module is not supported in [chars] platform

Explanation The inserted IM is not supported in the specified platform

Recommended Action None

NCS4200INTF

%NCS4200INTF-3-UNSUPPORTED: Interface [chars] is not supported in subslot [dec] by the [chars] module

Explanation The Interface specified in the error message is not supported in the specified Subslot by the version of the operating system currently running on the system.

Recommended Action None

NCS4200_PTP

%NCS4200 PTP-3-MSGDISPATCH : Unable to dispatch received TDL message from PTP daemon

Explanation An unexpected condition has occurred while IOS was trying to dispatch a TDL message received from PTP daemon.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%NCS4200 PTP-3-MSGINITFAIL : Failed to initalize required PTP resource: [chars]
```

Explanation During the initialization of the resources required by PTP, a failure occured. This has prevented PTP from being activated.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance

Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

NCS4206_CFC

```
%NCS4206 CFC-3-PUNT KEEPALIVE ERR ALLOC CSB: Failed to allocate a csb
```

Explanation Can't allocate a csb when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
NCS4206\_CFC-3-PUNT\_KEEPALIVE\_ERR\_ALLOC\_TTY: Failed to allocate a tty
```

Explanation Can't allocate a TTY when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%NCS4206 CFC-3-PUNT KEEPALIVE ERR OPEN FILE : Failed to open file: [chars]
```

Explanation Failed to open file when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%NCS4206_CFC-3-PUNT_KEEPALIVE_ERR_WRITE_TO_FILE : Write to file Id [dec] failed [dec] bytes, expected [dec] bytes
```

Explanation Write to file failed when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%NCS4206_CFC-4-PUNT_KEEPALIVE_ERR_CLOSE_FILE : Failed to close file with descriptor:
[dec]
```

Explanation Closing of file failed when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%NCS4206 CFC-4-PUNT KEEPALIVE ERR GET FILE NAME : Failed to get file name
```

Explanation Could not form a file name when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%NCS4206 CFC-4-PUNT KEEPALIVE ERR INV FILE ID : Invalid file descriptor: [dec]
```

Explanation Invalid file descriptor was found when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%NCS4206 CFC-4-PUNT KEEPALIVE ERR INV PARAM : Invalid parameter: [chars]
```

Explanation Invalid parameter was passed when generating punt err log

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

NETCLK

```
%NETCLK-4-NETCLK CMD FAIL : NULL
```

Explanation This message indicates that a network clock command from RP to IOS-SR or SPAs has failed

Recommended Action The message can be ignored if the carrier card was reloaded or powered down. Otherwise, Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Issue the CmdBold> show logging and show network-clocks command to gather data that may help identify the nature of the error. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

0

```
%NETCLK-5-NETCLK_CHANGE : Network clock source transitioned from priority [dec]
[chars] to priority [dec] [chars]
```

Explanation This notice indicates a change in the clock source.

Recommended Action No action required.

%NETCLK-5-NETCLK_MODE_CHANGE : Network clock source not available. The network clock
has changed to [chars]

Explanation None

Recommended Action No action required

```
%NETCLK-5-NETCLK_PHASE_LOST : Network clock source not available. Phase-lost on
clock priority [dec] [chars]
```

Explanation None

Recommended Action No action required

NILE_RLDRAM

```
%NILE_RLDRAM-3-RLDRAM_READ : A memory read attempted beyond the boundary limit: off-
set = [hex]. Allowed offset = [hex]
```

Explanation An attempt was made to read memory beyond the boundary limit. This error could be caused by software defect.

Recommended Action Examine the logs for RLDRAM read offset

```
%NILE_RLDRAM-3-RLDRAM_WRITE : A memory write attempted beyond the boundary limit:
offset = [hex]. Allowed offset = [hex]
```

Explanation An attempt was made to read memory beyond the boundary limit. This error could be caused by software defect.

Recommended Action Examine the logs for RLDRAM read offset

O

ООМ

 $\$00M-0-NO_MEMORY_RESET$: The system is completely out of available memory. The board will be reset.

Explanation The system has exhausted all available memory and the hardware component will be reset.

P

Recommended Action Review other messages related to low memory states and see if those messages contain any information about an issue that can be addressed. If this problem persists, copy all the output from the console as well as the output of show tech-support, and provide the gathered information to your Cisco technical support representative.

```
%OOM-3-NO_MEMORY_AVAIL : The system is very low on available memory. Operations will begin to fail.
```

Explanation The system has exhausted all available memory. It is not possible to continue stable operation.

Recommended Action The system has exhausted all available memory and stable operation is no longer possible.

P

PEGA_PTP_ENABLER

Explanation None

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

PLATFORM

```
%PLATFORM-3-BACKUP_NVRAM_OPEN_FAIL : Failed to open backup nvram -[chars].
```

Explanation The backup nvram device could not be opened.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLATFORM-3-BACKUP NVRAM READ FAIL : Failed to read backup nvram -[chars].
```

Explanation The backup nvram contents could not be read.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance

P

Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLATFORM-3-BACKUP NVRAM WRITE FAIL : Failed to write backup nvram -[chars].
```

Explanation Couldn't write into the backup nvram device.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLATFORM-3-ELEMENT_CRITICAL: [chars]: [chars] value [chars] [chars] critical level [chars]
```

Explanation The Shell Manager monitors the health of each board and emits an error message when a value has passed a critical level.

Recommended Action Reduce static and dynamic loads on the system by reducing the number of elements in the configuration or by limiting the capacity for dynamic services.

```
%PLATFORM-3-GEC NOMAC : Can't allocate MAC address for port-channel interface [int]
```

Explanation MAC address allocation failed for the port-channel interface specified in the message. This may happen if the port-channel interface exceeds the maximum number of supported port-channel interfaces.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLATFORM-3-HASTATUS FAIL : RP switchover, [chars] (count [int])
```

Explanation RP switchover failed to reach active state. The RP will be reset. This is indicative of a IPC problem between IOSd and CMRP

Recommended Action Make sure system achieves full redundant state after the RP reset. If not, reload entire system

```
%PLATFORM-3-NO BASEMAC : Can't retrieve base MAC address
```

Explanation Base MAC address determination failed at system start.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLATFORM-3-NOMAC : Can't allocate MAC address for interface [int]/[int]
```

Explanation MAC address allocation failed because of an incorrect slot and port combination, which exceeds the maximum available hardware.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLATFORM-3-NOMAC INTF : Failed to allocate MAC address for interface [chars]
```

Explanation MAC address allocation failed for logical interface specified in the message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLATFORM-3-NVRAM OPEN FAIL : Failed to open nvram -[chars].
```

Explanation The nvram device could not be opened.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLATFORM-3-NVRAM READ FAIL : Failed to read nvram -[chars].
```

Explanation The nyram contents could not be read.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLATFORM-3-NVRAM WRITE FAIL : Failed to write nvram -[chars].
```

Explanation Couldn't write into the nyram device.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

Р

```
%PLATFORM-3-REDMODE FAIL : Redundancy mode: [chars] (rc [dec])
```

Explanation Redundancy mode change could not be processed. This is indicative of a IPC problem between IOSd and the peer platform process.

Recommended Action Make sure system achieves full redundant state. If not, reload entire system

```
%PLATFORM-3-RF_PROG_FAIL : Progression completion notification to chassis management failed, [chars]
```

Explanation Could not notify the completion of the RF progression to the chassis management process. The system will potentially not be in a fully redundant state.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLATFORM-3-RF_RELOAD_PEER : Reload peer notification to chassis management failed,
[chars]
```

Explanation Could not notify Reload Peer to the chassis management process. The Standby peer could not be reloaded by the Active. The system will potentially not be in a fully redundant state.

Recommended Action Reload peer instance using the available CLI commands. If system does not achieve full Standby status after that, the system must be reloaded

```
%PLATFORM-4-ELEMENT_WARNING : [chars]: [chars] value [chars] [chars] warning level
[chars]
```

Explanation The Shell Manager monitors the health of each board and emits a warning message when a value has passed a critical level.

Recommended Action Reduce static and dynamic loads on the system by reducing the number of elements in the configuration or by limiting the capacity for dynamic services.

```
%PLATFORM-4-HASTATUS WARN : RP HA status warning, [chars])
```

Explanation Standby RP reports peer not present event. This is indicative of a IPC problem between IOSd and CMRP

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLATFORM-4-RELOAD STANDBY : [chars] reload requested by [chars]. Reason [chars]
```

Explanation Unexpected configuration or states mismatch between Active and Standby RPs. Reloading Standby to synchronize the configuration or states.

Ρ

Recommended Action None. This is expected behavior.

```
%PLATFORM-4-STATS_COLLECTION : Reducing statistics collection interval for SPA ([chars]) will impact the RP control plane activity
```

Explanation MIB statistics for HW counters are sent from CC to RP every 10 seconds by default, changing the timer through CLI to send more often will increase RP CPU utilization and result in sending more IPC messages between CC and RP

Recommended Action No action is required.

```
%PLATFORM-6-EVENT LOG : [chars]
```

Explanation An entry from the internal event log at reload on the standby RP. This is informational.

Recommended Action No action is required.

```
%PLATFORM-6-HASTATUS : RP switchover, [chars]
```

Explanation RP switchover events received by platform code.

Recommended Action No action is required.

```
%PLATFORM-6-HASTATUS DETAIL: RP switchover, [chars] (count [int])
```

Explanation RP switchover events received by platform code.

Recommended Action No action is required.

```
%PLATFORM-6-LOWSPACE : SD [chars] : low space alarm assert
```

Explanation bootflash memory is very low Delete the old file from boot flash to create space

Recommended Action No action is required.

```
%PLATFORM-6-LOWSPACERECOVER: SD [chars]: low space alarm deassert
```

Explanation bootflash memory

Recommended Action No action is required.

```
%PLATFORM-6-RF PROG SUCCESS : RF state [chars]
```

Explanation A marker to illuminate when the standby reaches a terminal state.

Recommended Action No action is required.

Р

%PLATFORM-6-SB_INIT_DELAY: RF progression will be suspended due to standby initialization delay configuration setting. Standby initialization will resume after [int] seconds

Explanation An informational message about the standby initialization delay configuration. RF progression will be delayed for the configured value. Bulk-sync and other progression events will not happen until after the configured delay value

Recommended Action No action is required.

%PLATFORM-6-SB_INIT_DELAY_END : RF progression delay timer expired. Standby initialization will now continue

Explanation An informational message about the standby initialization delay configuration. RF progression will now continue since configured delay has expired

Recommended Action No action is required.

PLATFORM_ACT2

```
%PLATFORM ACT2-2-SUDI VALIDATION FAILED : Secure UDI validation failed. [chars]
```

Explanation Secure UDI validation for the chassis failed. The router failed to authenticate itself

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

PLATFORM_BRKOUT

%PLATFORM_BRKOUT-3-BRKOUTCMD_SYNCFAILED : Failed to send Breakout command to hardware.

Explanation A messages that was sent the hardware module, was not deliverd correctly. The failure most likely occurred because of a software communication error.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

PLATFORM_SCC

%PLATFORM SCC-1-AUTHENTICATION FAIL : Chassis authentication failed

P

Explanation This Router may not have been manufactured by Cisco or with Cisco's authorization. This product may contain software that was copied in violation of Cisco's license terms. If your use of this product is the cause of a support issue, Cisco may deny operation of the product, support under your warranty or under a Cisco technical support program such as Smartnet. Please contact Cisco's Technical Assistance Center for more information.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

PLATFORM_TAM

```
%PLATFORM TAM-2-SUDI VALIDATION FAILED : Secure UDI validation failed. [chars]
```

Explanation Secure UDI validation for the module failed. The module failed to authenticate itself

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

PLIM_QOS

```
%PLIM_QOS-3-IOSXE_RP_PLIM_QOS_FAIL : A software error while configuring the [chars] on slot [dec]
```

Explanation This error happens when IOS fails to send messages to configure the per slot qos parameters in forwarding plane

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

PLOGDRP

```
%PLOGDRP-3-MSGBIPCBUFFER: Unable to acquire a BIPC buffer for sending messages.
```

Explanation A message was to be sent by IOS, but no BIPC buffer was available. The message to be sent has been discarded and the associated operation failed.

P

representative with the gathered information.

```
%PLOGDRP-3-MSGDISPATCHERR : Error when receiving TDL error message: [chars]
```

Explanation An unexpected condition in which IOS has received an error during TDL message processing from the Proxy Logger.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLOGDRP-3-MSGDISPATCHERR_SIZE : Received TDL error message is larger than supported
size :[dec]
```

Explanation A TDL message larger than supported has been received and partial message of that is displayed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLOGDRP-3-MSGDISPATCHNULL : Received NULL TDL message
```

Explanation An unexpected condition in which IOS has received a NULL TDL message for the Proxy Logger.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLOGDRP-3-MSGINVALIDFIELD : Invalid errmsg field '[chars]' received from the Proxy Logger, error [dec]
```

Explanation An error message received from the Proxy Logger is missing a required field.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%PLOGDRP-4-MSGDISPATCH : Unable to dispatch received TDL message '[chars]' from Proxy Logger. LUID: [chars]
```

Explanation An unexpected condition has occurred while IOS is trying to dispatch to the TDL message handler functions for received TDL messages from Proxy Logger.

Ρ

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

PMAN

```
%PMAN-0-PROCESS_NOTIFICATION : The process lifecycle notification component failed because [chars]
```

Explanation The process lifecycle notification component failed, preventing proper detection of a process start and stop. This problem is likely the result of a software defect in the software sub-package.

Recommended Action Note the time of the message and investigate the kernel error message logs to learn more about the problem and see if it is correctable. If the problem cannot be corrected or the logs are not helpful, copy the error message exactly as it appears on the console along with the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PMAN-0-PROCFAILCRIT : A critical process [chars] has failed (rc [dec])
```

Explanation A process important to the functioning of the router has failed.

Recommended Action Note the time of the message and investigate the error message logs to learn more about the problem. If the problem persists, copy the error message and the output of show platform software tech-support into a plaintext file and contact Cisco technical support with the gathered information.

```
%PMAN-3-PROC_BAD_COMMAND: Non-existent executable or bad library used for process [chars]
```

Explanation The executable file used for the process is missing or a dependent library is bad

Recommended Action Make sure that the named executable is present and dependent libraries are good

```
%PMAN-3-PROC_BAD_EXECUTABLE : Bad executable or permission problem with process [chars]
```

Explanation The executable file used for the process is bad or has permission problem

Recommended Action Make sure that the named executable is replaced with correct executable

```
%PMAN-3-PROC EMPTY EXEC FILE : Empty executable used for process [chars]
```

Explanation The executable file used for the process is empty

Recommended Action Make sure that the named executable is of non-zero size

```
%PMAN-3-PROCFAIL: The process [chars] has failed (rc [dec])
```

P

Explanation The process has failed as the result of an error.

Recommended Action This message will appear with other messages related to the process. Check the other messages to determine the reason for the failures and see if corrective action can be taken. If the problem persists, copy the error messages and the output of show platform software tech-support into a plaintext file and contact Cisco technical support.

%PMAN-3-PROCFAIL_IGNORE: [chars] process exits and failures are being ignored due to debug settings. Normal router functionality will be affected. Critical router functions like RP switchover, router reload, FRU resets, etc. may not function properly.

Explanation A process exit or failure is being ignored due to the user-configured debug settings.

Recommended Action If this behavior is desired and the debug settings are set according to the user's preference, no action is needed. If the appearance of this message is viewed as a problem, change the debug settings. The router is not expected to behave normally with this debug setting. Functionality like SSO switchover, router reloads, FRU resets, etc. will be affected. This setting should only be used in a debug scenario. It is not normal to run the router with this setting

```
%PMAN-3-PROCFAILOPT : An optional process [chars] has failed (rc [dec])
```

Explanation A process that does not affect the forwarding of traffic has failed.

Recommended Action Note the time of the message and investigate the kernel error message logs to learn more about the problem. Although traffic will still be forwarded after receiving this message, certain functions on the router may be disabled as a result of this message and the error should be investigated. If the logs are not helpful or indicate a problem you cannot correct, copy the error message as it appears on the console and the output of show tech-support and provide the information to a Cisco technical support representative.

```
%PMAN-3-PROCHOLDDOWN : The process [chars] has been helddown (rc [dec])
```

Explanation The process was restarted too many times with repeated failures and has been placed in the holddown state

Recommended Action This message will appear with other messages related to the process. Check the other messages to determine the reason for the failures and see if corrective action can be taken. If the problem persists, copy the error messages and the output of show platform software tech-support into a plaintext file and contact Cisco technical support.

```
%PMAN-3-PROC_RESTART_CNT_EXCEEDED : The process [chars] restart count ([dec]) has exceeded the configured limit ([dec])
```

Explanation The process was restarted many times and has exceeded the configured limit.

Recommended Action This message will appear with other messages related to the process. Check the other messages to determine the reason for the failures and see if corrective action can be taken. If the problem persists, copy the error messages and the output of show platform software tech-support into a plaintext file and contact Cisco technical support.

P

%PMAN-3-RELOAD_FRU_IGNORED: All [chars]/[dec] reloads are being ignored. This is being done for debugging purposes and will be changed at a later time to allow the reload. Critical router functions like RP switchover, router reload, FRU resets, etc. may not function properly.

Explanation A supervisor failure is being ignored due to debugging purposes.

Recommended Action This will be removet at a later point in time

```
%PMAN-3-RELOAD RP : Reloading: [chars]
```

Explanation The RP is being reloaded

Recommended Action Make sure this is not due to an error condition. If it is due to an error condition, collect information requested by the other log messages

```
%PMAN-3-RELOAD_RP_SB_NOT_READY : Reloading: [chars]
```

Explanation The RP is being reloaded since there is no ready standby instance

Recommended Action Make sure this is not due to an error condition

```
%PMAN-3-RELOAD SYSTEM : Reloading: [chars]
```

Explanation The system is being reloaded

Recommended Action Make sure this is not due to an error condition. If it is due to an error condition, collect information requested by the other log messages

```
%PMAN-3-RPSWITCH: RP switch initiated. Critical process [chars] has failed (rc [dec])
```

Explanation A RP switchover has been initiated due to a critical fault

Recommended Action Make sure this is not due to an error condition. If it is due to an error condition, collect debug information like all console output and log files

```
%PMAN-5-EXITACTION : Process manager is exiting: [chars]
```

Explanation The process manager is exiting

Recommended Action Make sure this is not due to an error condition. If it is due to an error condition, collect information requested by the other log messages

```
%PMAN-6-PROCSHUT : The process [chars] has shutdown
```

Explanation The process has gracefully shutdown.

Recommended Action No user action is necessary. This message is provided for informational purposes only.

Р

```
%PMAN-6-PROCSTART : The process [chars] has started
```

Explanation The process has launched and is operating properly.

Recommended Action No user action is necessary. This message is provided for informational purposes only.

```
%PMAN-6-PROCSTATELESS: The process [chars] is restarting stateless
```

Explanation The process has requested a stateless restart.

Recommended Action No user action is necessary. This message is provided for informational purposes only.

PTPD

```
%PTPD-0-CHASFS_OBJECT_CREATE : Failed to create chassis filesystem object [chars] because [chars]
```

Explanation The hardware failed to create a chassis filesystem object.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-CHASFS_OBJECT_NOT_PRESENT : Expected chassis filesystem object [chars] not present.
```

Explanation A chassis filesystem object expected to be present is not. This could be due to a software defect or filesystem failure.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-CHASFS_OBJECT_WATCH : Failed to watch chassis filesystem object [chars] because [chars]
```

Explanation A chassis filesystem object was not watched because of the reason stated in the error message.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-CHASFS_PROPERTY_CREATE : Failed to create chassis filesystem object [chars]
property [chars] because [chars]
```

Explanation A chassis filesystem property was not properly created.

Ρ

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-CHASFS_PROPERTY_GET: Failed to read chassis filesystem object [chars] property [chars] because [chars]
```

Explanation A chassis filesystem property was not properly read by the system.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-CHASFS_PROPERTY_NOT_PRESENT : Expected chassis filesystem object [chars] property [chars] not present.
```

Explanation A chassis filesystem object property expected to be present is not. This could be due to a software defect or filesystem failure.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-CHASFS_PROPERTY_SET: Failed to write chassis filesystem object [chars] property [chars] because [chars]
```

Explanation A chassis filesystem property failed to write.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-EVENT_LIBRARY: An event facility initialization or maintenance function failed because [chars]
```

Explanation An event facility initialization or maintenance function failed. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-IPC CONNECTION INVALID : An IPC connection has invalid state.
```

P

Explanation An IPC connection has an invalid state. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-IPC CONNECT MASTER : IPC connection to the active RSP failed because [chars]
```

Explanation IPC connection to the active RSP failed. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-IPC INITIALIZATION : IPC initialization failed because [chars]
```

Explanation IPC initialization failed. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-MESSAGE REGISTER : Failed to register with active RSP because [chars]
```

Explanation The active RSP failed to register.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-MESSAGE RELAY : Failed to relay a message because [chars]
```

Explanation Failed to relay a message. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-MESSAGE RESPONSE : An invalid message response was received because [chars]
```

Explanation An invalid message response was received. This could be due to a software defect or system resource exhaustion.

Ρ

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-MQIPC ADVANCE : Failed to advance MQIPC queue because [chars]
```

Explanation The MQIPC initialization failed.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-MQIPC INITIALIZATION : MQIPC initialization failed because [chars]
```

Explanation MQIPC initialization failed. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-PEER_TABLE : A peer table initialization or maintenance function failed because [chars]
```

Explanation A peer table initialization or maintenance function failed. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%PTPD-0-RESOURSE : Resource allocation failed in [chars] because [chars]
```

Explanation The system is unable to allocate the requested resource.

Recommended Action In most cases, this message is seen as a result of a temporary resource issue. Retry the request for the resource when the system is experiencing lower traffic volumes. If the message persists, reload the router using the reload command.

```
%PTPD-3-CHASFS_OBJECT_DESTROY: Failed to destroy chassis filesystem object [chars] because [chars]
```

Explanation A chassis filesystem object that should have been destroyed was not destroyed.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical

R

support representative.

```
%PTPD-3-CHASFS_PROPERTY_DESTROY : Failed to destroy chassis filesystem proprty [chars]/[chars] because [chars]
```

Explanation A chassis filesystem property that should have been destroyed was not destroyed.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

R

RP_MLP

```
%RP MLP-3-CFG FAILED : Config send to IM failed reason([dec])
```

Explanation Configuration send to IM failed

Recommended Action None

```
%RP_MLP-3-INCOMPATIBLELINK : The current config cannot be supported as link([chars])
[chars] for bundle ([chars])
```

Explanation When using multilink 1) All the links should be from the same port. 2) Non-channelized T3 interfaces are not supported on multilink 3) Link added should be compatible with the existing links in the bundle Refer to product documentaion for restrictions

Recommended Action Please modify the config as not to violate the restrictions

```
%RP_MLP-3-UNSUPPORTEDCONFIG : The current config cannot be supported as [chars] for [chars]
```

Explanation When using multilink 1) The maximum number of links in the bundle and number of bundles should not exceed max permisible by device 2) Link added should be compatible with the existing links in the bundle Refer to product documentaion for restrictions

Recommended Action Please modify the config as not to violate the restrictions

```
%RP_MLP-4-BADLINKDECONFIG : Bad way of removing member link, now perform 'no shut'
on both sides of Multilink
```

Explanation If member link has to be removed from multilink bundle, first remove the multilink configuration from the member link and then perform no channel-group command on the controller.

Recommended Action If the member link is removed from the multilink bundle using no channel-group command, perform no shut on both sides of the multilink interface to make it work.

```
%RP MLP-5-LINKTYPEMISMATCH : Link([chars]) cannot be added to Bundle([chars])
```

Explanation Link speed mismatch with other member links of the bundle.

Recommended Action None

```
%RP MLP-5-SLOTMISMATCH : Link([chars]) cannot be added to Bundle([chars]) as [chars]
```

Explanation Link should be on same slot as other member links of Bundle.

Recommended Action None

```
%RP MLP-5-SPAWARNING : could not add link for bundle [chars] as [chars]
```

Explanation A link was added to the bundle, but it is not on the same bay as other member links of the bundle.

Recommended Action Ensure that, when a link is added to a bundle, that it is on the same bay as the other member links of the bundle, in order to have the MLP

```
%RP_MLP-6-BAYMISMATCH : Bay number in message ([dec]) received ([chars]) greater
than max number [dec]
```

Explanation Bay number in the message received exceeded max number of bays

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

S

SBC_MPS

```
%SBC MPS-3-ENQUEFAIL : Enqueue of TDL message failed ([chars]).
```

Explanation An unexpected condition has occurred which resulted in configuration or event details not being forwarded.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SBC MPS-3-INITFAIL : SBC module initialisation failure: [chars].
```

Explanation An unexpected condition has occurred which resulted in the module being unable to initialise.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SBC MPS-3-INTERNAL : An internal IOSd SBC error has been encountered[chars].
```

Explanation An internal error has been encountered.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SBC MPS-3-MAX RESOURCES : The maximum resource limit has been reached.
```

Explanation The system was asked to allocate more resources, but the maximum resource limit had already been reached

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SBC_MPS-3-UNEXPECTED_TIMOUT : An unexpected timeout has been encountered by SBC ([chars]).
```

Explanation A timeout was experienced by the IOSd SBC subsystem, but no such timeout should have occurred. The system will ignore the timeout and continue operating.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SBC MPS-4-MPF CAPABILITIES : SBC MPF Capabilities handling failure.
```

Explanation SBC has been unable to properly prepare a Media Packet Forwarding capabilities message. SBC may not be able to support select functionality such as transcoding or SRTP.

```
%SBC MPS-4-MPF SRTP CAPABILITIES : Unable to set SRTP capabilities
```

Explanation SBC made an attempt to set the platform capabilities with respect to its handling of SRTP streams and was not successful. SRTP streams will not be handled through the SBC.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SBC_MPS-4-NEW_MPF_CAPABILITIES : New SBC MPF Capabilities handling failure.
```

Explanation SBC has received a new set of Media Packet Forwarding capabilities from the associated Forwarding Processor that are inconsistent with those already in use. SBC was unable to process these new capabilities online, and will automatically restart.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SBC_MPS-4-TRANSCODE_MPF_CAPABILITIES : Transcoding SBC MPF Capabilities handling failure.
```

Explanation SBC has been unable to prepare a transcoding supported Media Packet Forwarding capabilities message. SBC will not be able to support transcoding functionality.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SBC_MPS-4-UNEXPECTED_PKT : An unexpected packet for call [dec] has been received by SBC.
```

Explanation A packet been received by SBC for the noted call, but the call was not in a correct state to handle it. The system will ignore the packet and continue operating.

```
%SBC MPS-6-DEACTIVATE NO RSP : SBC deactivate response is considered lost.
```

Explanation The response for SBC deactivate can get lost due to FP startup or switchover while deactivation is in progress.

Recommended Action SBC can be activated now if needed.

```
%SBC MPS-6-DEACTIVATE RESPONSE : SBC deactivate is complete.
```

Explanation SBC deactivation can take a while. This happens when SBC deactivation is done in the presence of a lot calls with deactivation-mode set to abort. SBC deactivate is now complete.

Recommended Action SBC can be safely activated now if needed.

```
%SBC_MPS-6-UNEXPECTED_TDL : An unexpected message ([chars]) has been received by SBC while in the [chars] state.
```

Explanation An internal message has been received by SBC, but it was not expecting that message at that particular time. The system will ignore the message and continue operation.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

SBC_SPF

```
%SBC SPF-3-ENQUEFAIL : Enqueue of TDL message failed ([chars]).
```

Explanation An unexpected condition has occurred which resulted in configuration or event details not being forwarded.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SBC SPF-3-INTERNAL : An internal IOSd SBC error has been encountered[chars].
```

Explanation An internal error has been encountered.

```
%SBC_SPF-3-NOT_FOUND : An unsolicited message has been received by SBC ([chars]
[int])
```

Explanation An internal message has been received by SBC, but it was not expecting that message at that particular time. The system will ignore the message and continue operation.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

SERVICES

```
%SERVICES-0-INVALID_OWNERSHIP : Error using service handle [IPV6 address] -invalid
ownership ([IPV6 address], [IPV6 address])
```

Explanation A multi-thread application is trying to incorrectly use the services library. Applications must follow thread confinement strategy with the services library. Each thread of the application must initialize private managed context of the service library.

Recommended Action Copy the error message, tracebacks and version information and contact a Cisco representative.

```
%SERVICES-2-NOINIT : Error initializing services: [chars]
```

Explanation An application failed to initialize the core services library. The application will not be able to communicate with other modules on the system.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SERVICES-2-NORESOLVE ACTIVE : Error resolving active FRU: [chars]
```

Explanation An application was not able to determine the active FRU. The application was likely started incorrectly.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SERVICES-2-NORESOLVE LOCAL : Error resolving local FRU: [chars]
```

Explanation An application was not able to determine its local FRU. The application was likely started incorrectly.

representative and provide the representative with the gathered information.

```
%SERVICES-2-NORESOLVE STANDBY : Error resolving standby FRU: [chars]
```

Explanation An application was not able to determine the standby FRU. The application was likely started incorrectly.

Recommended Action If this message recurs, copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SERVICES-3-INVALID CHASFS : Thread [IPV6 address] has no global chasfs context
```

Explanation A multi-thread application is trying to incorrectly use the services library. Applications must follow thread confinement strategy with the services library. Each thread of the application must initialize private managed context of the service library.

Recommended Action Copy the error message, tracebacks and version information and contact a Cisco representative.

SMAN

```
%SMAN-2-NO MEMORY: Cannot allocate memory for an internal data structure
```

Explanation An out-of-memory condition occurred when attempting to create an internal data structure. The daemon encountering the problem will exit, after which the process manager will restart.

Recommended Action Check the log files for the associated daemon. Monitor processes for excessive memory consumption.

```
%SMAN-2-TDL_MESSAGE : Cannot construct an IPC message for library. The message name is [chars] and the reason is: [chars]
```

Explanation A problem occurred while constructing a type definition language (TDL) message or setting a field in a TDL message. If the problem occurred during construction of a TDL message, the system is out of memory. If the problem occurred while setting a field in the TDL message, there is a library mismatch issue.

Recommended Action Check [uipeer] ERR entries in the log files for message reporting problems.

```
%SMAN-3-HOSTINFO_MONITOR_FAILURE : Error initializing host info monitoring: [chars]
```

Explanation During initialization, the Shell Manager monitors changes to host-related information, such as the hostname. This error occurs if initialization fails.

Recommended Action Check the Shell Manager trace file for related details.

```
%SMAN-3-HOSTINFO READ FAILURE : Error reading host info ([chars]): [chars]
```

Explanation During process startup and when changes occur, the Shell Manager reads host-related information, such as the hostname. This error occurs if there is a failure reading information.

Recommended Action Check the Shell Manager trace file for related details.

```
%SMAN-3-INVALID_EPOCH_FILE: An upgrade or installation has produced an invalid messaging configuration file [chars], [chars]
```

Explanation During an upgrade or installation of a new package, an invalid messaging configuration file was produced. The file is either empty or has invalid permissions and cannot be read.

Recommended Action Repeat the installation or upgrade. If the problem persists, revert to a previous known good package.

```
%SMAN-3-NO CDL FILE : Could not access command definition file [chars]: [chars]
```

Explanation During initialization, the Shell Manager loads a XML CDL file to load all the CLI structure. This file is for some reason not found.

Recommended Action Check the Shell Manager trace file for related details.

```
%SMAN-3-PTL_RENDERER_FAILURE : Rendering error with [chars].[chars]. Transform is missing or invalid for data.
```

Explanation The Shell Manager process attempted to render a command response but the transformation failed due to an internal error. The failure may have been caused by a missing transform file or an included file cannot be found. The transformation may also fail if the data returned in the response is binary and has not been processed correctly. In this case, the rendering engine is unable to interpret the data resulting in a failure. The transformation may also fail if there is a mismatch of packages installed on the system. In this case, incompatible messages are exchanged between the Shell Manager and the daemon servicing the command request and incorrect data is passed to the rendering engine.

Recommended Action This error indicates a configuration issue resulting from bad or mismatched packages. Review the Shell Manager trace files and log files. Uninstall, then reinstall, any new packages.

SMANRP

```
%SMANRP-3-BADREPLYJOBID : Incorrect command reply job id [int] (origin [chars]), expecting [int]
```

Explanation A command reply message from the Shell Manager referenced the wrong originating job id

```
%SMANRP-3-CMDBUILD : Interactive command directive [dec] of [dec] failed
```

Explanation In processing a CLI command, one of the instructions returned through the Shell Manager could not be turned into an interactive command for remote execution.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-CMDCONNECT : Connection to local interactive relay failed: [chars]
```

Explanation Connecting to the local relay for an interactive command failed due to the reason indicated in the error message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-CMDSEND : Send interactive command to relay failed: [chars]
```

Explanation Sending the interactive command string to the local relay after the connection was established failed by the reason indicated in the error message.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-CMDTOOLONG : Interactive command too long
```

Explanation Instructions for command execution would result in creation of a command string that is beyond the maximum size.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

%SMANRP-3-INVALIDCONNHANDLE : Invalid connection handle [int] referenced during command execution.

Explanation The execution of a CLI command, which must communicate with Shell Manager for command execution, has referenced a connection handle that is invalid. The CLI command execution will have failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance

Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-MSGBIPCBUFFER : Unable to acquire a BIPC buffer for sending messages.
```

Explanation A message was to be sent by IOS, but no BIPC buffer was available. The message to be sent has been discarded and the associated operation failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-MSGBIPCCONNERR: Unable to register with the BIPC subsystem for connections to Shell Manager
```

Explanation IOS Shell Manager client code could not register with the BIPC communications infrastructure in order to establish a connection with the Shell Manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-MSGBIPCERR : Unable to process received BIPC messages from Shell Manager, error: [chars]
```

Explanation An unexpected condition has occurred while IOS trying to process a received BIPC message from Shell Manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-MSGBUILDERROR : Error [dec] building TDL message '[chars]' to send to the Shell Manager: [chars]
```

Explanation An unexpected condition has occurred while IOS is building a TDL message to send to the Shell Manager

```
%SMANRP-3-MSGDISPATCH : Unable to dispatch received TDL message '[chars]' from Shell Manager. LUID: [chars]
```

Explanation An unexpected condition has occurred while IOS is trying to dispatch to the TDL message handler functions for received TDL messages from Shell Manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-MSGDISPATCHNULL : Received NULL TDL message
```

Explanation An unexpected condition in which IOS has received a NULL TDL message from Shell Manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
SMANRP-3-MSGENQUEUEERROR : Error queueing TDL message '[chars]' to send to the Shell Manager
```

Explanation An unexpected condition has occurred when IOS attempted to queue a TDL message to send to the Shell Manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-MSGERROR : Error [dec] handling a received TDL message '[chars]' from the Shell Manager: [chars]
```

Explanation An unexpected condition has occurred while IOS is processing a TDL message received from the Shell Manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-MSGINVALIDFIELDINT : Invalid field '[chars]' in TDL message '[chars]' received: value '[int]' from the Shell Manager
```

Explanation A message with an invalid field value was received from the Shell Manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-MSGINVALIDFIELDSTR : Invalid field '[chars]' value '[chars]' in TDL message '[chars]' received from the Shell Manager
```

Explanation A message with an invalid field value was received from the Shell Manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
SMANRP-3-MSGMARSHALERROR: Error '[dec]' marshaling TDL message '[chars]' to send to the Shell Manager
```

Explanation An unexpected condition has occurred while IOS is marshaling TDL message to send to the Shell Manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
SMANRP-3-MSGMISSINGFIELD : Missing field '[chars]' in TDL message '[chars]' received from the Shell Manager
```

Explanation A message missing a required field was received from the Shell Manager

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-SET ACCESS FAIL : Installing LIIN interface access control failed
```

Explanation This error happens when the Shell Manager shim failed to set the access control function for the LIIN, possibly due to IOS out of memory or corruption. Interactive commands will not work.

```
%SMANRP-3-SMAN_HANDLER_QUEUE_NOTEMPTY : Dynamic command handler exited foreground process with non-empty queue
```

Explanation The dynamic command handler which dispatches commands to the shell manager, has exited without proper cleanup.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-SMAN_INIT_CONN_FAIL : Shell Manager client connection pool initialization failed: Unable to request creation of [int] of [int] connections.
```

Explanation The Shell Manager client has failed to create all of its connections to Shell Manager. Ability to execute some CLI commands will be severely restricted or non-existent.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-SMAN_INIT_DC_TDL_FAIL : Shell Manager client initialization failed: Unable to initialize messaging: [chars]
```

Explanation The Shell Manager client has failed to initialize the infrastructure for messaging with the Shell Manager. Ability to execute some CLI commands will be severely restricted or non-existent.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-3-SMAN_INIT_WQ_FAIL : Shell Manager client connection handler initialization failed: Unable to create [int] of [int] receiving queues.
```

Explanation The Shell Manager client has failed to create all of its receiving queues. Ability to execute some CLI commands will be severely restricted or non-existent.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%SMANRP-6-SMSTATUS : Shell Manager is [chars]
```

Explanation The current status of Shell Manager.

Recommended Action No action is required.

SPA_OIR_STATE_CHANGE

 $SPA_OIR_STATE_CHANGE-2-OOS_AUMA_MEA_MT$: SPA N/A in subslot 0/[dec] state transitioned to [chars].

Explanation The state transitioned to out of service autonomous management - mismatch and maintenance, because the entity has been manually removed from service for a maintenance activity. Also, the card may be inserted in the wrong slot.

Recommended Action No action is required.

```
%SPA_OIR_STATE_CHANGE-2-OOS_AUMA_UAS_MEA : SPA [chars] in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state transitioned to out of service autonomous management - unassigned and mismatch; because the entity had been manually inserted into wrong bay and/or the card is not provisioned in the database.

Recommended Action No action is required.

```
%SPA_OIR_STATE_CHANGE-2-OOS_AU_MEA : SPA [chars] in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state transitioned to out of service autonomous and mismatch. An improper equipment is provisioned or inserted in the bay.

Recommended Action No action is required.

```
%SPA_OIR_STATE_CHANGE-6-EMPTY: SPA [chars] in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state is in empty since the subslot is neither provisioned, nor is it phsically populated with any interface module.

Recommended Action No action is required.

```
SPA_OIR_STATE_CHANGE-6-IS_NR: SPA [chars] in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state transitioned to in-service and normal. It is fully operational and shall provide provisioned functions.

Recommended Action No action is required.

```
SPA_OIR_STATE_CHANGE-6-OOS_AU_FLT : SPA [chars] in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state transitioned to out of service autonomous - fault condition.

Recommended Action No action is required.

```
SPA_OIR_STATE\_CHANGE-6-OOS\_AUMA\_FLT\_MT : SPA [chars] in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state transitioned to out of service autonomous management - unequipped and unassigned, because the card is neither physically present nor provisioned in the database.

Recommended Action No action is required.

```
SPA_OIR_STATE_CHANGE-6-OOS_AUMA_SWDL_MT: SPA [chars] in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state transitioned to out of service autonomous - software download and maintenance. The entity had been manually removed from for a maintenance activity.

Recommended Action No action is required.

```
SPA_OIR_STATE_CHANGE-6-OOS_AUMA_UAS : SPA [chars] in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state transitioned to out of service autonomous management - unassigned, because the card is not provisioned in the database.

Recommended Action No action is required.

```
SPA_OIR_STATE\_CHANGE-6-OOS\_AUMA\_UEQ\_MT : SPA [chars] in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state transitioned to out of service autonomous - unequipped and maintenance. The card is not physically present. The entity has been manually removed from service for a maintenance activity.

Recommended Action No action is required.

```
%SPA_OIR_STATE_CHANGE-6-OOS_AU_SWDL : SPA [chars] in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state transitioned to out of service autonomous and software download.

Recommended Action No action is required.

```
%SPA_OIR_STATE_CHANGE-6-OOS_AU_UEQ : SPA N/A in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state transitioned to out of service autonomous because the card is not physically present.

Recommended Action No action is required.

```
%SPA_OIR_STATE_CHANGE-6-OOS_MA_MT : SPA [chars] in subslot 0/[dec] state transitioned to [chars].
```

Explanation The state transitioned to out of service management. The entity had been manually removed from service for a maintenance activity but still performs its provisioned functions.

Recommended Action No action is required.

SSFPD

```
%SSFPD-0-MESSAGE RESPONSE : An invalid message response was received because [chars]
```

Explanation An invalid message response was received. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD-0-PEER_TABLE : A peer table initialization or maintenance function failed be-
cause [chars]
```

Explanation A peer table initialization or maintenance function failed. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

SSFPD_INFRA

```
%SSFPD_INFRA-0-CHASFS_OBJECT_CREATE : Failed to create chassis filesystem object [chars] because [chars]
```

Explanation The hardware failed to create a chassis filesystem object.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD_INFRA-0-CHASFS_OBJECT_NOT_PRESENT : Expected chassis filesystem object [chars] not present.
```

Explanation A chassis filesystem object expected to be present is not. This could be due to a software defect or filesystem failure.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD_INFRA-0-CHASFS_OBJECT_WATCH : Failed to watch chassis filesystem object [chars] because [chars]
```

Explanation A chassis filesystem object was not watched because of the reason stated in the error message.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD_INFRA-0-CHASFS_PROPERTY_CREATE : Failed to create chassis filesystem object [chars] property [chars] because [chars]
```

Explanation A chassis filesystem property was not properly created.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD_INFRA-0-CHASFS_PROPERTY_GET : Failed to read chassis filesystem object
[chars] property [chars] because [chars]
```

Explanation A chassis filesystem property was not properly read by the system.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD_INFRA-0-CHASFS_PROPERTY_NOT_PRESENT : Expected chassis filesystem object [chars] property [chars] not present.
```

Explanation A chassis filesystem object property expected to be present is not. This could be due to a software defect or filesystem failure.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD_INFRA-0-CHASFS_PROPERTY_SET : Failed to write chassis filesystem object [chars] property [chars] because [chars]
```

Explanation A chassis filesystem property failed to write.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

%SSFPD_INFRA-0-EVENT_LIBRARY: An event facility initialization or maintenance function failed because [chars]

Explanation An event facility initialization or maintenance function failed. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD INFRA-0-IPC CONNECTION INVALID : An IPC connection has invalid state.
```

Explanation An IPC connection has an invalid state. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD_INFRA-0-IPC_CONNECT_MASTER : IPC connection to the active RSP failed because [chars]
```

Explanation IPC connection to the active RSP failed. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD INFRA-0-IPC INITIALIZATION : IPC initialization failed because [chars]
```

Explanation IPC initialization failed. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD INFRA-0-MESSAGE REGISTER : Failed to register with active RSP because [chars]
```

Explanation The active RSP failed to register.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
$SSFPD INFRA-0-MESSAGE RELAY: Failed to relay a message because [chars]
```

Explanation Failed to relay a message. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD_INFRA-0-MESSAGE_RESPONSE : An invalid message response was received because [chars]
```

Explanation An invalid message response was received. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD INFRA-0-MQIPC ADVANCE : Failed to advance MQIPC queue because [chars]
```

Explanation The MQIPC initialization failed.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD INFRA-0-MQIPC INITIALIZATION : MQIPC initialization failed because [chars]
```

Explanation MQIPC initialization failed. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD_INFRA-0-PEER_TABLE : A peer table initialization or maintenance function
failed because [chars]
```

Explanation A peer table initialization or maintenance function failed. This could be due to a software defect or system resource exhaustion.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the

error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD INFRA-0-RESOURSE: Resource allocation failed in [chars] because [chars]
```

Explanation The system is unable to allocate the requested resource.

Recommended Action In most cases, this message is seen as a result of a temporary resource issue. Retry the request for the resource when the system is experiencing lower traffic volumes. If the message persists, reload the router using the reload command.

```
%SSFPD_INFRA-3-CHASFS_OBJECT_DESTROY: Failed to destroy chassis filesystem object [chars] because [chars]
```

Explanation A chassis filesystem object that should have been destroyed was not destroyed.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.

```
%SSFPD_INFRA-3-CHASFS_PROPERTY_DESTROY : Failed to destroy chassis filesystem pro-
prty [chars]/[chars] because [chars]
```

Explanation A chassis filesystem property that should have been destroyed was not destroyed.

Recommended Action In most cases, the problem can be corrected by reloading the impacted hardware using the hwmodule [slot | subslot] slot-number reload command. If the reload fails to correct the problem, collect the output of the error message, the logs, and the output of show tech-support and provide the gathered information to a Cisco technical support representative.



UDEV

```
%UDEV-3-UDEVPERMS: An invalid permissions value, [chars], was found in a udev file
```

Explanation The udev files for a particular filesystem contain a description the file system. If the permissions attribute is not recognized then this file system may run with incorrect permissions.

Recommended Action No action is required.

UEA MGR URPF

```
%UEA_MGR_URPF-3-URPF_PREFIX_EXHAUSTED : uRPF IPv4 address TCAM lookup space exhausted. Maxium number of uRPF prefixes allowed on RSP3 platform is [dec]
```

Explanation A software error has occurred

Recommended Action The global IPv4 uRPF prefix TCAM lookup space (across all VRFs) has been exhausted. IPv4 forwarding & uRPF functionality will be degraded. Please revisit router configuration to limit the number of IPv4 prefixes in uRPF enabled VRFs

```
%UEA_MGR_URPF-3-URPF_VRF_OVERRIDE : Per-VRF uRPF overridden for vrf:[dec]. Allowed
mode for this vrf is [chars]
```

Explanation A software error has occurred

Recommended Action uRPF mode is per-VRF, hence we can't have two different mode (strict and loose) at once in the same VRF. The new mode configured conflicts with the earlier mode and user will have to change it to allowed mode for uRPF to take effect on the interface.

UEA_RLDRAM

```
%UEA_RLDRAM-3-NILE_ACCESS_RD : A memory read called from
[hex]:[hex]:[hex]:[hex]
```

Explanation An attempt was made to read memory beyond the boundary limit. This error could be caused by software defect.

Recommended Action Examine the logs for RLDRAM read offset

```
%UEA_RLDRAM-3-NILE_ACCESS_WR : A memory read called from
[hex]:[hex]:[hex]:[hex]
```

Explanation An attempt was made to read memory beyond the boundary limit. This error could be caused by software defect.

Recommended Action Examine the logs for RLDRAM read offset

```
%UEA_RLDRAM-3-RLDRAM_READ : A memory read attempted beyond the boundary limit: off-
set = [hex]. Allowed offset = [hex]
```

Explanation An attempt was made to read memory beyond the boundary limit. This error could be caused by software defect.

Recommended Action Examine the logs for RLDRAM read offset

```
%UEA_RLDRAM-3-RLDRAM_WRITE : A memory write attempted beyond the boundary limit:
offset = [hex]. Allowed offset = [hex]
```

Explanation An attempt was made to read memory beyond the boundary limit. This error could be caused by software defect.

Recommended Action Examine the logs for RLDRAM read offset

UEA_TCAM

%UEA_TCAM-3-TCAM_ACL_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_ACL_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than [dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_EQOS_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_EQOS_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than [dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_EVLAN_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_EVLAN_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_IPV4_TUNNEL_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%*threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_IPV4_TUNNEL_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less
than [dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_IPV6_ACL_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_IPV6_ACL_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less
than [dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_IVLAN_THRESHOLD : TCAM-above-threshold: TCAM usage more than [dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_IVLAN_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_MCASTV4_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_MCASTV4_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than [dec]%*threshold set for app [chars]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_MCASTV6_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_MCASTV6_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less
than [dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_QOS_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_QOS_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less than
[dec]%%threshold set for app [chars], asic id [dec]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_UCASTV4_THRESHOLD : TCAM-above-threshold: TCAM usage more than [dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_UCASTV4_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less
than [dec]%*threshold set for app [chars]

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

%UEA_TCAM-3-TCAM_UCASTV6_THRESHOLD : TCAM-above-threshold: TCAM usage more than
[dec]%%threshold set for app [chars]

Explanation The TCAM usage for the application has become equal/gone beyond the threshold level

Recommended Action Depends on the user

```
%UEA_TCAM-3-TCAM_UCASTV6_THRESHOLD_UNDER : TCAM-below-threshold: TCAM usage less
than [dec]%%threshold set for app [chars]
```

Explanation The TCAM usage for the application has become less than the threshold level

Recommended Action Depends on the user

UIPEER

```
\mbox{\ensuremath{\mbox{WUIPEER-2-TDL\_MESSAGE}}} : Cannot construct an IPC message for library. The message name is [chars] and the reason is: [chars]
```

Explanation A problem occurred while constructing a type definition language (TDL) message or setting a field in a TDL message. If the problem occurred during construction of a TDL message, then the system is out of memory. If the problem occurred while setting a field in the TDL message, there is a library mismatch issue.

Recommended Action Check [uipeer] ERR entries in the log files for message reporting problems.

```
%UIPEER-3-INVALID_DEBUG_MESSAGE: The peer process was unable to process an incoming message for 'debug all' from the shell-manager
```

Explanation When the 'debug all' command is issued, the Shell Manager broadcasts a notification of the command request to its peers. If the notification message has been corrupted or incorrectly created, the peers cannot complete the requested operation.

Recommended Action Check the trace files for the Shell Manager failed process. Restart the system.

```
%UIPEER-3-INVALID_EPOCH_MESSAGE: The peer process was unable to process an incoming epoch update message from the shell-manager
```

Explanation For each new type definition language (TDL) epoch, the Shell Manager broadcasts a change notification message to its peers. If the Shell Manager's message is incorrect or corrupt, the peers are unable to identify the new epoch. In this case, the peers reject the proposed epoch.

Recommended Action Check the trace files for the Shell Manager failed process. Check or undo any recently installed packages, then restart the system.

```
%UIPEER-3-INVALID_HOSTINFO_MESSAGE : The peer process was unable to process an in-
coming message for host info from the shell-manager
```

Explanation When host information, such as the hostname, changes, the Shell Manager broadcasts a notification of the change to its peers. If the notification message has been corrupted or incorrectly created, the peers cannot complete the requested operation.

Recommended Action Check the trace files for the Shell Manager failed process. Restart the system.

```
%UIPEER-3-NO PEER: A process was unable to retrieve a shell-manager peer handle.
```

V

Explanation A process was attempting to communicate with the Shell Manager daemon using the integrated [uipeer] component. The error occurred because the peer instance could not be found.

Recommended Action Check [uipeer] ERR entries in the log files for message reporting problems.

```
%UIPEER-5-TIMER ACCURACY TEST : Timer Accuracy Test [chars].
```

Explanation Test result of Timer Accuracy Test

Recommended Action No action is required. This is informational message



VIRT_SERVICE

```
%VIRT_SERVICE-3-ACTIVATE_FAIL : Failed to send virtual service [chars] activate mes-
sage
```

Explanation During the creation and transmission of the virtual service activate TDL message a failure occurred. The message was not successfully sent and therefore the virtual service was not activated.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-3-DEACTIVATE_FAIL : Failed to send virtual service [chars] deactivate message
```

Explanation During the creation and transmission of the virtual service deactivate TDL message a failure occurred. The message was not successfully sent and therefore the virtual service was not deactivated.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-3-INIT_FAIL : Failed to initialize required virtual service object:
[chars]
```

Explanation During the initialization of the resources required for the virtual service feature, a memory allocation failure occurred. This has prevented the virtual service feature from being enabled.

representative with the gathered information.

```
%VIRT_SERVICE-3-INVALID_APPLIANCE_TIMEOUT : A response timeout occurred for an inva-
lid virtual service
```

Explanation An unexpected condition occurred where the virtual service context pointer in the expired timer was set to

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-3-INVALID_RF_MSG : Received an invalid RF message type from peer
```

Explanation An unexpected condition occurred where an invalid message type was detected.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT SERVICE-3-PKG PATH: Failed to [chars] required by virtual service [chars]
```

Explanation Specified package definition file was not found following a switchover.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-3-PKG_PATH_ACTIVATE : Failed to [chars]. Virtual service [chars] will not be activated
```

Explanation Specified package definition file was not found following a switchover. Unable to activate virtual service without specified package definition file present.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT SERVICE-3-RESET : Virtual service [chars] reset
```

Explanation An unexpected condition has occurred where Virt-manager has reported that it detected the named virtual service reset. This virtual service is not configured to be activated and as such, no attempt to reactivate it will be made.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-3-RESPONSE_TIMEOUT : Virtual service [chars] timed out waiting for a
response from Virt-manager
```

Explanation Failed to receive a response message from Virt-manager for last activation operation performed on the named virtual service. The virtual service activation state was marked as deactivated.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-3-ROMMON_UNSUPPORTED : ROM monitor configuration does not support vir-
tualization
```

Explanation Virtualization is not supported by the current ROM monitor configuration. Verify both the ROM monitor version and ROM monitor variable ENABLE_VTX are correct to enable virtualization.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT SERVICE-3-SEND RF MSG : Failed to send RF message to peer -[chars]
```

Explanation An unexpected condition occurred where an attempt to send an RF message to peer failed.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-3-STBY_PKG_PATH : Failed to [chars] required by virtual service
[chars] on standby
```

Explanation Specified package definition file was not found on standby. Configuration was accepted. Copy package definition file to standby at earliest convenience.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the

representative with the gathered information.

```
%VIRT_SERVICE-3-STBY_ROMMON_UNSUPPORTED : Standby ROM monitor configuration does not support virtualization
```

Explanation Virtualization is not supported by the current ROM monitor configuration on the standby. Verify both the ROM monitor version and ROM monitor variable ENABLE_VTX are correct to enable virtualization.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-3-UNKNOWN_APPLIANCE_TIMEOUT : A response timeout occurred for unknown
virtual service [chars]
```

Explanation A response timeout occurred for a virtual service that is no longer in the virtual service database.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-3-UNKNOWN_RF_MSG : Received an unknown RF message type ([dec]) from peer
```

Explanation An unexpected condition occurred where an unknown timer event was detected.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-3-UNKNOWN_TIMEOUT_TYPE : A response timeout occurred for an unknown timeout type ([dec])
```

Explanation An unexpected condition occurred where an unknown timeout type was detected.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-3-UNKNOWN_TIMER_EVENT : A timer event occurred for an unknown timer
event ([dec])
```

Explanation An unexpected condition occurred where an unknown timer event was detected.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT SERVICE-3-UNPROVISION FAIL : [chars]: [chars]
```

Explanation During the unprovision of the named virtual service, an unexpected failure occurred.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-4-SWITCHOVER_ACTIVATE : Virtual service [chars] will not be activated
following a switchover
```

Explanation Following a switchover, this virtual service will not be activated as there is an issue with its package definition file. Copy package definition file to standby at earliest convenience.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT SERVICE-5-ACTIVATION STATE : [chars] [chars]
```

Explanation The activation state of the named virtual service has changed as notified by Virt-manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT SERVICE-5-INSTALL STATE : [chars] [chars]
```

Explanation The installation state of the named virtual service has changed as notified by Virt-manager.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

```
%VIRT_SERVICE-5-RESET_REACTIVATE : Virtual service [chars] reset and will be reac-
tivated
```

Explanation Virt-manager has reported that it detected the named virtual service reset. An attempt will be name to reactivate this virtual service.

Recommended Action Copy the error message exactly as it appears on the console or in the system log. Research and attempt to resolve the error using the tools at https://cway.cisco.com/go/sa/. Also perform a search using the Bug Search Tool: https://bst.cloudapps.cisco.com/bugsearch/. If you still require assistance, open a case with the Technical Assistance Center: https://mycase.cloudapps.cisco.com/start, or contact your Cisco technical support representative and provide the representative with the gathered information.

VMAN

```
%VMAN-2-ACTIVATION STATE : [chars] '[chars]' [chars] [chars]
```

Explanation The activation state of the named virtual service has changed as notified by Virt-manager.

Recommended Action In the failed case, check Virt-manager's logs for the cause of the failure. In the successful case, this notification can be ignored.

```
%VMAN-2-ALLOC VIRT INST RCS : Virtual Service[chars]
```

Explanation A memory allocation request failed to allocate a data structure required to activate the virtual service.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-COMMIT VIRT INST RCS : Virtual Service[chars]
```

Explanation The request to commit the resources required by the named virtual service failed.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-CPUSHARES LIMIT : Virtual Service[chars]
```

Explanation The virtual service machine definition file is requesting more CPU shares than the system has available for virtual services.

Recommended Action Deactivate any other virtual services to free up CPU share resources and activate this virtual service. If that does not address the problem, then enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-CPUTUNES INTERNAL ERROR : Virtual Service[chars]
```

Explanation Virt-manager and its associated infrastructure experienced an internal error.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-CPUTUNES SHARES LIMIT : Virtual Service[chars]
```

Explanation The virtual service machine definition file is requesting more CPU shares than the system has available for virtual services.

Recommended Action Deactivate any other virtual services to free up CPU share resources and activate this virtual service. If that does not address the problem, then enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-CREATE_VIRT_INST_ENTRY : Virtual Service[chars]
```

Explanation The request to create a DB entry for the named virtual service failed.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-DEACT_FOR_ISSU : [chars] Max ([int]s)
```

Explanation An ISSU event is pending. Any active VMs will be automatically deactivated to allow ISSU preprocessing to validate the environment. Any ISSU-deactivated VMs will be automatically restarted if the ISSU is cancelled.

Recommended Action None. Allow the ISSU to continue and the VMs will restart when the ISSU completes or cancel the ISSU and vman will automatically

```
%VMAN-2-DEFER VIRT INST PROC : Virtual Service[chars]
```

Explanation The final activation processing failed to successfully defer.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-DISK IMAGE PATH : Virtual Service[chars]
```

Explanation The virtual service machine definition file contains an invalid disk image path for one of the disk devices. This may be a Harddisk, CDROM or USB storage device.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-FIND_VIRT_INST_ENTRY : Failed to find virtual service with id [int] in the Virt-manager DB
```

Explanation The virtual service with the ID named could not be located in the Virt-manager DB.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-GENERAL FAILURE : Virtual Service[chars]
```

Explanation The named virtual service has triggered the log. Please interpret the log in the context of the virtual services.

Recommended Action No action is required

```
%VMAN-2-GUESTSHELL_ENABLED: The guest shell has been enabled. The command '[chars]' may be used to access it, '[chars] destroy' to remove it.
```

Explanation Informs the user that the guest shell virtual service has been enabled (which is done by default).

Recommended Action The user may use or remove the guest shell with the commands specified.

```
%VMAN-2-HA STATE : [chars] [chars] [chars]
```

Explanation VMAN tries to detect the role/slot of various nodes on HA events from the platform. If any of those event callbacks fail, this notification would be raised.

Recommended Action In the failed case, check Virt-manager's logs for the cause of the failure. Check for the HA event error msg and root cause the same.

```
%VMAN-2-HA SWITCHOVER STATE : [chars] [chars] [chars] [chars]
```

Explanation VMAN HA switchover state related messages for a virtual-service whilst it is being recovered on newly active RP after a HA switchover.

Recommended Action In the failed case, check Virt-manager's logs for the cause of the failure. Check for the HA event error msg and root cause the same.

```
%VMAN-2-HA SYNC ERR : [chars] '[chars]' [chars]
```

Explanation The ha-sync persistent storage disk for the virtual service cannot be watched for sync to standby RP.

Recommended Action Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-HA_SYNC_THREAD_STATE : HA remote sychronize thread has failed and exited.
```

Explanation VMAN tries to remote sync the OVA repository to all online nodes using a separate thread. If that thread fails, this notification would be raised.

Recommended Action In the failed case, check Virt-manager's logs for the cause of the failure. Check for the pthread error msg and root cause the same.

```
%VMAN-2-INCONSISTENT CPUTUNES CONFIG : Virtual Service[chars]
```

Explanation The virtual service machine definition file is requesting invalid CPU tunes parameter.

Recommended Action Use a different valid machine definition file for the virtual service. If the problem persists, then enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and

scan them for the cause.

```
%VMAN-2-INCONSISTENT MEM CONFIG : Virtual Service[chars]
```

Explanation The virtual service machine definition file is inconsistent in the specification of required memory via the <memory> and <currentMemory> nodes.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-INSERT_VIRT_INST_ENTRY : Virtual Service[chars]
```

Explanation Inserting the named virtual service into the virtual service DB tracked by Virt-manager failed.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-INSTALL_FAILURE : Virtual Service[chars]
```

Explanation The installation of the virtual service failed.

Recommended Action Enable the Virt-manager trace logs and repeat the installation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-INSTALL_LOG : [chars] [chars] [chars]
```

Explanation The installation log of the named virtual service, is to provide more information about long running operation, that could affect the control of CLI

Recommended Action No action is required

```
%VMAN-2-INSTALL MEDIA RETRY: VMAN, VM install media still unavailable.[chars]
```

Explanation The install media was not detected. Waiting for udev to complete install media(harddisk) detection.

Recommended Action After VMAN exceeds the maximum retry limit, verify if install media (harddisk) is accessible and retry the installation again.

```
%VMAN-2-INSTALL STATE : [chars] '[chars] '[chars] [chars]
```

Explanation The installation state of the named virtual service has changed as notified by Virt-manager.

Recommended Action In the failed case, check Virt-manager's logs for the cause of the failure. In the successful case, this notification can be ignored.

```
%VMAN-2-INVALID ACT MSG : Virtual Service[chars]
```

Explanation The virtual service activate message was received, however, the data it contained could not be interpreted

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-INVALID DEACT MSG : Failed to process virtual service deactivate message
```

Explanation The virtual service deactivate message was received, however, the data it contained could not be interpreted

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-INVALID PACKAGE : Virtual Service[chars]
```

Explanation The package definition file for the named virtual service has failed to be validated and the virtual service will not run

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause. The most likely cause would be that the package file has been corrupted during file transfer. The suggested action would be to redo the file transfer.

```
%VMAN-2-INVALID UNPROV MSG : Failed to process virtual service unprovision message
```

Explanation The virtual service unprovision message was received, however, the data it contained could not be interpreted

Recommended Action Enable the Virt-manager trace logs and repeat the activation followed by deactivation and then unprovision of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-MACHINE TYPE NOT SUPPORTED : Virtual Service[chars]
```

Explanation The virtual service cannot be activated as the machine type specified is not supported

Recommended Action Enable the support for the machine type and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-MACH PARSE FAILURE : Virtual Service[chars]
```

Explanation The named virtual service has an invalid parameter specified in the .xml file inside the .ova package

Recommended Action Fix the .xml file inside the .ova package to have valid values. Then retry installing and activating it

```
%VMAN-2-MEMORY LIMIT : Virtual Service[chars]
```

Explanation The virtual service machine definition file is requesting more memory than the system has available for virtual services.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

٧

```
%VMAN-2-MEMORY_LIMIT_WARN : Virtual service ([chars])[chars] defines [int] MB of Memory exceeding the maximum [int] MB.
```

Explanation The virtual service machine definition file is requesting more memory for the specified profile, than the system has available for virtual services.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-MORETHANONE_CPUTUNES_CONFIG : Virtual Service[chars]
```

Explanation The virtual service machine definition file is requesting more than one CPU tunes parameter.

Recommended Action Use a different valid machine definition file for the virtual service. If the problem persists, then enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-MOVE STATE : [chars] '[chars]' [chars] [chars]
```

Explanation The move of the core or log file of the named virtual service has as been successful or failed as notified by Virt-manager.

Recommended Action In the failed case, check Virt-manager's logs for the cause of the failure. In the successful case, this notification can be ignored.

```
%VMAN-2-NETWORK CONFIG ERROR : Virtual Service[chars]
```

Explanation A network configuration error has been detected for the named virtual service.

Recommended Action No action is required

```
%VMAN-2-PROCESS PKG DEF : Virtual Service[chars]
```

Explanation The virtual service package for the named virtual service has failed to be validated and the virtual service will not run.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-PROC INT LIST : Virtual Service[chars]
```

Explanation The interface list embedded in the activate request for the named virtual service could not be processed.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-REMOVE VIRT INST ENTRY : Virtual Service[chars]
```

Explanation Removing the named virtual service from the virtual service DB tracked by Virt-manager failed.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-RESET FORCE: Virtual Services non-recoverable reset command processed
```

Explanation A 'virtual service reset force' command has been entered and processed. This action initiates a cleanup of last resort. Occasionally a VM will get into an unrecoverable state that prevents it from activating but also from uninstalling. This is a rare event but when it happens the only resort may be to remove the .conf control file and reboot, which forces a cleanup of all previously installed VM files and artifacts. Note that once this command is used, current VMs are considered to be in an unstable or unpredictable state, and all future install, uninstall, upgrade, and activation commands will be blocked.

Recommended Action Once the command is entered and accepted, there is no recourse but to restart the system.

```
%VMAN-2-RESIZE_OPER_STATE : Virtual service '[chars]' [chars] to '[int]' [chars]
```

Explanation VMAN attempts to resize various VM parameters like rootfs size, CPU share, memory if requested by user. Success/failure status messages for these resize operations are communicated by this syslog.

Recommended Action In the failed case, check Virt-manager's logs for the cause of the failure. Check for the HA event error msg and root cause the same.

```
%VMAN-2-RSYNC STATE : [chars] [chars] [chars]
```

Explanation VMAN tries to remote sync the virtual-instance configuration file and the OVA repository to all online nodes. If rsync fails even after consecutive retries, this notification would be raised.

Recommended Action In the failed case, check Virt-manager's logs for the cause of the failure. Check for the rsync error code and root cause the same.

```
%VMAN-2-SET_VTX_ROMVAR_SPACE : Failed to set ROM monitor variable ENABLE_VTX: No space in table
```

Explanation Failed to set ENABLE_VTX ROM monitor variable due to no space in Monitor Variable Table.

Recommended Action Verify number of entries in Monitor Variable Table.

```
%VMAN-2-SET_VTX_ROMVAR_STRING : Failed to set ROM monitor variable ENABLE_VTX: Inva-lid string format: [chars]
```

Explanation Failed to set ENABLE_VTX rom monitor variable due to invalid string format.

Recommended Action Verify format of string from error message.

```
%VMAN-2-START FAILED : Virtual Service[chars]
```

Explanation The named virtual service failed to start.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-UNINSTALL_ALL_VMS : All Virtual Services are being uninstalled [chars] [chars]
```

Explanation All virtual services are being uninstalled by Virt-manager.

Recommended Action Examine the reason given as to why all virtual services are being uninstalled for more information. If the reason indicated is due to some error condition, check Virt-manager's logs for the cause of the failure.

```
%VMAN-2-UPGRADE LOG: [chars] [chars] [chars]
```

Explanation The upgrade log of the named virtual service, is to provide more information about long running operation, that could affect the control of CLI

Recommended Action No action is required

```
%VMAN-2-VCPU INVALID : Virtual Service[chars]
```

Explanation The virtual service machine definition file is requesting invalid VCPU value.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-VCPU LIMIT : Virtual Service[chars]
```

Explanation The virtual service machine definition file is requesting more VCPUs than the system has reserved for virtual services.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-VIRT INST CRIT : VIRTUAL SERVICE [chars] LOG: [chars]
```

Explanation The named virtual service has triggered the log. Please interpret the log in the context of the virtual services.

Recommended Action No action is required

```
%VMAN-2-VIRT INST DISK : Virtual Service[chars]
```

Explanation The virtual service requires Disk Storage in excess of the Free Disk Storage available to virtual services.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-VIRT INST INTERFACE : Virtual Service[chars]
```

Explanation The number of configured virtual port group interfaces must match the number of Ethernet Network Interfaces defined in the machine definition file

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-VIRT_INST_LOG_UNTHROTTLE : Failed to unthrottle the log for virtual service [chars]
```

Explanation The named virtual service had sent overwhelming sys log messages and its log had been throttled as a result, but system has failed to unthrottle it for some reason.

Recommended Action For debugging collect the virt-manager logs and scan them for the cause.

```
%VMAN-2-VIRT INST MEMORY : Virtual Service[chars]
```

Explanation The virtual service requires physical memory in excess of the free memory available to virtual services.

Recommended Action Enable the Virt-manager trace logs and repeat the activation of the virtual service. Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-2-VIRT_INST_MGMT_INTERFACE : Virtual service [chars] has no management interface defined but it is configured in CLI.
```

Explanation A management interface is configured but none is defined.

Recommended Action Deactivate the virtual service, remove the management interface configuration CLI, and reactivate the virtual-service.

```
%VMAN-2-VIRT INST STATE : Virtual Service[chars]
```

Explanation The named virtual service has failed. It is no longer running either because the guest OS has failed, the guest OS has shut down the machine or the emulator has failed.

Recommended Action An attempt at restarting the virtual service can be made from the IOS configuration by doing a no activate/activate. For debugging collect the Virt-manager logs and scan them for the cause.

```
%VMAN-3-PSS ERR : Purpose: [chars], URI: [chars], errcode: [dec]
```

Explanation Persistent Storage Service handling error

Recommended Action Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-3-PSS_SNAPSHOT_ERR : Source URI: [chars], Destination URI: [chars], errcode: [dec]
```

Explanation Persistent Storage Service snapshot error

Recommended Action Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-3-SDWRAP ERR : Description: [chars], errcode: [dec]
```

Explanation Debug infrastructure error

Recommended Action Collect the Virt-manager logs and scan them for the cause.

```
%VMAN-3-VIRT INST ERR : VIRTUAL SERVICE [chars] LOG: [chars]
```

Explanation The named virtual service has triggered the log. Please interpret the log in the context of the virtual services.

Recommended Action No action is required

```
%VMAN-4-HA_SYNC_NEEDED : If using the guest shell, please use 'guestshell sync' if you want to preserve state on standby in case of supervisor switchover
```

Explanation Message notifying user that he needs to manually synchronize the Virtual service contents to standby supervisor in order to preserve these contents in case of a supervisor switchover. Currently only applicable to the guest shell

Recommended Action User can type the 'guestshell sync' command on active supervisor to synchronize it's contents to the standby supervisor if desired.

```
%VMAN-4-PACKAGE_SIGNING_LEVEL_CHANGED : Package signing level changed from allow '[chars]' to allow '[chars]'
```

Explanation The package certificate signing level global setting has been changed via configuration under the virtual-service global sub-mode.

Recommended Action Ensure that this setting has been changed as expected by an authorized user.

```
%VMAN-4-UPDATE WARNING : Virtual Service[chars]
```

Explanation The named virtual service has triggered the log. Please interpret the log in the context of the virtual services.

Recommended Action No action is required

```
%VMAN-4-VIRT INST WARN : VIRTUAL SERVICE [chars] LOG: [chars]
```

Explanation The named virtual service has triggered the log. Please interpret the log in the context of the virtual services.

Recommended Action No action is required

```
VMAN-4-VIRT\_SERV\_LIBVIRTD\_WARN : VMAN not able to connect to the libvirt daemon after '[dec]' attempts
```

Explanation VMAN has been unable to connect to the libvirt daemon. Virtualization services will not be available until this connection is made.

Recommended Action Collect the logs produced by 'show virt tech'

```
%VMAN-4-WATCHDOG TIMER : [chars] '[chars]' [chars] [chars]
```

Explanation The watchdog timer configured for the named virtual service has expired.

Recommended Action Check any logs produced by the virtual service to determine the cause.

```
%VMAN-5-AUX : Virtual Service[chars]
```

Explanation The AUX login to a virtual service may allow the user access to system functions that may not have been tested or may interact with the system in unintended ways. Use with caution.

Recommended Action No action is required

```
%VMAN-5-PACKAGE_SIGNING_LEVEL_ON_INSTALL : Package '[chars]' for service container '[chars]' is '[chars]', [chars] '[chars]'
```

Explanation A service container software package with the certificate signing level described is being installed.

Recommended Action Take note of the service container and software package. Verify the software package is expected to be (un)signed as described and has the appropriate contents. Uninstall the package if unsure of the package origins.

```
%VMAN-5-PERMISSION DENIED: Virtual Service '[chars]' is not owned by client IOSd
```

Explanation An attempt was made to modify a virtual-service that is not owned by by the client. The request was rejected.

Recommended Action No action is required.

```
%VMAN-5-VIRT INST : LOG FROM VIRTUAL SERVICE [chars]: [chars]
```

Explanation The named virtual service has triggered the log. Please interpret the log in the context of the virtual services.

Recommended Action No action is required

```
%VMAN-5-VIRT INST NOTICE : VIRTUAL SERVICE [chars] LOG: [chars]
```

Explanation The named virtual service has triggered the log. Please interpret the log in the context of the virtual services.

Recommended Action No action is required

```
%VMAN-6-VIRT INST INFO : VIRTUAL SERVICE [chars] LOG: [chars]
```

Explanation The named virtual service has triggered the log. Please interpret the log in the context of the virtual services.

Obtaining Documentation and Submitting a Service Request

Recommended Action No action is required

```
%VMAN-7-VIRT INST DEBUG : VIRTUAL SERVICE [chars] LOG: [chars]
```

Explanation The named virtual service has triggered the log. Please interpret the log in the context of the virtual services.

Recommended Action No action is required

Obtaining Documentation and Submitting a Service Request

For information on obtaining documentation, using the Cisco Bug Search Tool (BST), submitting a service request, and gathering additional information, see What's New in Cisco Product Documentation.

To receive new and revised Cisco technical content directly to your desktop, you can subscribe to the What's New in Cisco Product Documentation RSS feed. The RSS feeds are a free service.

Cisco and the Cisco logo are trademarks or registered trademarks of Cisco and/or its affiliates in the U.S. and other countries. To view a list of Cisco trademarks, go to this URL: www.cisco.com/go/trademarks. Third-party trademarks mentioned are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (1110R)

Copyright ©2017, Cisco Systems, Inc.

All rights reserved. Printed in USA.