



# Troubleshooting

This chapter provides basic installation troubleshooting information. The chapter includes the following sections:

- Troubleshooting Overview, page 4-1
- Initialization and Self-Test Problems, page 4-2
- Troubleshooting Subsystems, page 4-4
- Using the Reset Switch, page 4-10
- Further Contacts, page 4-11




**Note**

This chapter provides only hardware troubleshooting information that does not require access to the router's command-line interface (CLI) or knowledge of CLI commands. For more advanced troubleshooting, refer to the Cisco IOS online document *Troubleshooting Tips for the Cisco uBR905 Cable Access Router*.

## Troubleshooting Overview

Installation problems with Cisco uBR905 routers are commonly due to the cable system and its topography. LEDs on the front panel of the Cisco uBR905 router reveal operational status and help you determine problem areas. See Figure 4-1 for the layout of the LEDs on the router's front panel; see Table 1-1 on page 1-7 for a description of these LEDs.

**Figure 4-1 Cisco uBR905 Cable Access Router Front Panel LEDs**

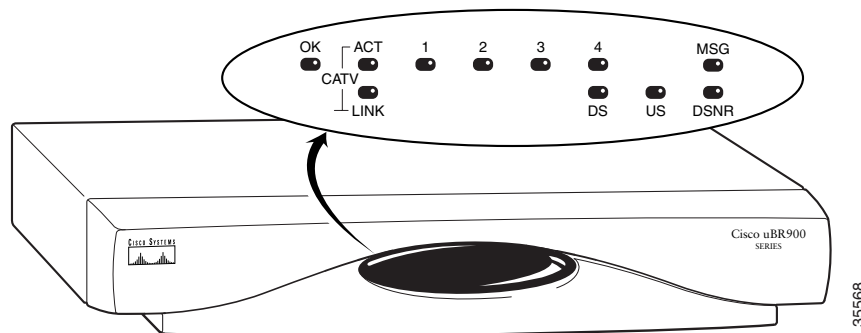

# Initialization and Self-Test Problems

When the Cisco uBR905 router first powers on, it performs the following self-test and initialization routines:

1. The primary ROM monitor in Flash memory tests the secondary ROM monitor. If the secondary ROM monitor is present in Flash memory and passes its verification tests, it assumes control and continues with the initialization process; otherwise, the primary ROM monitor continues with the initialization process.
2. The system runs its diagnostic procedures, which ensure that all Cisco uBR905 components are functioning. To complete the diagnostic procedures, the Cisco uBR905 processor must be able to:
  - Perform a system reset trap.
  - Fetch and execute instructions from the ROM Monitor area of the Flash memory.
  - Write several internal registers and reset the control processor successfully.
  - Correctly configure the port registers.
  - Perform conditional branches.
  - Verify that the software-controlled LEDs are functional.

If all diagnostic procedures are successful, all LEDs except for the four Ethernet and the ACT LEDs briefly blink.

3. The next step of the self-test initializes the memory controller. The US LED comes on if this test succeeds.
4. The console port is initialized and the banner is output to the console port.
5. Next, the Cisco uBR905 router performs a self-test on the low memory area of the DRAM. When this test starts, the LINK, DS, US, and MSG LEDs come on.
6. After testing low memory, the processor clears the LEDs and then tests its memory cache. When this test starts, the DS and MSG LEDs come on.
7. The next step tests the BSS uninitialized data area of the DRAM. When this test starts, all LEDs go off and the LINK, DS, and MSG LEDs come on. If this test succeeds, the OK LED begins blinking, the DS and MSG LEDs go off, and the US LED goes on.
8. The final step tests the remaining DRAM. When this test starts, all LEDs go out and then the DS and US LEDs go on. If this test succeeds, the DS and US LEDs go out, and the LINK and DSNR LEDs go on. The OK LED continues blinking until the Cisco uBR905 router has loaded the Cisco IOS image.

Table 4-1 summarizes the self-test failure codes displayed by the LEDs; these patterns appear only when the OK LED goes off and remains off during boot.

**Table 4-1 LED Self-Test Failure Codes**

LINK	DS	US	MSG	Error Description
		ON		Initialization of the memory controller failed.
ON	ON	ON	ON	The self-test of the low registers of the DRAM failed.
	ON		ON	The self-test of the processor cache failed.
ON	ON		ON	A memory or controller problem was detected while clearing the BSS area of the DRAM.
	ON	ON		A memory or controller problem was detected while clearing the remaining DRAM.

9. If all self-tests passed, the Cisco uBR905 router turns off all LEDs except OK and boots the Cisco IOS image stored in its Flash memory. The OK LED blinks during the boot process. If this LED *does not* start to blink, or if it continues blinking for more than ten minutes, see the “Power Subsystem” section on page 4-6.
10. If the Cisco IOS image booted successfully, it takes control from the ROM monitor code and turns the OK LED on solid.
11. The router starts normal operations after it starts up the Cisco IOS image. At this point, the US, DSNR and LINK LEDs remain on to indicate that the router is operational and is receiving a healthy signal:
  - The OK LED indicates that power is supplied to the router and that it has successfully loaded and is running a Cisco IOS image.
  - The DS LED indicates that the router is locked to a downstream channel.
  - The US LED indicates that the router has established connectivity with the CMTS and is operating within 6 dB of desired power level (generally within 3 dB).
  - The LINK LED indicates that the cable interface is operational and is connected to the proper coaxial cable.
  - The DSNR LED reveals that the router is receiving a quality downstream signal with a low signal-to-noise ratio (SNR) and that is 5 dB above the downstream lock threshold.
  - The ACT LED blinks to indicate activity on the cable interface.
  - The Ethernet 1, 2, 3, 4 LEDs blink to indicate activity from the PCs and other customer premises devices connected to the corresponding Ethernet ports.



**Note** Because the signal-to-noise ratio and lock threshold can drift, they are regularly checked and the DSNR LED is updated. While this might cause the DSNR LED to occasionally blink briefly, under normal conditions the DSNR LED remains on.

12. When the router and computer have booted successfully, you should be able to access an Internet web site, which will confirm that the router is configured correctly. If you cannot access a web site, proceed to the “PC Subsystem” section on page 4-8.


# Troubleshooting Subsystems

The key to troubleshooting is to isolate a problem to a specific subsystem:

- Power subsystem
- Coaxial cable subsystem
- RF and digital signal subsystem
- PC subsystem

Figure 4-2 on the next page provides a general troubleshooting flowchart. Table 4-2 can help you correlate LED behavior with possible problems, and suggested courses of actions.

**Figure 4-2 Basic Troubleshooting Strategy for Startup Problems**

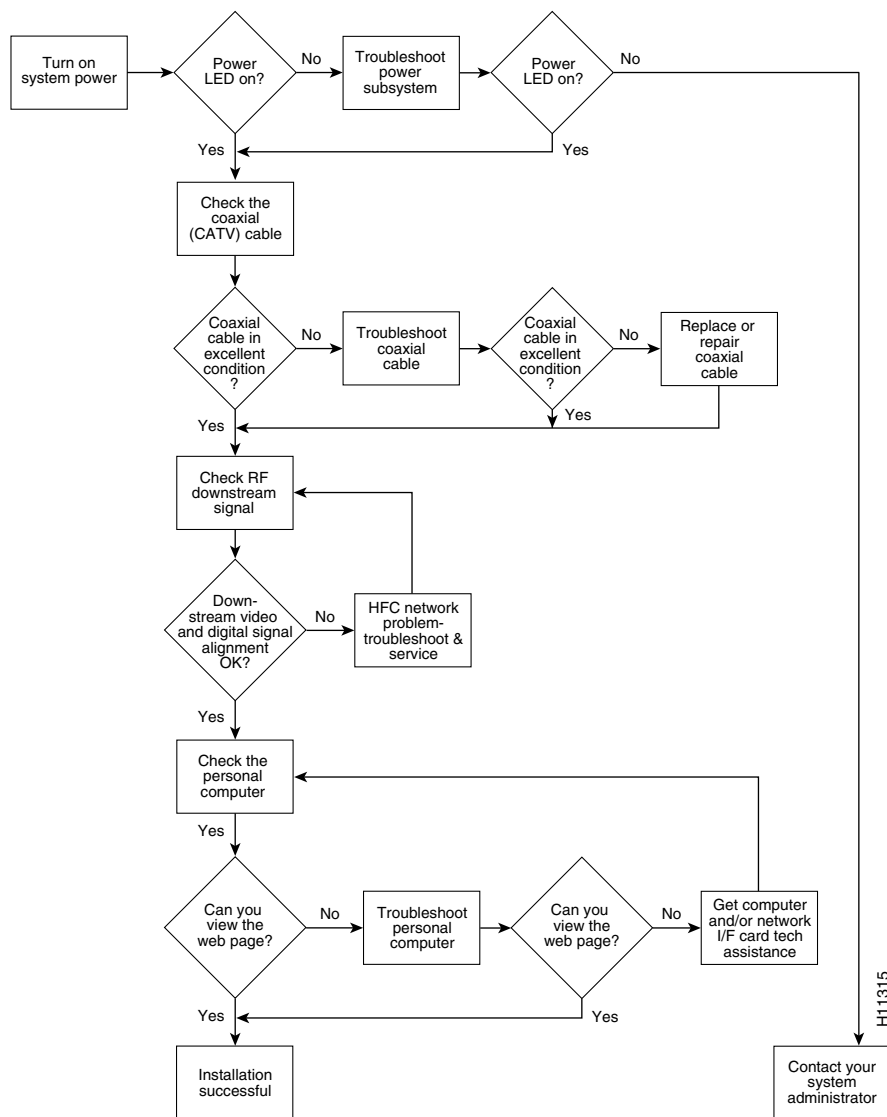

H11315



Table 4-2 General Troubleshooting Tips (continued)

LED	Status	Possible Problem	Suggested Action
US	Upstream LED is off.	Upstream signal is not reaching the headend; router is unable to communicate with the remote end. Systematic RF noise problem or other outage.	Verify continuity back to the headend using the standard procedures for your system. Temporarily locate the router closer to the ground block, the tap, or another tap closer to the headend—ensuring correct RF input level at all times.
DSNR	Downstream signal-to-noise LED is off.	Systematic RF noise problem or other outage.	Verify correct RF input to the router. Temporarily locate the router closer to the ground block, the tap, or another tap closer to the headend—ensuring correct RF input level at all times.  Do not install the router unless your system management expressly states that this is the procedure to follow. This is an early indication of low-quality cable signals and indicates a high likelihood of intermittent router operation.

## Power Subsystem

To help isolate a problem with the Cisco uBR905 router power subsystem, look at the OK LED. Does the LED remain on when self-test is finished and a software image booted?

- If yes, the power source is good and the power supply is functional.
- If no, make sure that the power cable is connected at the back of the router and that the power supply is properly connected to power at the wall outlet.
  - If the OK LED remains off but other LEDs are on, check for possible diagnostic codes.
  - If the OK LED remains off and all other LEDs are also off, check the power source or power supply. Connect the power cord to another power source, if available. If the LED comes on, the problem is the first power source.
  - If the OK LED fails to blink after you connect the power cord to a new power source, the power supply is probably faulty.




### Note

If you are unable to resolve the problem or you determine that either a power supply or cable access router connector is faulty, contact your field office for instructions.

## Coaxial Cable Subsystem

For proper operation, the Cisco uBR905 router must be able to establish a connection with the service provider's CMTS. There are many conditions inherent to coaxial cable that can inhibit this connection:

- 
- Step 1** Verify the cable connection from the router to the HFC plant and headend by checking the video reception. You should test the same coaxial cable that the router is connected to—if necessary, disconnect the router from the coaxial cable and connect a cable-ready TV in its place.
- If the TV does not receive any cable channels, contact the service provider to re-establish service to the site. If the TV does receive cable channels, it indicates that the basic infrastructure between the site and the HFC plant and headend is working; however, because data connections are much more sensitive to signal interference than cable TV service, it is still possible that a problem exists that prevents reception of the data signals.
- Step 2** If you are using a splitter or coupler to share the coaxial cable between a TV and the router, remove the splitter or coupler, TV, and any other devices connected to the cable (such as video or DVD players) so that the router connects directly to the coaxial cable coming out of the CATV wall outlet. Make sure that the router is the only device on this segment of cable.
- If the router functions in this configuration, inspect the splitter and any other devices that were installed on this cable segment. If necessary, upgrade them and their interconnecting cables with ones that have higher-quality connectors—see “Coaxial Connector and Cable Specifications” in Appendix B, “Connector and Cable Specifications” for the recommended cable and connector quality. A high-pass filter might be necessary between the modem and TV to prevent signal interference. If this does not help, you might need to install a separate cable for TV reception.
- Step 3** Disconnect the coaxial cable from the back of the router and inspect the cable and its connector. Is the center conductor on the coaxial cable end straight and of the correct length to ensure a good connection?
- If the center conductor is not straight or appears to be too long or too short, cut the coaxial cable behind the connector end, and strip the insulation back. Make sure that the newly exposed center conductor is straight. Before replacing the new cable connector end, check the general condition of the cable. Make sure that the new conductor end is securely crimped to the cable.
-   
**Note** The center connector should extend 1/8 inch (3.2 mm) beyond the end of the connector.
- 
- Step 4** Is the coaxial cable running to the router in excellent condition?
- The coaxial cable between the router and the cable tap must be of very high quality. The cable insulation must be at least 80 percent braid with foil. If the existing cable appears to be of lesser quality or in poor condition, replace the cable from the ground block or tap to the cable end.
- Step 5** Is the coaxial cable connection to the back of the cable access router secure?
- Check that the coaxial cable end is securely screwed onto the F-connector at the back of the cable access router. Hand-tighten the connector, making sure that it is finger tight; then give it a 1/6 turn.
- 



**Note** If you are unable to resolve the problem, contact your internal service organization for instructions and assistance.

---

## RF and Digital Subsystem

The use of RF and digital signals on the same cable can lead to interference if the HFC network is not correctly configured.

---

**Step 1** Is the downstream video signal being received at the ground block or at the tap?

Connect a premium services cable converter to the ground block or at the tap and contact field service dispatch. Ask the CMTS system administrator to check if they can locate the box on the network by sending an impulse, or on-demand, video signal to the converter.

If field service can locate the converter at the ground block or at the tap, repeat the test with the cable access router connected to the cable end near the computer.

If field service cannot locate the converter at the cable end, but can locate the converter at the ground block or tap, replace the cable from the ground block or tap to the cable end.

---

## PC Subsystem

To isolate a problem with a PC that is connected to the Cisco uBR905 router:

---

**Step 1** Can you access a web page using the web browser installed on the computer?

If you cannot access a web page, verify that the computer network protocol is configured for TCP/IP and that DHCP services are enabled using the following Windows 95 options:

- a. Turn on your PC and enter your network username and password.
- b. Choose **Start> Settings> Control Panel** to display the Control Panel.
- c. Double-click the **Network** icon. The Network window appears with the Configuration tab in the foreground. If the Configuration tab is not in the foreground, click this tab.
- d. Scroll the network components list box until the Ethernet adapter TCP/IP option displays for your network adapter and double-click the selection. The TCP/IP Properties window appears with the IP Address tab in the foreground. If the IP Address tab is not in the foreground, click this tab.




---

**Note** If there is no TCP/IP entry for the installed network adapter, the computer is not configured for IP. Refer to the subscriber's computer and network interface card user guides on how to configure these settings.

---

- e. Make sure that the button next to **Obtain an IP address automatically** is selected. If this button is not selected, the computer is not configured for DHCP. Select the **Obtain an IP address automatically** radio button now and save the configuration settings.
- f. Close all networking windows and close the Control Panel.
- g. Follow the onscreen instructions and reboot your PC.

**Step 2** Is the network interface card operational?

Verify that the network card is installed properly and that necessary software drivers have been installed and are running on the computer. Consult the user guide or other documentation that accompanied the network card. Contact technical support for the network card manufacturer as necessary.



- Step 3** Is the computer preconfigured to work with special software such as America Online? Some computers come with dialup adapters preconfigured to work with special software. To ensure that the setup is correct, follow the procedures below.

#### Setting the Internet Properties

- a. Turn on your PC and enter your network username and password.
- b. Choose **Start> Settings> Control Panel** to display the Control Panel.
- c. Double-click the **Internet** icon. The Internet Properties window appears with the General tab in the foreground.
- d. Click the **Connection** tab. The Internet Properties Connection tab displays. The Connect to the Internet: as needed check box is checked, and the name of the dialup adapter appears in the Dial-Up Networking connection list box.
- e. Click the **Connect to the Internet: as needed** check box to deselect the option.



#### Note

---

The check box must not be checked. If the checkbox is checked, the computer attempts to open a dialup adapter connection each time a network application is started.

---

- f. Click **OK**.
- g. From the Control Panel, double-click the **System** icon. The System Properties window appears with the General tab in the foreground.
- h. Click the **Device Manager** tab.
- i. Click the **Network adapter** selection. Make sure that the display does not contain either a red “X” or a yellow exclamation point.
- j. Click **OK**.

#### Setting Network Components

- a. Turn on your PC and enter your network username and password.
- b. Choose **Start> Settings> Control Panel** to display the Control Panel.
- c. Double-click the **Network** icon. The Network window appears with the Configuration tab in the foreground.
- d. Scroll the list box until the particular dialup adapter selection appears. If the computer has America Online installed, two network components will be displayed: AOL Dialup Adapter and TCP/IP:AOL Dialup Adapter.



#### Note

---

The computer might have more than one dialup adapter. Be sure to select the right dialup adapter.

---

- e. If the subscriber does not intend to use America Online, remove both these components from the Network components list box:
  - Click **AOL Dialup Adapter** to highlight it. Click **Remove**.
  - Click **TCP/IP:AOL Dialup Adapter** to highlight it. Click **Remove**.
- f. If the subscriber intends to use America Online, double-click the TCP/IP component associated with the dialup adapter. The TCP/IP Properties window appears with the IP Address tab in the foreground.

- g. Click the **Obtain an IP address automatically** button. The IP address for the dialup connection is assigned only when the connection is made. By default, the computer is assigned an IP address by the Cisco uBR905 router via DHCP.



**Note** When set up correctly, the Cisco uBR905 router is the default Internet connection device. The subscriber might select the dialup adapter as an alternative connection path.

- h. Click **OK**. A dialog box appears, informing you that before the change can become effective, the computer must be rebooted.
- i. Click **Yes** to reboot the computer.

## Using the Reset Switch

The Cisco uBR905 router contains a reset switch with three different actions:

- A quick press (less than 10 seconds) initiates a hardware reset, similar to a power cycle or software reload.
- Pressing the reset switch from between 10 and 30 seconds causes the router to clear its saved RF parameters and do a hardware reload. This reload is similar to plugging in the router for the first time.
- Pressing the reset switch for longer than 30 seconds causes the router to erase its system image and download a new system image over the cable interface should the CMTS system administrator have set certain options in the configuration file, in conjunction with field service personnel. The router then reboots with this new image.

See Table 4-3 for additional elaboration.

**Table 4-3** *Reset Descriptions*

Type of Reset	Press Reset Switch...	What Happens...
Warm	Less than 10 seconds	The router reboots, using the downstream frequencies saved in the configuration file.
Cold	10 to 29 seconds	The router reboots the image in Flash memory, ignoring the downstream frequencies saved in the configuration file. The router initiates a downstream frequency search, which may take a few minutes. The new frequencies are saved in the configuration file and are used at the next warm reset.
Cold	More than 30 seconds	The router downloads a new image from the CMTS and reboots, storing this image in Flash memory, assuming coordination between the CMTS system administrator and field personnel.

**Note**

---

The reset switch on the back panel of the Cisco uBR905 cable access router is recessed to prevent accidental resets of the router. To press the switch, use a blunt object, such as a pen or pencil point; do not use a sharp object, such as a knife or awl, because this could permanently damage the switch and the router's circuitry.

---

## Further Contacts

If you experience trouble with the startup that is not resolved with the procedures and tips in this chapter, contact field service dispatch for further assistance and instructions. Also see the documentation available in the Broadband Cable section on CCO and the Documentation CD-ROM.

**Note**

---

Cisco recommends that a CMTS systems engineer or network administrator be available, or on-call, to assist field service technicians or installers in troubleshooting a Cisco uBR905 cable access router.

If you are a network administrator or systems engineer with a Cisco product covered under warranty or a maintenance contract, contact Cisco's Technical Assistance Center (TAC) at 800 553-2447, 408 526-7209, or [tac@cisco.com](mailto:tac@cisco.com).

---

