

Date: Jan 31, 2022

This is a companion document to [Cisco Prime Network 5.3 Supported VNEs](#). It contains the following:

- Information about new or enhanced Virtual Network Elements (VNE) drivers, new modules, new technologies and new software versions supported after Prime Network 5.3 release.
- Device support information for Change and Configuration Management.
- Device support information for command scripts (scripts launched by right-clicking an NE in Prime Network Vision and choosing Commands).

Contents

Obtaining the New and Enhanced Device Drivers3

Which Jar File is a Device Using?3

New Support for Cisco Routers5

 Cisco ASR 10XX Series Routers — Additional Support5

 Cisco ASR 901 Routers — Additional Support7

 Cisco ASR 902 Routers — Additional Support7

 Cisco ASR 903 Routers — Additional Support7

 Cisco ASR 920 Routers — Additional Support7

 Cisco ASR 5000 Series Routers — Additional Support8

 Cisco ASR 9000 Series Routers — Additional Support8

 Cisco Network Convergence System 540 Series Routers (NCS 540) — Additional Support9

 Cisco Network Convergence System 560 Series Routers (NCS 560) — Additional Support 10

 Cisco Network Convergence System 5500 Series Routers (NCS 5500) — Additional Support 11

 Cisco ME 3600X Ethernet Access Switch 13

New Support for Cisco Switches13

 Cisco Industrial Ethernet 4K — Additional Support 13

 Cisco Nexus 5000 Series Switches— Additional Support 13

 Cisco Nexus 9000 Series Switches— Additional Support 14

 Cisco Catalyst 3650 Series Switches — Additional Support 15

 Cisco Catalyst 3850 Series Switches — Additional Support 15

 Cisco Nexus 3000 Series Switches— Additional Support 15

Cisco Catalyst 9300 Series Switches — Additional Support.....	16
New Support for Data Center	17
Cisco UCS — Additional Support	17
Cisco UCS C Series Rack Mount Server — Additional Support	17
New Support for Firewall Device	17
Cisco ASA — Additional Support	17
Cisco ASA5585-X Series Switches — Additional Support	17
New Support for Events.....	17
Supported Syslogs	17
Cisco ASR 9000— Supported Syslogs.....	18
Cisco Network Convergence System 540 Series Routers (NCS 540) — Supported Syslogs.....	18
Cisco Network Convergence System 5500 Series Routers (NCS 5500) — Supported Syslogs	18
Supported Traps.....	19
Cisco ASR 5000— Supported Traps.....	19
Cisco ASR 9000 — Supported Traps	20
Cisco IOS and Cisco IOS - XE— Supported Traps.....	20
Support for Change and Configuration Management in 5.3	20
Cisco Catalyst 9300 Series Switches.....	20

Obtaining the New and Enhanced Device Drivers

New and enhanced VNE support for multiple device families is provided through Prime Network Device Packages (DPs) and Point Patches, as they become available. To obtain this additional support, do the following:


- For Device Packages (DPs), log into Cisco.com and go to the [Cisco Prime Network Software Download site](#).
- For Patches, log into Cisco.com and go to the [Cisco Prime Network Software Download site](#).

Once you download the new support, you can install on Cisco Prime Network 5.3. DP contents are described in this document (and in the Readme that accompanies the download). Point Patch contents are described in the Release Note or Readme available on the download site.

Which Jar File is a Device Using?

To identify the jar file that is being used by any devices that are managed by Prime Network, open the Administration client and check the properties of the VNE. In the General tab, the driver file name is displayed.

The following example shows a Nexus 7000 device that is using the driver file Cisco-Nexus70xx-v6.0.0.0.jar, which was provided in the release of Prime Network 5.3(DP0).

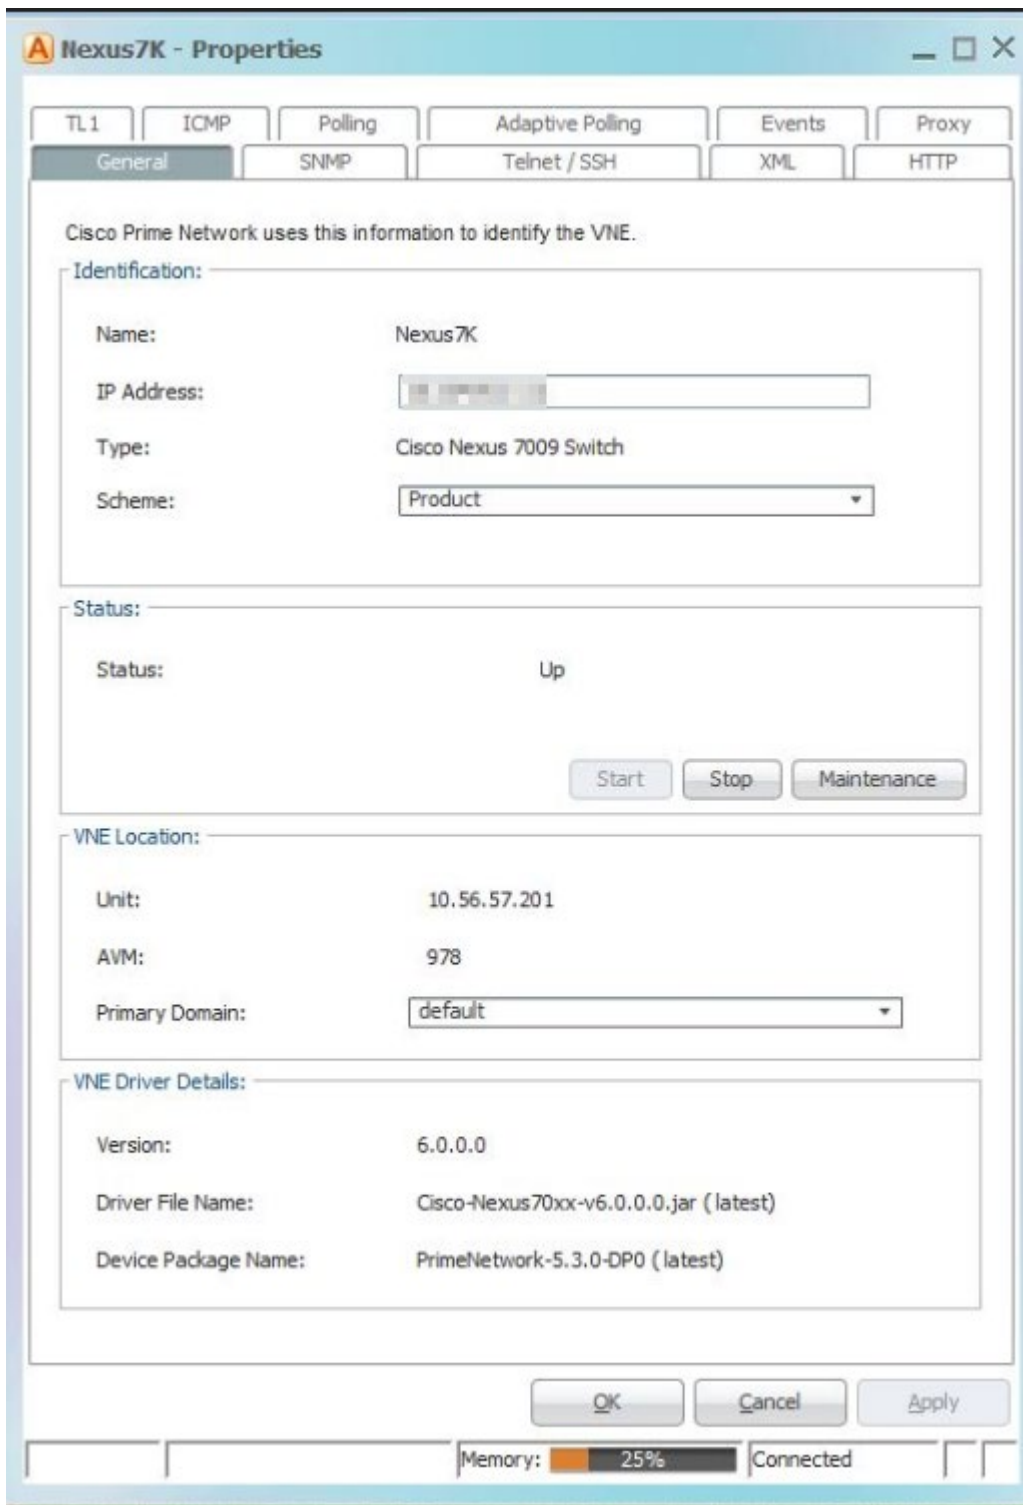

With this information, you can check if a newer version is available and what new support it provides (see the “New Support” sections in this document).

New Support for Cisco Routers

Cisco ASR 10XX Series Routers — Additional Support

- **Cisco ASR 1000 Series — Supported Software Versions**

Software Version	Added in:
IOS-XE 16.12.3	DP 2009
IOS-XE 16.12.5	DP 2105
IOS-XE 17.3.3	DP 2105

- **Cisco ASR 1001 Series—Supported Software Versions**

Software Version	Added in:
IOS-XE 16.12.3	DP 2009
IOS-XE 16.12.5	DP 2105
IOS-XE 17.3.3	DP 2105

- **Cisco ASR 1001 - X Series—Supported Software Versions**

Software Version	Added in:
IOS-XE 16.12.3	DP 2009
IOS-XE 16.12.5	DP 2105
IOS-XE 17.3.3	DP 2105

- **Cisco ASR 1001 - HX Series—Supported Software Versions**

Software Version	Added in:
IOS-XE 16.12.3	DP 2009
IOS-XE 16.12.5	DP 2105
IOS-XE 17.3.3	DP 2105

- **Cisco ASR 1002 Series—Supported Software Versions**

Software Version	Added in:
IOS-XE 16.12.3	DP 2009
IOS-XE 16.12.5	DP 2105
IOS-XE 17.3.3	DP 2105

- **Cisco ASR 1002-X Series—Supported Software Versions**

Software Version	Added in:
IOS-XE 16.12.3	DP 2009
IOS-XE 16.12.5	DP 2105
IOS-XE 17.3.3	DP 2105

- **Cisco ASR 1002 - HX Series—Supported Software Versions**

Software Version	Added in:
IOS-XE 16.12.3	DP 2009
IOS-XE 16.12.5	DP 2105
IOS-XE 17.3.3	DP 2105

- **Cisco ASR 1004 Series—Supported Software Versions**

Software Version	Added in:
IOS-XE 16.12.3	DP 2009
IOS-XE 16.12.5	DP 2105
IOS-XE 17.3.3	DP 2105

- **Cisco ASR 1006 Series—Supported Software Versions**

Software Version	Added in:
IOS-XE 3.16.8S/15.5(3)S8	DP 1907
IOS-XE 16.12.3	DP 2009
IOS-XE 16.12.5	DP 2105
IOS-XE 17.3.3	DP 2105

- **Cisco ASR 1006-X Series—Supported Software Versions**

Software Version	Added in:
IOS-XE 16.12.3	DP 2009
IOS-XE 16.12.5	DP 2105
IOS-XE 17.3.3	DP 2105

Cisco ASR 901 Routers — Additional Support

- Cisco ASR 901 — Supported Software Versions

Software Version	Added in:
IOS 15.6(2) SP8 / 3.18 SP8	DP 2005

Cisco ASR 902 Routers — Additional Support

- Cisco ASR 902 — Supported Software Versions

Software Version	Added in:
*IOS 17.1.1	DP 2001

Cisco ASR 903 Routers — Additional Support

- Cisco ASR 903 — Supported Software Versions

Software Version	Added in:
IOS 16.12.3	DP 2009
IOS 16.12.5	DP 2105
IOS 17.3.3	DP 2107

Cisco ASR 920 Routers — Additional Support

- Cisco ASR 920 — Supported Software Versions

Software Version	Added in:
IOS 16.12.5	DP 2105



*Note: VNE discovery using SSH is not supported due to stronger encryptions enforced in the IOS 17.1.1 version on the ASR 902 device.

Cisco ASR 5000 Series Routers — Additional Support

- Cisco ASR 5000— Supported Software Versions

Software Version	Added in:
StarOS 21.17	DP 2001
StarOS 21.18.1	DP 2003
StarOS 21.19.0	DP 2005
StarOS 21.20.0	DP 2007
StarOS 21.21.0	DP 2011
StarOS 21.22.0	DP 2101
StarOS 21.23.0	DP 2103
StarOS 21.24.0	DP 2107
StarOS 21.25.0	DP 2111
StarOS 21.26.0	DP 2201

Cisco ASR 9000 Series Routers — Additional Support

- Cisco ASR 9000— Supported Software Versions



Note: The below listed software versions are supported for ASR 9K Classic (32-bit) IOS XR software.

Software Version	Added in:
IOS XR 6.6.3	DP 2005
IOS XR 6.7.2	DP 2009
IOS XR 7.1.2*	DP 2009
IOS XR 6.7.3	DP 2101
IOS XR 7.1.3**	DP 2105
IOS-XR 7.3.2***	DP 2111

*ASR9K(64-bit) with IOS-XR 7.1.2 will be supported in DP 2009 only if all the below production SMU's are installed on the device.

- i. [CSCvv51226](#)
- ii. [CSCvv64858](#)
- iii. [CSCvv10524](#)

**ASR9K(64-bit) with IOS-XR 7.1.3 will be supported in DP 2105 only if the [CSCvv10524](#) production SMU is installed on the device.

*** Breakout feature is not supported due to HWBU dependency bug [CSCvv09823](#).

- **Cisco ASR 9000 — Supported Network Elements**

NE Type	Product Name	SysOID	Added in:
ASR 9901	Cisco ASR 9901	.1.3.6.1.4.1.9.1.2658	DP 2105

- **Cisco ASR 9000 — Supported Modules**

Module Name	Module Description	Added in:
A9K-MOD200-TR	A9K-MOD200-TR	DP 2001
A99-32X100GE-X-TR	A99-32X100GE-X-TR	DP 2009
QSFP-100G-CWDM4-S	QSFP-100G-CWDM4-S	DP 2009
QSFP-100G-AOC10M	QSFP-100G-AOC10M	DP 2009

Cisco Network Convergence System 540 Series Routers (NCS 540) — Additional Support

- **Cisco Network Convergence System 540 Series Routers (NCS 540) — Supported software versions**

Software Version	Added in:
IOS XR 6.5.3 (N540-24Z8Q2C-SYS)	DP 1907
IOS XR 7.0.1	DP 1907
IOS XR 6.6.3	DP 2007
IOS XR 7.1.2	DP 2009
IOS XR 7.2.1	DP 2011
IOS XR 7.2.2	DP 2109
IOS-XR 7.3.2*	DP 2111

* Breakout feature is not supported due to HWBU dependency bug [CSCvy09823](#).

- **Cisco Network Convergence System 540 Series Routers (NCS 540) — Supported Network Elements**

NE Type	Product Name	SysOID	Added in:
Cisco NCS 540 (N540-X-24Z8Q2C-M)	Cisco NCS540	.1.3.6.1.4.1.9.1.2430 ^{1,2}	DP 1809
Cisco NCS 54016G (N540-ACC-SYS)	ciscoNCS54016G	.1.3.6.1.4.1.9.1.3009	DP 2007
Cisco NCS 540 (N540-X-24Z8Q2C-M)	Cisco NCS540	.1.3.6.1.4.1.9.1.2741 ^{1,2}	DP 2009

1. Sys OID for **N540-24Z8Q2C-M** will get change from .1.3.6.1.4.1.9.1.2430 to .1.3.6.1.4.1.9.1.2741 on upgrading IOS-XR 7.1.2 due to HW defect [CSCvu03339](#).

- 2. SFP modelling for NCS 540 with IOS-XR 7.1.2 and IOS-XR 7.2.1 will be supported in DP 2009 and DP 2011 only if [CSCvv51226](#) this productions SMU is installed on the device.

- **Cisco Network Convergence System 540 Series Routers (NCS 540) — Supported Technologies**

Support for	Added in:
<ul style="list-style-type: none"> • BGP EVPN Address family in Inventory 	DP 2003

Cisco Network Convergence System 560 Series Routers (NCS 560) — Additional Support

- **Cisco Network Convergence System 560 Series Routers (NCS 560) — Supported software versions**

Software Version	Added in:
IOS XR 7.1.1	DP 2011

- **Cisco Network Convergence System 560 Series Routers (NCS 560) — Supported Network Elements**

NE Type	Product Name	SysOID	Added in:
ciscoN5604RSP4E (N560-4-RSP4-E)	ciscoN5604RSP4E	.1.3.6.1.4.1.9.1.2856*	DP 2011

*SFP modelling for NCS 560 with IOS-XR 7.1.1 will be supported in DP 2011 only if [CSCvv51226](#) this productions SMU is installed on the device.

- **Cisco Network Convergence System 560 Series Routers (NCS 560) — Supported Modules**

Module Name	Module Description	SysOID	Added in
N560-IMA2C	N560-IMA2C	.1.3.6.1.4.1.9.12.3.1.9.2.670	DP 2011
A900-IMA8Z	A900-IMA8Z	.1.3.6.1.4.1.9.12.3.1.9.2.526	DP 2011
N560-4-RSP4E	N560-4-RSP4E	.1.3.6.1.4.1.9.12.3.1.9.2.671	DP 2011
N560-4-FAN-H	N560-4-FAN-H	.1.3.6.1.4.1.9.12.3.1.7.370	DP 2011
N560-4-PWR-FAN	N560-4-PWR-FAN	.1.3.6.1.4.1.9.12.3.1.7.372	DP 2011
A900-PWR1200-A	A900-PWR1200-A	.1.3.6.1.4.1.9.12.3.1.6.478	DP 2011

- **Cisco Network Convergence System 560 Series Routers (NCS 560) — Supported Technologies**

Support for:	Added in:
<ul style="list-style-type: none"> • Access List • CDP • BFD • LLDP • LSE • Modular OS • MPBGP • QOS • IPv4 and IPv6 • Routing Entities • Local Switching • BFD 	DP 2011

Cisco Network Convergence System 5500 Series Routers (NCS 5500) — Additional Support

- **Cisco Network Convergence System 5500 Series Routers (NCS 5500) — Supported software versions**

Software Version	Added in:
IOS XR 7.1.2*	DP 2009
IOS XR 7.2.1*	DP 2011
IOS XR 6.6.3 SP2	DP 2101
IOS XR 7.3.1	DP 2103
IOS XR 7.2.2	DP 2109
IOS XR 7.3.2**	DP 2111

*SFP modelling for NCS 55xx with IOS-XR 7.1.2 and IOS-XR 7.2.1 will be supported in DP 2009 and DP2011 only if [CSCvv51226](#) this productions SMU is installed on the device.

** Breakout feature is not supported due to HWBU dependency bug [CSCvy09823](#).

- **Cisco Network Convergence System 5500 Series Routers (NCS 5500) — Supported Network Elements**

NE Type	Product Name	SysOID	Added in:
NCS 5504	Cisco NCS 5504 Router	.1.3.6.1.4.1.9.1.2413	DP 2001
NCS 5508	Cisco NCS 5508	.1.3.6.1.4.1.9.1.2349	DP 2011
NCS 55A1-24H	ciscoNCS55A124H	.1.3.6.1.4.1.9.1.2432	DP 2109
*NCS55A1-24Q6H-S	ciscoNCS55A124Q6HS	.1.3.6.1.4.1.9.1.3158	DP 2109
NCS-55A1-48Q6H	ciscoNCS55A148Q6H	.1.3.6.1.4.1.9.1.2866	DP 2111

* NCS-55A1-24Q6H-S (1.3.6.1.4.1.9.1.3158) will be supported in DP 2109 only if the [CSCvz72160](#) production SMU is installed on the device.

- **Cisco Network Convergence System 5500 Series Routers (NCS 5500) — Supported Modules**

Module Name	Module Description	SysOID	Added in:
NC55-PWR-3KW-AC	NCS 5500 3KW AC Power Supply	.1.3.6.1.4.1.9.12.3.1.6.511	DP 2001
NC55-SC	NCS 5500 System Controller	.1.3.6.1.4.1.9.12.3.1.9.2.534	DP 2001
NC55-RP-E	NCS 5500 Route Processor	.1.3.6.1.4.1.9.12.3.1.9.2.617	DP 2001
NC55-5504-FC	NCS 5504 Fabric Card	.1.3.6.1.4.1.9.12.3.1.9.2.623	DP 2001
NC55-5504-FAN	Fan Tray module	.1.3.6.1.4.1.9.12.3.1.7.303	DP 2001
QSFP-100G-SM-SR	QSFP-100G-SM-SR	.1.3.6.1.4.1.9.12.3.1.9.118.31	DP 2001
NCS-950W-DCFV	NCS-950W-DCFV	.1.3.6.1.4.1.9.12.3.1.6.553	DP 2001
NC55-36X100G	NC55-36X100G	.1.3.6.1.4.1.9.12.3.1.9.2.535	DP 2011
NC55-MOD-A-SE-S	NC55-MOD-A-SE-S	.1.3.6.1.4.1.9.12.3.1.9.2.652	DP 2011
NC55-5508-FAN	NC55-5508-FAN	.1.3.6.1.4.1.9.12.3.1.7.277	DP 2011
NC55-5508-FC	NC55-5508-FC	.1.3.6.1.4.1.9.12.3.1.9.2.536	DP 2011
QSFP-H40G-CU3M	QSFP-H40G-CU3M	.1.3.6.1.4.1.9.12.3.1.9.102.5	DP 2011
QSFP-100G-PSM4-S	QSFP-100G-PSM4-S	.1.3.6.1.4.1.9.12.3.1.9.118.3	DP 2011
NC55-5504-FAN2	NC55-5504-FAN2	.1.3.6.1.4.1.9.12.3.1.7.408	DP 2103
NC55-5504-FC2	NC55-5504-FC2	.1.3.6.1.4.1.9.12.3.1.9.2.712	DP 2103
NC55-36X100G-A-SE	NC55-36X100G-A-SE	.1.3.6.1.4.1.9.12.3.1.9.2.618	DP 2103
NC55-5508-FAN2	NC55-5508-FAN2	.1.3.6.1.4.1.9.12.3.1.7.352	DP 2103
NC55-5508-FC2	NC55-5508-FC2	.1.3.6.1.4.1.9.12.3.1.9.2.669	DP 2103
*NC55-PWR-3KW-DC	NC55-PWR-3KW-DC	.1.3.6.1.4.1.9.12.3.1.6.510	DP 2103
QSFP-4x10g-LR-S	cevQSFP4X10GLRLS	.1.3.6.1.4.1.9.12.3.1.9.93.13	DP 2109
SFP-H25G-CU2M	SFP-H25G-CU2M	.1.3.6.1.4.1.9.12.3.1.9.122.2	DP 2111
QSFP-100G-CU3M	QSFP-100G-CU3M	.1.3.6.1.4.1.9.12.3.1.9.118.17	DP 2111

* Power status shows incorrect for NC55-PWR-3KW-DC due to HWBU dependency bug [CSCvx85393](#)

- **Cisco Network Convergence System 5500 Series Routers (NCS 5500) — Supported Technologies**

Support for:	Added in:
<ul style="list-style-type: none"> • BGP EVPN Address family in Inventory 	DP 2003
<ul style="list-style-type: none"> • IPv4 BGP Routes 	DP 2105

Cisco ME 3600X Ethernet Access Switch

- Cisco ME 3600—Supported Technologies

Technology	Added in:
*CEM	DP 2103

* CEM ports are supported for the module (ME-3600X-24CX-M).

New Support for Cisco Switches

Cisco Industrial Ethernet 4K — Additional Support

- Cisco Industrial Ethernet 4K — Supported software versions

Software Version	Added in:
15.2(7)E2	DP 2109

- Cisco Industrial Ethernet 4K — Supported Network Elements

NE Type	Product Name	SysOID	Added in:
*IE-4010-4S24P	Cisco IE 4010 4S24P Industrial Ethernet Switch	.1.3.6.1.4.1.9.1.2368	DP 2111
*IE-4010-16S12P	Cisco IE 4010 16S12P Industrial Ethernet Switch	.1.3.6.1.4.1.9.1.2369	DP 2111

* Few ports are not modelled on IE4K due to HWBU dependency bug [CSCwa36449](#).

- Cisco Industrial Ethernet 4K — Supported Modules

Module Name	Module Description	SysOID	Added in
IE-4010-4S24P	IE-4010-4S24P	.1.3.6.1.4.1.9.12.3.1.9.71.142	DP 2111
IE-4010-16S12P	IE-4010-16S12P	.1.3.6.1.4.1.9.12.3.1.9.71.143	DP 2111
PWR-RGD-AC-DC-250	PWR-RGD-AC-DC-250	.1.3.6.1.4.1.9.12.3.1.6.633	DP 2111
PWR-RGD-AC-DC-H	PWR-RGD-AC-DC-H	.1.3.6.1.4.1.9.12.3.1.6.284	DP 2111

Cisco Nexus 5000 Series Switches— Additional Support

- Cisco Nexus 5000 — Supported Software Versions

Software Version	Added in:
NX-OS 7.3.(7)N1(1)	DP 2003

- **Cisco Nexus 5000 — Supported Modules**

Module Name	Module Description	SysOID	Added in
N55-M160L3-V2	N55-M160L3-V2	.1.3.6.1.4.1.9.12.3.1.9.72.20	DP 2003

Cisco Nexus 9000 Series Switches—Additional Support

- **Cisco Nexus 9000 — Supported Technologies**

Support for	Added in:
*BFD neighbors with VRF Name	DP 2107



*Note: BFD neighbor loss/BFD neighbor found service alarms will not show the VRF Name in the location.

- **Cisco Nexus 9000 — Supported Software Versions**

Software Version	Added in:
NX-OS 9.3.6	DP 2101

- **Cisco Nexus 9000—Supported Network Elements**

NE Type	Product Name	SysOID	Added in:
N9K-C93240YC-FX2	N9K-C93240YC-FX2	.1.3.6.1.4.1.9.12.3.1.3.2010	DP 2003
N9K-C9336C-FX2	N9K-C9336C-FX2	.1.3.6.1.4.1.9.12.3.1.3.1955	DP 2003
N9K-C92348GC-X	N9K-C92348GC-X	.1.3.6.1.4.1.9.12.3.1.3.2239	DP 2009

- **Cisco Nexus 9000 — Supported Modules**

Module Name	Module Description	SysOID	Added in
N9K-C9504-FM-E	N9K-C9504-FM-E	.1.3.6.1.4.1.9.12.3.1.9.100.28	DP 2003
N9K-X97160YC-EX	N9K-X97160YC-EX	.1.3.6.1.4.1.9.12.3.1.9.100.36	DP 2003
NXA-PAC-1100W-PE2	NXA-PAC-1100W-PE2	.1.3.6.1.4.1.9.12.3.1.6.610	DP 2003
NXA-FAN-35CFM-PE	NXA-FAN-35CFM-PE	.1.3.6.1.4.1.9.12.3.1.7.357	DP 2003
NXA-FAN-65CFM-PE	NXA-FAN-65CFM-PE	.1.3.6.1.4.1.9.12.3.1.7.359	DP 2003
SFP-H10GB-CU2M	SFP-H10GB-CU2M	.1.3.6.1.4.1.9.12.3.1.9.77.23	DP 2003
SFP-10G-LR	SFP-10G-LR	.1.3.6.1.4.1.9.12.3.1.9.76.1	DP 2009
N9K-C92348GC-X (Fixed Module)	N9K-C92348GC-X (Fixed Module)	.1.3.6.1.4.1.9.12.3.1.9.114.8	DP 2009

Cisco Catalyst 3650 Series Switches — Additional Support

- **Cisco catalyst 3650—Supported Software Versions**

Software Version	Added in:
IOS-XE 16.12.4	DP 2011
IOS-XE 16.12.5b	DP 2107

Cisco Catalyst 3850 Series Switches — Additional Support

- **Cisco catalyst 3850—Supported Software Versions**

Software Version	Added in:
IOS-XE 16.12.5b	DP 2105

- **Cisco catalyst 3850 — Supported Technologies**

Support for	Added in:
ISIS	DP 2001

Cisco Nexus 3000 Series Switches— Additional Support

- **Cisco Nexus 3000 — Supported Software Versions**

Software Version	Added in:
NX-OS 9.3.1	DP 2009
NX-OS 9.3.7	DP 2107

- **Cisco Nexus 3000 — Supported Technologies**

Support for	Added in:
ISIS	DP 2001

Cisco Catalyst 9300 Series Switches — Additional Support

- **Cisco Catalyst 9300 — Supported Software Versions**

Software Version	Added in:
IOS-XE 16.9.4	DP 2005
IOS-XE 16.9.5	DP 2007
IOS-XE 16.12.2	DP 2007

- **Cisco Catalyst 9300 — Supported Network Elements**

NE Type	Product Name	SysOID	Added in:
C9300L-24T-4X-E	C9300L-24T-4X-E	.1.3.6.1.4.1.9.1.2494	DP 2005
C9300L-48T-E	C9300L-48T-E	.1.3.6.1.4.1.9.1.2494	DP 2007
C9300-48T-4X	C9300-48T-4X	.1.3.6.1.4.1.9.1.2804	DP 2007

- **Cisco Catalyst 9300 — Supported Modules**

Module Name	Module Description	SysOID	Added in:
C9300-NM-8X	C9300-NM-8X	.1.3.6.1.4.1.9.12.3.1.9.2.646	DP 2007
PWR-C1-350WAC-P	PWR-C1-350WAC-P	.1.3.6.1.4.1.9.12.3.1.6.641	DP 2007

- **Cisco Catalyst 9300 — Supported Technologies**

Support for:	Added in:
<ul style="list-style-type: none"> • Bridges • Cisco Discovery Protocol • Ethernet Link Aggregation • Link Layer Discovery Protocol • Operating System • IPv4 and IPv6 • Spanning Tree Protocol • VTP 	DP 2005
<ul style="list-style-type: none"> • VRF 	DP 2011

New Support for Data Center

Cisco UCS — Additional Support

- Cisco UCS — Supported Software Versions

Software Version	Added in:
Firmware Version: 4.0(4a) NX-OS version: 5.0(3)N2(4.0.4a)	DP 2001

Cisco UCS C Series Rack Mount Server — Additional Support

- Cisco UCS Rack Servers — Supported Software Versions

Software Version	Added in:
Firmware Version: 4.0(2l)	DP 2005



*Note: VNE discovery using SSH is not supported due to stronger encryptions enforced in the 4.0(2l) version on the UCS Rack Servers

New Support for Firewall Device

Cisco ASA — Additional Support

Cisco ASA5585-X Series Switches — Additional Support

- Cisco ASA—Supported Network Elements

NE Type	Product Name	SysOID	Added in:
ASA5585-SSP-20	ASA5585-SSP-20	.1.3.6.1.4.1.9.1.1195	DP 2111

- Cisco ASA — Supported Modules

Module Name	Module Description	SysOID	Added in
ASA5585-SSP-IPS20	ASA5585-SSP-IPS20	.1.3.6.1.4.1.9.12.3.1.9.83.6	DP 2111

New Support for Events

Supported Syslogs

Cisco ASR 9000— Supported Syslogs

Support for	Added in
<ul style="list-style-type: none"> • %PLATFORM-VIC-6-OPTICS_OIROUT : OPTICS OIR: 0/0/CPU0 port 25 Sn: FNS22150VTT is removed • %PLATFORM-VIC-6-OPTICS_OIRIN : OPTICS OIR: 0/0/CPU0 port 25 Sn: FNS22150VTT is inserted 	DP 2009*
<ul style="list-style-type: none"> • %PLATFORM-ENVMON-2-ENV_CONDITION : Outstanding environmental condition exists in the chassis • %PLATFORM-ENVMON-2-ENV_CONDITION : Outstanding environmental condition cleared in the chassis • %PLATFORM-ENVMON-2-CHASSIS_OVERTEMP : Chassis ambient temperature 20.4C at or above rising T3 threshold -50.0C • %PLATFORM-ENVMON-2-CHASSIS_OVERTEMP_CLEAR : Chassis ambient temperature is normal 	DP 2101
<p>Power module syslog:</p> <ul style="list-style-type: none"> • %PLATFORM-ENVMON-2-SAT_PM_OIR : PM0/PM1 OIR alarm raised on satellite: 110 • %PLATFORM-ENVMON-2-SAT_PM_OIR : PM0/PM1 OIR alarm cleared on satellite: 110 <p>Fantray module syslog:</p> <ul style="list-style-type: none"> • %PLATFORM-ENVMON-2-SAT_FT_OIR : FT0/FT1 OIR alarm raised on satellite: 110 • %PLATFORM-ENVMON-2-SAT_FT_OIR : FT0/FT1 OIR alarm cleared on satellite: 110 	DP 2109

* Newly added SFP Syslogs under Lightspeed card will not associate to the interface level but to the managed element due to HW defect [CSCvv80204](#)

Cisco Network Convergence System 540 Series Routers (NCS 540) — Supported Syslogs

Support for	Added in
<ul style="list-style-type: none"> • %ROUTING-MLDP-5-BRANCH_ADD • %ROUTING-MLDP-5-BRANCH_DELETE 	DP 2003

Cisco Network Convergence System 5500 Series Routers (NCS 5500) — Supported Syslogs

Support for	Added in
<ul style="list-style-type: none"> • %ROUTING-MLDP-5-BRANCH_ADD 	DP 2003
<ul style="list-style-type: none"> • %ROUTING-MLDP-5-BRANCH_DELETE 	

Supported Traps

Cisco ASR 5000—Supported Traps

Support for	OID	Added in
starRCMServiceStart	.1.3.6.1.4.1.8164.2.1414	DP 2005
starRCMServiceStop	.1.3.6.1.4.1.8164.2.1415	DP 2005
starUPlaneTsServiceChainPathNotSelected	.1.3.6.1.4.1.8164.2.1416	DP 2005
starUPlaneTsServiceChainUp	.1.3.6.1.4.1.8164.2.1417	DP 2005
starUPlaneTsServiceChainDown	.1.3.6.1.4.1.8164.2.1418	DP 2005
starUPlaneTsMissConfiguration	.1.3.6.1.4.1.8164.2.1419	DP 2005
starRCMConfigPushCompleteReceived	.1.3.6.1.4.1.8164.2.1420	DP 2005
starRCMConfigPushComplete	.1.3.6.1.4.1.8164.2.1421	DP 2005
starX3MDConnDown	.1.3.6.1.4.1.8164.2.1422	DP 2007
starX3MDConnUp	.1.3.6.1.4.1.8164.2.1423	DP 2007
starRCMTCPDisconnect	.1.3.6.1.4.1.8164.2.1424	DP 2007
starRCMTCPConnect	.1.3.6.1.4.1.8164.2.1425	DP 2007
starRCMChassisState	.1.3.6.1.4.1.8164.2.1426	DP 2007
starRCMChassisReload	.1.3.6.1.4.1.8164.2.1427	DP 2007
starDiameterEndPointPriorityPeersUnAvailable	.1.3.6.1.4.1.8164.2.1428	DP 2101
starDiameterEndPointPriorityPeersAvailable	.1.3.6.1.4.1.8164.2.1429	DP 2101
starDiameterEndPointNonPriorityPeersUnAvailable	.1.3.6.1.4.1.8164.2.1430	DP 2101
starDiameterEndPointNonPriorityPeersAvailable	.1.3.6.1.4.1.8164.2.1431	DP 2101
starSxPeerUnsupportedVersion	1.3.6.1.4.1.8164.2.1432	DP 2103
starSxPeerUnsupportedVersionClear	1.3.6.1.4.1.8164.2.1433	DP 2103
starSRPPeerUnsupportedVersion	1.3.6.1.4.1.8164.2.1434	DP 2103
starSRPPeerUnsupportedVersionClear	1.3.6.1.4.1.8164.2.1435	DP 2103

Support for	OID	Added in
sessionUnevenDistribution	.1.3.6.1.4.1.8164.2.1436	DP 2111
sessionUnevenDistributionClear	.1.3.6.1.4.1.8164.2.1437	DP 2111
starSgiReachabilityAPNDown	.1.3.6.1.4.1.8164.2.1438	DP 2111
starSgiReachabilityAPNUp	.1.3.6.1.4.1.8164.2.1439	DP 2111

Cisco ASR 9000 — Supported Traps

Support for:	OID	Added in
Enhanced PIM Neighbor trap*	.1.3.6.1.4.1.9.10.119.1.1.3.1.4	DP 2003

* PIM neighbor trap (.1.3.6.1.4.1.9.10.119.1.1.3.1.4) requires the presence of routing entry for its neighbor. If the routing entry is not present, it will match the default route entry (0.0.0.0). When there is no default route available under Routing Entity, PIM Neighbor lost trap will be processed successfully, and it will be associated to the “ManagedElement” level.

Cisco IOS and Cisco IOS - XE— Supported Traps

Support for	OID	Added in
cbgpPeer2FsmStateChange	.1.3.6.1.4.1.9.9.187.0.7	DP 2005

Support for Change and Configuration Management in 5.3

Change and Configuration Management is enhanced through device packs and point patches to support the following:

Cisco Catalyst 9300 Series Switches

Device Series	Software Version/Feature	Provided/Added in:
CAT 9300	Cisco IOS-XE 16.9.4	DP 2005

Features	Support	Level of Support/Limitations
Backup	Yes	<ul style="list-style-type: none"> ✓ Running-config ✓ Startup-config
Restore	Yes	<ul style="list-style-type: none"> ✓ Running-config – supports both overwrite and merge mode ✓ Startup-config – supports overwrite mode ✓ Edit and restore / Edited Config Archive restore: Configuration deploy mode will be “Merge” by default. Configuration deploy mode will be “Overwrite” by default for “startup-configuration”
Change log	Yes	

Features	Support	Level of Support/Limitations
Configuration Export	Yes	
Distribution	Yes	
Installadd	NA	
Activation	Yes	
Deactivate	Yes	
Remove	NA	
Rollback	NA	
Commit	NA	
Image Baseline	Yes	
Synchronize	Yes	
ISSU Support	No	
Supported Protocol: TFTP, SCP, FTP		